

SONY®

Service Bulletin

NO:HIFI1-99-028R1

SUBJECT: No Sound

DATE: SEP 2000

MODEL (S): TA-E9000ES

Please discard the previous issued bulletin: HIFI1-99-028

Symptom : No Sound.

Cause : Oscillation may cause Q108, Q109 and R124 to break down.

Solution : Apply the following changes on the Power Board.

1. add a 100pF capacitor (1-163-117-11) in parallel with R153.
2. Replace R124 with 4.7k, 1W resistor (1-215-873-11)

