

SONY.

**Car Stereo
Service Bulletin**

CSA-14

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: XR-4400/5600/U110

No. 316

Subject: Does Not Receive Radio Broadcasts

Date: March 18, 1994

Symptom:
(21)

In some units, the antenna plug shorts to the chassis, causing the unit to not receive radio broadcasts.

Solution: If the customer complains of this problem, install a spacer on the chassis as shown below.


REF	DESCRIPTION	PART NUMBER
-	SPACER	3-564-759-01

Applicable Models

XR-4400: up to 74,900

XR-5600: up to 34,300

XR-U110: up to 87,600

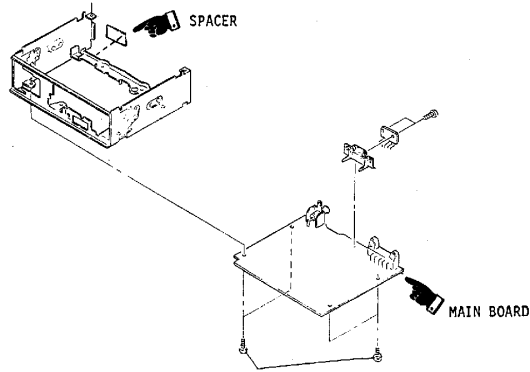

Reference: Technical News ME-93037
Autoflagged - NO



PRINTED IN USA
CSA-14394-5