

CONFIDENTIAL

CSI-111

Sony Service Company National Technical Services A Division of Sony Electronics Inc. Park Ridge, New Jersey 07656

Service Bulletin Computer Monitors

Model: CPD-200ES No. 197

Subject: CRT Socket J001 Label Incorrect Date: June 1, 1998

Symptom:

(116C) The imprinted labels for the focus lead colors on J001 on the A Board are incorrect.


The Red colored Focus Lead from the FBT is connected at the J001 input marked "BLACK". The Black colored Focus Lead from the FBT is connected at the J001

input marked "RED". Refer to illustration below.

Solution: Please note the following when the FBT, J001, or the A Board are replaced. The correct Focus Lead connection is with the wire jacket colors reversed from the

imprinted labels on the J001 CRT Socket. Refer to illustration below.

J001 CRT Socket Focus Leads on the A Board

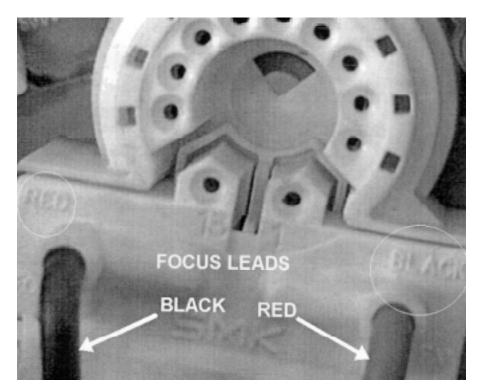

Reference: FPR T0337; J. Grose PRINTED IN USA