

**Model:** CPD-200ES**No.** 204**Subject:** Picture Shaking; Faulty C620**Date:** June 15, 1998**Symptom:**  
**(3350)**

The picture appears to be shaking after the unit has been in use for a period of time. C620, the AC rectifier filter capacitor in the power supply circuits may be faulty.

**Solution:**

If the customer complains of this symptom, then please check C620 on the D Board. C620 may appear to be slightly expanded at the top. Replace C620 if necessary.

REF	DESCRIPTION	PART NUMBER
C620	390 $\mu$ F 20% 400V	1-109-984-11

Please refer to illustration below.

