

SONY[®]

Sony Service Company
National Technical Services
A Division of Sony Electronics Inc.
Park Ridge, New Jersey 07656

CONFIDENTIAL

Service Bulletin
Hi-Fi Products

CSA-13

Model: HCD-H771, HCD-H991AV, HCD-RX70, HCD-RX100AV, HCD-W55

No. 539

Subject: No CD Loading

Date: July 15, 1997

Symptom:

(61) The CD tray will not open.

Solution: Replace the Loading Motor IC BA6286N (8-759-274-09).

Applicable Models: Sets equipped the BA6286N Driver IC with lot numbers 708H88, 709H90, 708H56 or 709H91 printed on the IC.

