

CONFIDENTIAL

CSV-5

Sony Service Company National Technical Services A Division of Sony Electronics Inc. Park Ridge, New Jersey 07656

Service Bulletin Multi-Disc Players


Model: DVPS-360, DVPS-560D No. **65**


Subject: REPLACING THE OPTICAL PICKUP Date: June 15, 2000

Symptom:

(****) Some of the Optical Pickup replacement KHM-220AAA/J1RP may need reinforcement boards to be cut smaller. The reinforced board may interfere with the Optical Pickup. If this is the case, please check and do the following.

Solution: Please confirm the reinforced board that is attached to the 23 Pin- Flexible Cable, which is connecting to the Optical Pickup. Cut the part of the reinforced board shown below. When cutting, avoid damage to other signal lines, cut only the board. After cutting, it has to be 10.0 - 11.5 (mm) if you measure the length of the reinforced board from the point of the Flexible Cable.

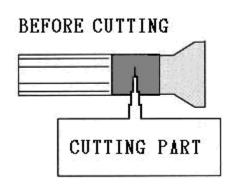

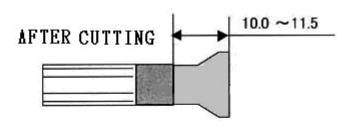

Part Number A-6062-397-A 8-820-081-03 8-820-081-09 **Part Name**

OPTICAL PICKUP KHM-220AAA/J1RP OPTICAL PICKUP KHM-220AAA/J1RP OPTICAL PICKUP KHM-220AAA/J1RP

Reference: HVDK00E003

PRINTED IN USA