

**Model:** DVP-S360, DVP-S560D, DVP-S570D**No.** 77**Subject:** SYSCON ROM Update**Date:** December 19, 2001**Symptom:  
(1185)**

1. When playing Dual Layer Disc, the video may sometimes stop or is not played back normally if the Dual Layer Disc is not compatible.

2. When playing a .DVD Linear-PCM (Standard Audio of a DVD) after playing a Normal music CD (CDDA), the sound may sometimes disappear.

3. Sometimes, a CD/DVD/Video-CD will not play. When this occurs, "No Disc" or "C:13:00" errors appear on the display.

**Note: In the case of Symptom No.3, it is necessary to perform the actions below AND also to perform the actions in Service Bulliten # 68 if they have not been previously performed.**


**Solution:**

1. Replace the SYSCON ROM with the improved version. Ccheck the Model Type from the table below. Each Model Type has a different part number for the SYSCON ROM.

MODEL TYPE	TARGET MODEL & DESTINATION
TYPE 1	<b>DVP-S350: U2</b> <b>DVP-S363: U2</b> <b>DVP-S360: U2</b> DVP-S365: PX
TYPE 7	DVP-S535D: AU / E / CED / CEK DVP-S536D: CED / CEK              DVP-S545D: CN / TW <b>DVP-S560D: E / CA / U2</b> DVP-S565D: PX
TYPE 8	<b>DVP-S570D: UC</b> DVP-S735D: AU / CED / CEK / E / EA / RU DVP-S745D: CN / HK / KR / SP / TW

## &lt; How to check the DVD players current revision. &gt;


- Place the DVD Player: in STANDBY Mode.
- Press first the TITLE Key, then the CLEAR Key, then the POWER Key on the emote commander.
- Find "Model Name" on the bottom of menu screen.  
"Model Name" should be shown like "DPX13XXX".

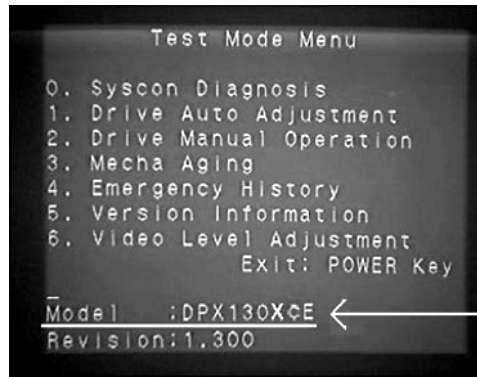

2. Replace IC 106 with the SYSCON ROM from the table below.

MODEL TYPE	Ref. No.	PART NUMBER	DESCRIPTION
TYPE 1	IC106	8-759-828-72	IC MR27V1602E-39TPZ060
TYPE 7	IC106	6-800-101-01	IC MR27V3202E-A4TPZ060
TYPE 8	IC106	6-800-102-01	IC MR27V3202F-A5TPZ060

**MB-86 Board (Side B)**

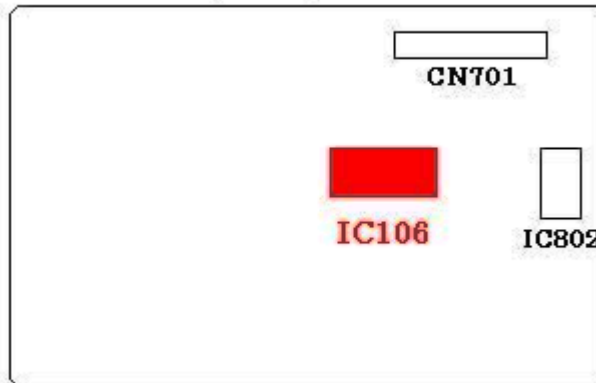

3. Confirm CHECK SUM by using the SYSCON DIAGNOSTIC in TEST MODE. Each model has a different CHECK SUM as shown in the table below.

MODEL TYPE	CHECK SUM	SYSCON ROM VERSION
TYPE 1	3B9F	Ver. 2.1
TYPE 7	4ECE	Ver. 1.6
TYPE 8	21EF	Ver. 1.6

4. Perform all Servo Adjustments after exchanging IC106.