

# SONY®

## Service Bulletin

NO: CS-96-027

SUBJECT: REPAIR OF BROKEN PILOT LAMP

DATE: DECEMBER 1996

MODEL (S): GEN CS

Pilot Lamp is open, this will make the backlighting inoperative.

Change all Pilot Lamps to the improved listed in table below.

Replaement No.	Description	Part Number	Remark
1	Pilot Lamp	1-517-181-12	Green
2	Pilot Lamp	1-517-181-22	Amber
3	Pilot Lamp	1-517-181-32	Yellow

### APPLICABLE MODELS AND SERIAL NUMBERS:

Model	Serial Number	Applicable Ref. No. & Replacement Number
CDX-5070	~ 101100	PL801, PL802, 2
CDX-5270	~ A67100	PL850, PL851, 1 PL801, PL802, 2
CDX-5470	~ A35500	PL850, PL851, 1 PL801, PL802, 2
CDX-600DSP	~ 11600	PL802, PL804, 1 PL801, PL803, 2
MDX-400	~ 13600	LAMP MOUNT, 3
XR-340	~ 29200	PL701, PL702, 2
XR-430	~ 17800	PL711, PL712, 1
XR-U700	~ 16400	PL703, PL704, PL706, 2 PL701, PL702, PL705, 1
XR-U800	~ 24300	PL703, PL704, PL706, 2

SONAM 408  
ME96020