

# SONY® Service Bulletin

NO: ME3-99-003

**SUBJECT: MECHANICAL DECK GETS LOCKED**

**DATE: JANUARY 1999**

**MODEL (S): MDX-61**

**SYMPTOM:** Pushing the Reset Button during disc changing may cause the mechanical deck to get locked.

**SOLUTION:**



Apply the following changes on the Main Board.

- Replace IC600 CXP84340-043 with CXP84648-005 (8-752-882-95)
- Remove R616.
- Add R635 0 Ω Metal Chip (1-216-295-11).
- Remove R636.
- Add D603 MA728 (8-719-421-27).

Apply the following changes on the Power Board.

- Remove C909.
- Add C912 2.2μF 10V Tantalum (1-135-149-21).  
Two versions of Power Board exist, one with and one without solder lands for C912.  
Mount C912 at the mounting location of C909 if no separate solder lands are available.

**Applicable Serial Numbers: 1 to 10160**

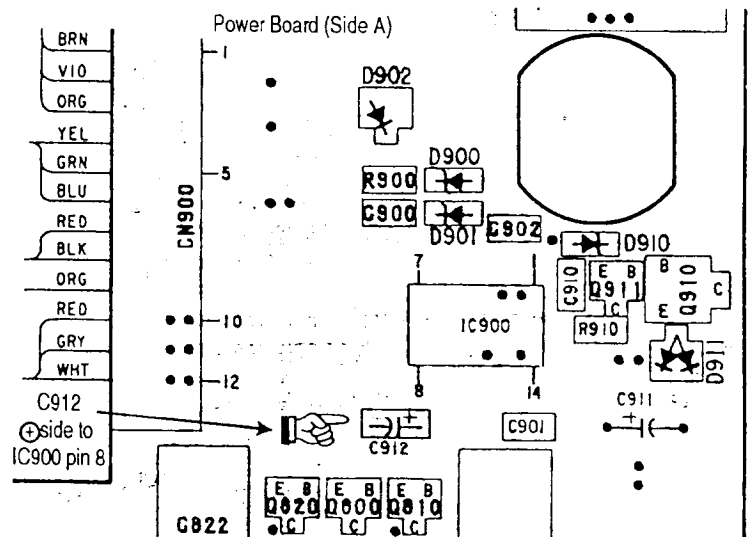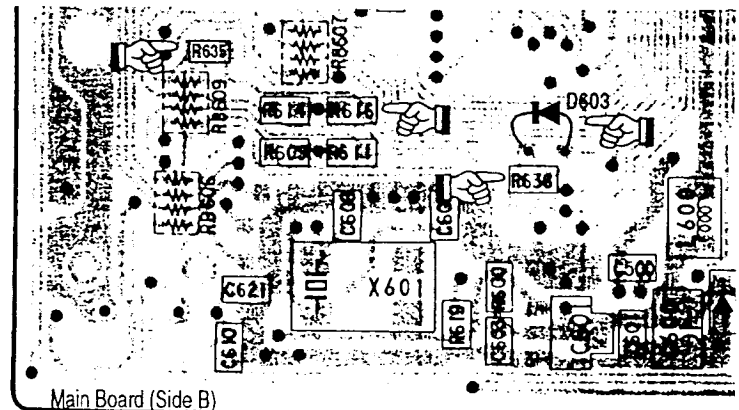

ME02997R  
ME97017

Sony of Canada Ltd.

115 Gordon Baker Road, Toronto, Ontario M2H-3R6  
NATIONAL LAB - CONSUMER SERVICE