

# SONY® Service Bulletin

NO: HIFI1-99-013

**SUBJECT:** NO SOUND OUTPUT

**DATE:** OCT 1999

**MODEL (S):** HCD-MDX10/RXD5/RXD7/RXD10AV/RXD80/W300/W900AV

**Symptom:** The "PROTECT" indication appears when switching on the set immediately after plugging in the AC power cord. The symptom does not reappear when switching the power off and back on.

**Cause:** Malfunctioning microcomputer IC501.

**Solution:** On the Main Board, replace IC501 as listed below.

Model	Former Part Number	New Part Number
HCD-RXD10AV HCD-RXD5	8-759-588-90	8-759-639-96 M30622MA-A16FP
HCD-W900AV	8-759-597-15	
HCD-W300 HCD-RXD7	8-759-571-18	
HCD-RXD80	8-759-588-89	
HCD-MDX10	8-759-583-18	8-759-641-61 M30620MC-A15FP

Sony of Canada Ltd.

115 Gordon Baker Road, Toronto, Ontario M2H-3R6  
NATIONAL LAB - CONSUMER SERVICE

AU99055  
AU99049  
AU05799  
AU06999