

**Service Bulletin**

**SUBJECT: UNIT POWERS OFF DURING PLAYBACK OR RECORDING**

**DATE: APRIL 1997**

**MODEL (S): MZ-R3**

**MT-MZR3-109**



**FOR INTERNAL USE ONLY**

**CAUSE:** Failure of the Open/Close Switch S817.

**SOLUTION:** •Replace the Open/Close Switch S817.

•Replace the 0.01 $\mu$ F Chip Capacitor C825 on the Main Board with a 0.22 $\mu$ F Chip Capacitor.

Ref.	Former		New	
	Description	Part Number	Description	Part Number
S817	SWITCH, PUSH (1 KEY)	1-572-467-31	REPLACE WITH SAME TYPE	
C825	0.01 $\mu$ F CHIP	1-164-118-11	0.22 $\mu$ F CHIP	1-115-467-11

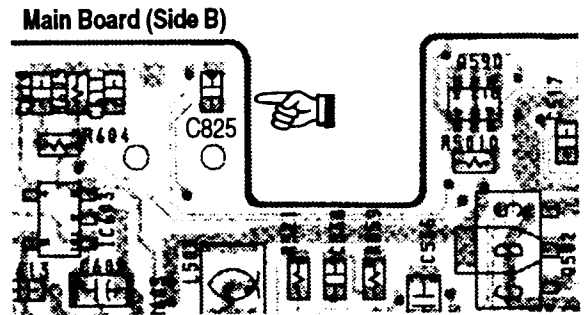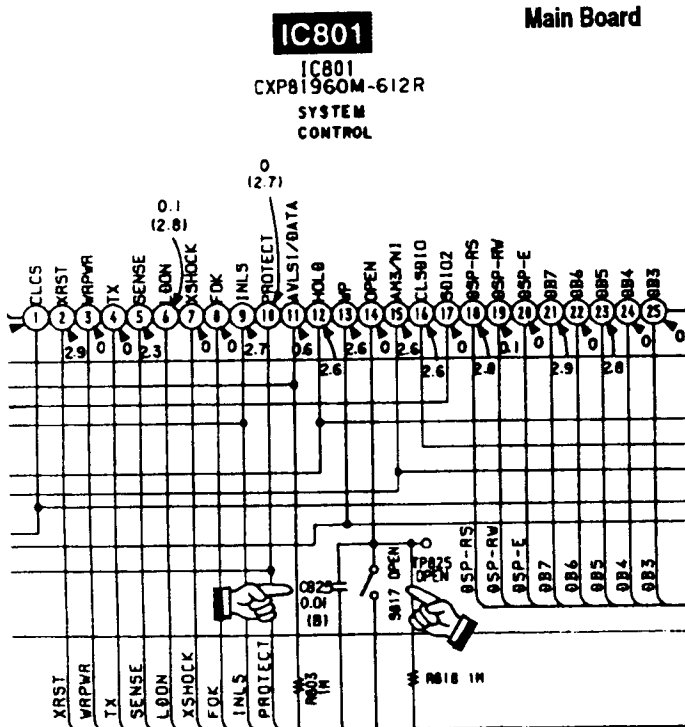

GA00497  
GA96039  
SONAM #442, 518