

SONY® Service Bulletin

NO: HIF12-99-004


SUBJECT: CAUTION WHEN REPLACING BD BOARD

DATE: JANUARY 1999

MODEL (S): MDS-JE320/JE510/PC1/S38/S39

On the BD Board (A-4699-770-A) supplied, a solder bridge may be missing between TP26 and TP27.

Check side B of the supplied BD Board and, if necessary, add the missing solder bridge before mounting the board. A missing solder bridge will prevent the set from recording properly.

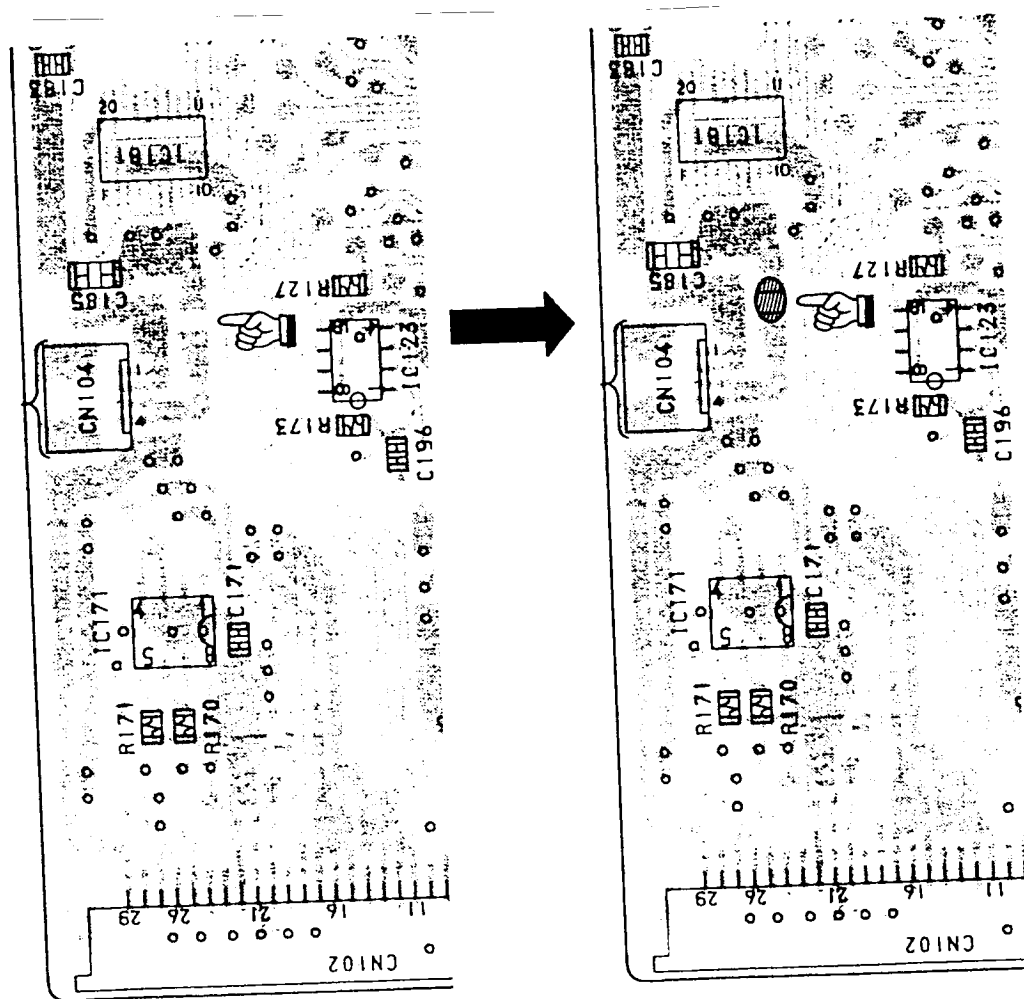

AU03598

Sony of Canada Ltd.

115 Gordon Baker Road, Toronto, Ontario M2H-3R6
NATIONAL LAB - CONSUMER SERVICE