

# SONY®

## Service Bulletin

NO: HIFI2-99-005

**SUBJECT:** INCORRECT UTOC UPDATING

**DATE:** JANUARY 1999

**MODEL (S):** MDS-JE500/JE510/JE700/S38

**SYMPTOM:** The UTOC may be updated incorrectly which may cause the following symptoms:

- The remaining time after recording is abnormally high.
- A new recording erases the previous recording.
- Playing a disc recorded with the above mentioned models may cause the message Disc Errors to appear on some portable models.

**CAUSE:** Malfunctioning microprocessor.

**SOLUTION:** Replace the microprocessor as listed below.

MODEL	REF.	FORMER		NEW	
		PART NUMBER	DESCRIPTION	PART NUMBER	DESCRIPTION
MDS-JE500	IC316	8-759-451-86	Ru8X11AMF-0109	8-759-565-35	Ru8X12TF-0128
MDS-JE700	IC401	8-759-476-19	Ru8X11AMF-0116	8-759-565-32	Ru8X12AMF-0125
MDS-JE510	IC316	8-759-451-86	Ru8X11AMF-0109	8-759-565-35	Ru8X12TF-0128
MDS-S38	IC401	8-759-476-18	Ru8X11AMF-0115	8-759-565-36	Ru8X12TF-0129

Sony of Canada Ltd.

115 Gordon Baker Road, Toronto, Ontario M2H-3R6  
NATIONAL LAB - CONSUMER SERVICE

AU04198  
AU98030R1