

SONY® Service Bulletin

NO: HIFI2-99-006

SUBJECT: INTERMITTENT PLAY/RECORD/LOAD/UNLOAD

DATE: JANUARY 1999

MODEL (S): MZ-R50

SYMPTOM: The unit arrives with the customer complaint of intermittent loading/unloading/recording or playback.

SOLUTION: Check the Motor Flexible Board (ref. #136, P/N 1-667-211-11) for damage near CN702. The damage is a result of the flexible board contacting inductor L512, which is located on the main board. Replace the damaged Flexible Board with a new part, and add felt cushion material to the replacement Flexible board where the damage was observed. Cover the top of inductor L512 with the cushion material.

Reassemble the unit.

DESCRIPTION	PART NUMBER
135MM X 205MM,CUSHION	3-831-441-11

Sony of Canada Ltd.

115 Gordon Baker Road, Toronto, Ontario M2H-3R6
NATIONAL LAB - CONSUMER SERVICE

SONAM 484