

# SONY® Service Bulletin

NO: HIFI2-99-010

**SUBJECT:** DIM LIGHT/LOADING MOTOR MALFUNCTION

**DATE:** AUGUST 1999


**MODEL (S):** DHC-MD7, MDS-M9

**SYMPTOM:** The customer complains of a dim light or the unit arrives with a loading motor IC malfunction.

**SOLUTION:** Replace C113 and C114 on the POWER BOARD with improved versions.

REF	DESCRIPTION	PART NUMBER
--	REG M'T KIT	A-4724-432-A

Cut the foil pattern from CN223 (see diagram). Attach the wires from the REG M'T to the digital board as shown.

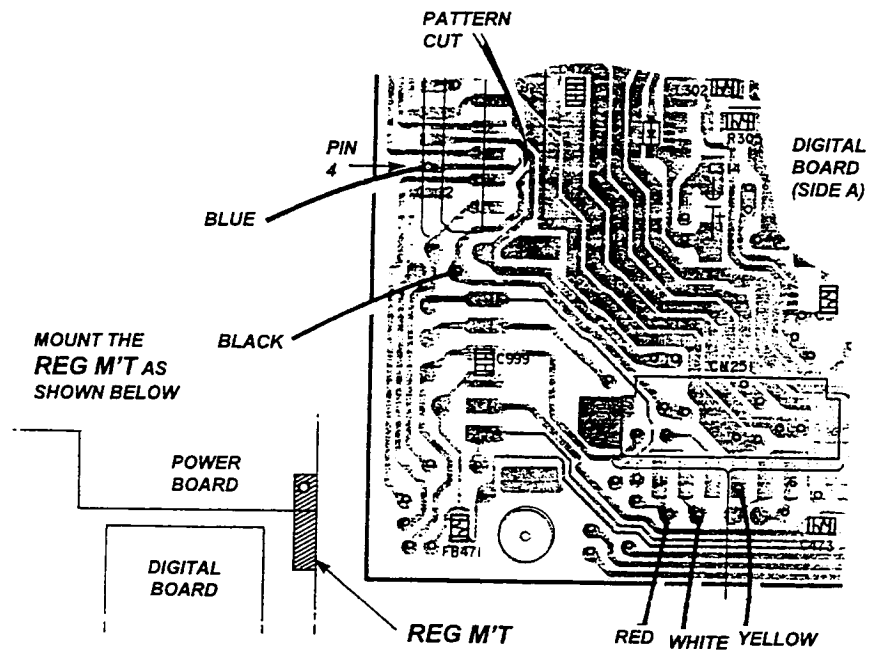

SONAM 588  
AU98046

Sony of Canada Ltd.

115 Gordon Baker Road, Toronto, Ontario M2H-3R6  
NATIONAL LAB - CONSUMER SERVICE