SONY® Service Bulletin

NO: HIFI2-99-012

SUBJECT: ERROR MESSAGE "C-13 DISC ERROR" WHEN USING A NEW DISC

DATE:

AUGUST 1999

MODEL (S):

MDS-JB920/JE520


SYMPTOM: The customer complaint states the unit displays error message "C-13 Disc Error" when

using a new disc.

SOLUTION: Replace the holder assy P/N (A-4680-118-H). After replacing the holder assembly test the

continuity between the chassis at the holder Assy and the main board ground. (must be less than 200 ohms). If continuity reading is higher than 200 ohms reform the board spring (see

picture).

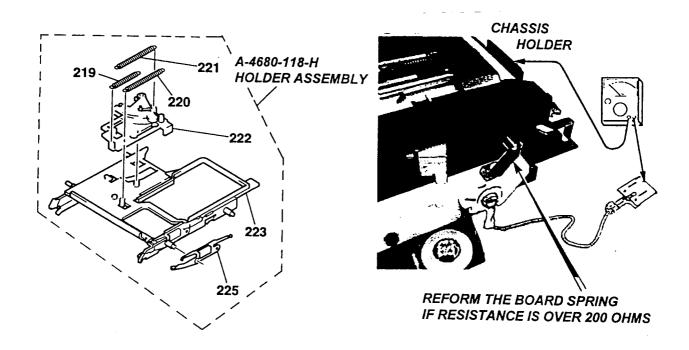

SONAM 589 AU98049