

SONY®

Service Bulletin

NO:HIFI2-01-001

SUBJECT: Noise Recorded in Analog Recording Mode


DATE: February 2001

MODEL (S): MDS-JE330, MDS-S40

Symptom: The customer complains of noise in the audio when recording in analog recording mode.


Solution: Perform the following:

Remove capacitors C301, C302 and C303 from the main board.

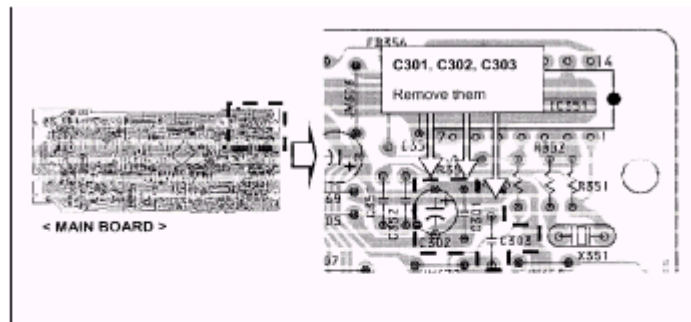

Add the following:

REF	DESCRIPTION	PART NUMBER
NA	CAPACITOR 10 PF	1-162-232-31
NA	CAPACITOR 0.1 UF	1-164-159-31

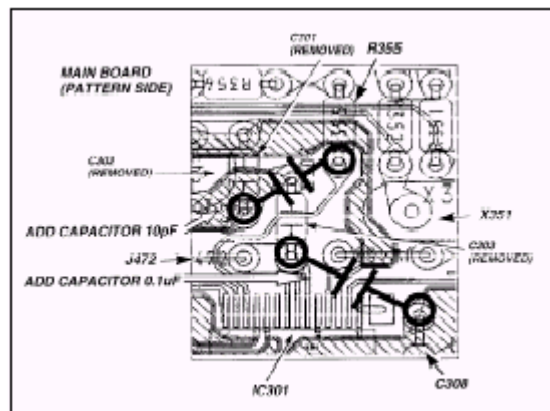

AU-00048
SONAM646