

SONY®

Service Bulletin

NO:HIFI2-01-006

SUBJECT: Intermittently Will Not Power ON

DATE: April, 2001

MODEL (S): MDS-JE440, MDS-JE640


Symptom: Customer complaint states the unit intermittently will not power ON.

Solution: Replace the following component:

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
C400	3300UF/16V	1-126-936-51	10000UF/16V	1-126-939-11

1. Replace Ref# C400 CAPACITOR, 33000uF /16V, with CAPACITOR, 10000uF / 16V.
2. Secure the replacement CAPACITOR with SONY BOND (7-432-912-45).

Applicable Serial Numbers : 4770001~4771490

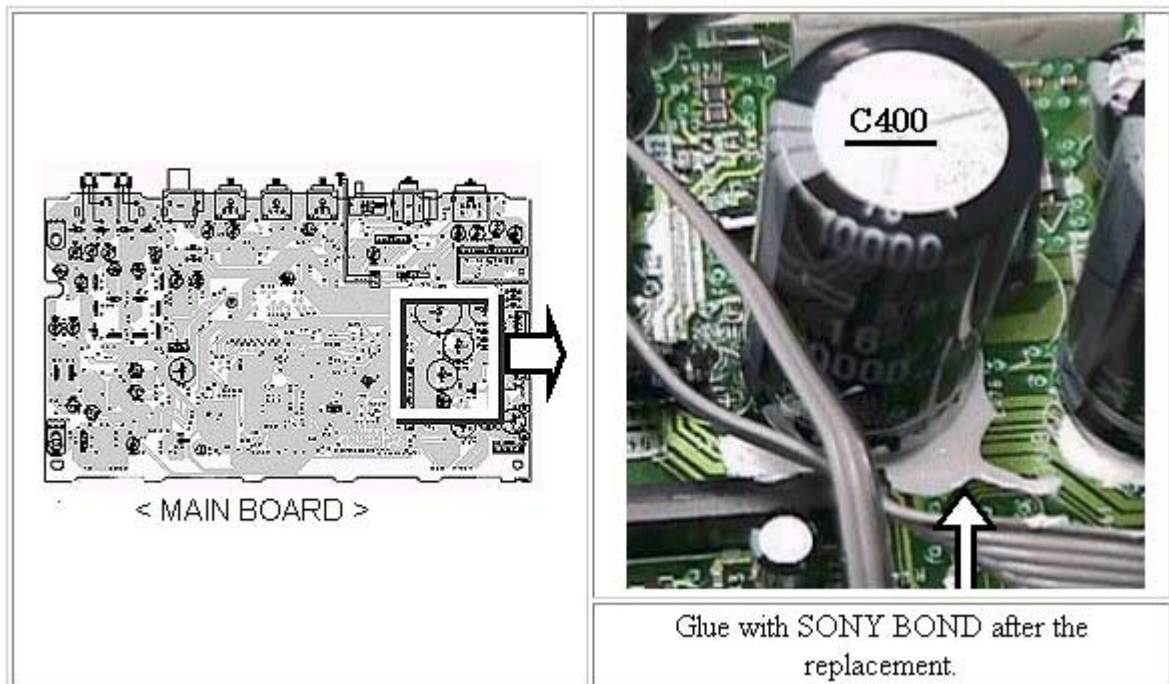

SONAM653
AU00055R1

Sony of Canada Ltd.

115 Gordon Baker Road, Toronto, Ontario M2H-3R6
NATIONAL LAB - CONSUMER SERVICE