

SONY®

Service Bulletin

NO:ME2-01-010

SUBJECT: NO SOUND**DATE: November 2001****MODEL (S): See below**

Models: CDX-4000X, CDX-4005, CDX-C5000X, CDX-C5005, CDX-C7000X, CDX-M600
XR-C5300X, XR-C5305, XR-C5500, MDX-C6500X, MDX-C8500X.

Symptom: Power IC is broken to make no output from speakers.

Cause: When large sound is output from the large size speakers, the reverse current from the voice coils may destroy the output transistors of power IC.

Solution: Change the power IC from TA8268HS to TA8268AH.

Description	Former	New	P/N of New Part
Power IC	TA8268HS	TA8268AH	8-759-827-14

[S/N RANGE]					
Model name	Destination	Serial No.	Model name	Destination	Serial No.
CDX-4000X	U,CA	ALL	XR-C5300X	U,CA	ALL
CDX-4005	U	ALL	XR-C5305	U,CA	ALL
CDX-C5000X	U,CA	ALL	XR-C5500	U,	ALL
CDX-C5005	U	ALL	MDX-C6500X	U,	ALL
CDX-C7000X	U	ALL	MDX-C8500X	U	ALL
CDX-M600	U	ALL			

ME01XAU519

Sony of Canada Ltd.

115 Gordon Baker Road, Toronto, Ontario M2H-3R6
NATIONAL LAB - CONSUMER SERVICE