

Repair tips

SUBJECT: Unit will not record TOC: Error code '434'

DATE: 05/16/2002

MODEL (S): MZ-R500/R700/R900

Symptom: Unit will not record TOC. All else seems to work OK. (Recording does not work of course, but it looks like it is.) Error code '434' appears at the end of alignment.

Solutions: Error '434' appears to refer to the 'PIT' area. This is a Spindle motor fault. Possibly the height of the spindle motor is low. Normal spindle thickness at the center is exactly 6mm. Units with a less than 6mm spindle are showing this fault.

Submitted By: Brian @ PHD Electronics Ltd.

Sony of Canada Ltd.

115 Gordon Baker Road, Toronto, Ontario M2H-3R6
NATIONAL LAB - AVIT