

Repair Tips

SUBJECT: Erases discs, does not play MO discs

: June/2002 MODEL (S): MZ-R700PC

Symptom: Erases discs, does not play MO discs. Unit shows a "138" error right at the end of setup.

Solution: Replacement of the chassis and the spindle motor has corrected this problem. **Spindle motor by itself usually will NOT correct the fault**. PCB's and chassis have been swapped to confirm this. Fault is due to physical impact on a soft surface.

Submitted By : Brian Street, PHD Electronics, BC /wd

Sony of Canada Ltd.

115 Gordon Baker Road, Toronto, Ontario M2H-3R6 NATIONAL LAB – AVIT