

# Computer Monitors Service Bulletin

CSI-111

Sony Service Company - Technical Services  
A Division of Sony Electronics Inc.  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** GDM17SE1, GDM20SE1

**No.** 85

**Subject:** Circuit Improvement

**Date:** February 21, 1995

**Symptom:**  
(231) Countermeasure against possible arcing

**Solution:** Please perform the following changes:

1. Remove R636 from the G-Board.
2. Add new Resistor (220K $\Omega$ , 1/2 Watt, P/N: 1-202-842-11) between R636 and C619 lands as illustrated below.
3. Fix resistor in place by applying RTV.



