

**SONY.**

# Computer Monitors Service Bulletin

**CSI-111**

Sony Service Company - Technical Services  
A Division of Sony Electronics Inc.  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** GDM17SE1, GDM20SE1

**No.** 71

**Subject:** Deflection Circuit Improvement

**Date:** November 24, 1994

**Symptom:**  
(111)

No operation, Front Panel LEDs are flashing

**Solution:** Perform the following on the D-Board:

- 1 Check Q-511, Q-512, PS-500 (Fuse link) and C-548.
- 2 Replace the above items if necessary.

ITEM	DESCRIPTION	PART NUMBER
Q-511	IRFI9630S-LF Transistor (GDM17SE1)	8-729-023-09
Q511	IRFI9630GS-LF Transistor (GDM20SE1)	8-729-015-28
Q-512	2SC3997-CC Transistor	8-729-023-08
PS-500	1.6 Amp Fuse Link	1-532-841-21
C-548	220 $\mu$ F, 20%, 63V Electrolytic Capacitor	1-104-796-11

- 3 Remove C-511.
- 4 Remove D-504 and mount it to the C-511 lands.

