

# Computer Monitors Service Bulletin

**CSI-111**

Sony Service Company - Technical Services  
A Division of Sony Electronics Inc.  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** GDM20SE1

**No.** 77

**Subject:** Preventive Measure to protect R-850

**Date:** January 9, 1995

**Symptom:**

(111) Possible Shut down

**Solution:**

To prevent the possibility that R-850 on the D-Board will open, perform the following circuit change:

- 1 Replace C-822 with the following new part.
- 2 Replace R-850.

REF	NEW	
	DESCRIPTION	PART NUMBER
C-822	CAPACITOR (1000V, 470PF)	1-162-134-11
R-850	RESISTOR (4.7K, 1/2W)	1-202-826-00

- 3 Apply RTV to the lands indicated by stripes in the figure below:



