
Model: CCD-TR517, CCD-TRV37, CCD-TRV57, CCD-TRV67, CCD-TRV87**No. 552****Subject: Switch Failure****Date:** December 6, 2000**Symptom:****(****)**

Units behave erratically. Symptoms reported are: unit switches between CAM/VTR modes or ejects by itself.

Solution:

Replace the following switches with improved parts.

REF	DESCRIPTION	PART NUMBER
S302	PUSH – SWITCH (PLAYER)	1-771-331-51
S303	PUSH – SWITCH (CAMERA)	1-771-331-71
S251	PUSH – SWITCH (EJECT)	1-771-331-71

The new switches were improved by using gold plating rather than silver plating.