

**Model:** CCD-TR517, CCD-TRV37, CCD-TRV57, CCD-TRV67, CCD-TRV87

**No. 563**

**Subject:** IC201 Replacement

**Date:** August 7, 2001

**Symptom:**

(\*\*\*\*)

IC201 (Y/C Processor) was changed in mid production. The new part is NOT directly compatible with the original one. Additional modifications are required on the VC and DD boards.

**Solution:**

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
IC201	HG75C012FFL	8-759-599-07	HG75C012SFL	8-759-670-78

When an FFL type IC201 is replaced with an SFL type, replace the following parts on the VC and DD boards.

Board	Ref	OLD		NEW	
		Description	P/N	Description	P/N
VC-234	R248	0Ω	1-216-864-91	68Ω	1-216-807-11
	R273	1MΩ	1-216-857-91	0Ω	1-216-864-91
	R270	Not Mounted		0Ω	1-216-864-91
	R260	47KΩ	1-216-841-91	Delete	
	R263	47KΩ	1-216-841-91	Delete	
	D203	1SS357-TPH3	8-719-027-76	Delete	
	Q214	RN1104F	8-729-042-29	Delete	
	IC204	TE85R	8-759-058-58	Delete	
DD-134	R335	68KΩ	1-218-891-91	560KΩ	1-218-913-91

