

---

**Model:** DCR-TR7000, DCR-TRV103, DCR-TRV110,  
DCR-TRV310, DCR-TRV315, DCR-TRV510**No. 506****Subject:** Caution when replacing the VC-213 board.  
Two versions of the DV Interface IC301 require  
different Page C Data.**Date:** October 15, 1999**Symptom:**  
**(1170)**

There are two types of DV Interface IC303 on the VC-213 boards; one is Sony and the other is TI. Both manufacturer names are labeled on the top of the IC. Whenever the board is replaced, the proper page C, address AD data must be installed. Incorrect data will result in NO DV IN/OUT.

**Solution:**

When IC303 is Sony, verify that data 00 is at page C, address AD.  
When IC303 is TI, verify that data 02 is at page C, address AD.

