March 24, 2016



Replace Rear Door Ultrasonic Sensors

Classification Campaign Bulletin Section/Group 11 - Closures Country/Region United States

Year 2016 Model Model X Version All

Bulletin Classification: This campaign bulletin addresses a known non-safety-related condition and provides recommended technical diagnosis and repair procedures. Apply this procedure to all vehicles in the affected VIN range listed. These instructions assume knowledge of motor vehicle and high voltage electrical component repairs, and should only be executed by trained professionals. Tesla Motors assumes no liability for injury or property damage due to a failure to properly follow these instructions or repairs attempted by unqualified individuals.

Condition

On some Model X vehicles, the adhesive that secures the rear door ultrasonic sensors might be prone to early delamination, resulting in reduced rear door operation. The user can still continue to open the door by holding the door switch.

Correction

Replace the rear door ultrasonic sensors.

Correction Description	Correction	Time
SB-16-11-003 Not Applicable	S011611003	0.00
Replace Rear Door Ultrasonic Sensors	S021611003	1.55

Required Part(s): Part Number Description Quantity

1055890-00-C SENSOR, ULTRASONIC, RADIAL 2

These part numbers were current at the time of publication. Use the revisions listed or later,

unless otherwise specified in the Parts Manual.

Shop supplies:

Alcohol wipes (1054788-00-A or equivalent)

Special Tool(s): 1080580-00-A Heat Gun

1080603-00-A Infrared Thermometer

1080978-00-A Force Gauge

1080978-10-A 22 mm Diameter Adapter for Force Gauge

Procedure

Affected VIN(s) Affected Model X vehicles built before February 3, 2016.

NOTE: This is a simplified summary of the affected VIN list. Refer to the VIN/Bulletin Tracker or Customer/Vehicle profile to determine applicability of this bulletin for a particular vehicle.

For feedback on the accuracy of this document, email <u>ServiceBulletinFeedback@teslamotors.com</u>.