



## Secure 2<sup>nd</sup> Row Seat Latching Cables

**Classification** Campaign Bulletin    **Section/Group** 13 - Seats    **Country/Region** United States

**Year** 2016    **Model** Model X    **Version** All

**Bulletin Classification:** *This campaign bulletin addresses a known non-safety-related condition and provides recommended technical diagnosis and repair procedures. Apply this procedure to all vehicles in the affected VIN range listed. These instructions assume knowledge of motor vehicle and high voltage electrical component repairs, and should only be executed by trained professionals. Tesla Motors assumes no liability for injury or property damage due to a failure to properly follow these instructions or repairs attempted by unqualified individuals.*

### Condition

On some vehicles, the latching cables inside the LH and RH 2nd row seats are not secured, and may be visible to occupants during some seat use cases.

### Correction

Use a cable tie to secure the latching cables together.

Correction Description	Correction	Time
SB-16-13-001 Not Applicable	S011613001	0.00
Secure 2 <sup>nd</sup> Row Seat Latching Cables	S021613001	0.05

Required Part(s):	Part Number	Description	Quantity
	1012486-00-B	CABLE TIE 2.5 MM WIDTH, BLACK	1

These part numbers were current at the time of publication. Use the revisions listed or later, unless otherwise specified in the Parts Manual.

## Procedure

1. Gently lift the bottom corners of the 2<sup>nd</sup> row seat lower cushion (Figure 1), then gently pull up on the bottom corners of the cushion (Figure 2) to expose the seat internals.

**NOTE:** The cushion is secured using hook-and-loop material.

**⚠ CAUTION:** Do not remove the cushion from the seat; the seat heater harness remains connected during this procedure (Figure 3).

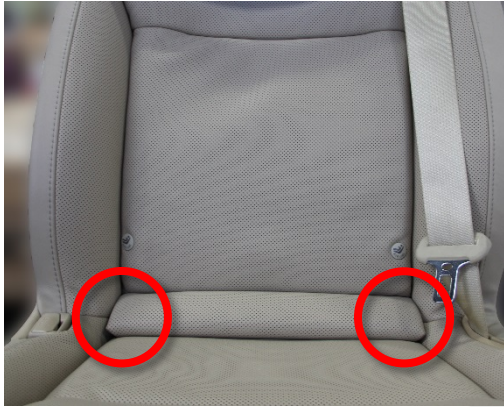


Figure 1



Figure 2



Figure 3

2. Identify the seat latching cables (Figure 4).

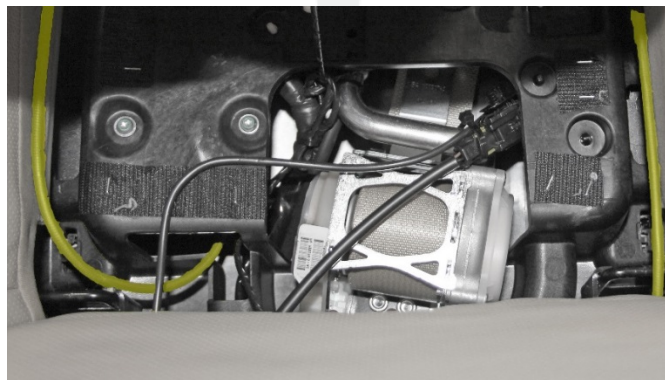
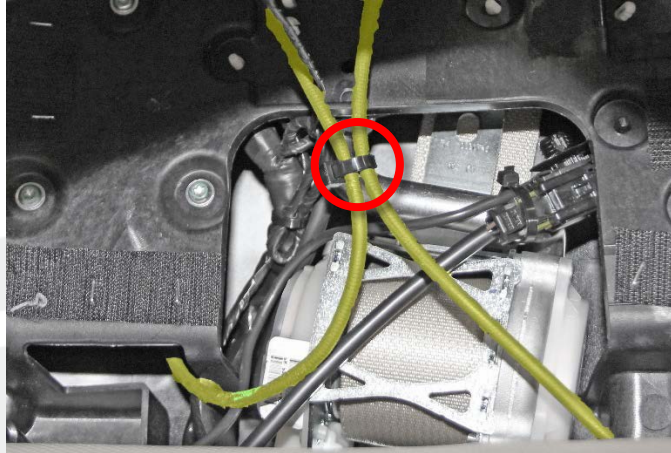


Figure 4 (Latching cables highlighted)

3. Gently pull both latching cables toward the center of the seat, then use a cable tie to loosely secure the latching cables together (Figure 5).

**⚠ CAUTION:** Do not fully tighten the cable tie.



**Figure 5 (Latching cables highlighted)**

4. Remove any excess tie. Ensure that the ratchet faces the rear of the vehicle.
5. Reinstall the seat cushion.
6. Repeat steps 1- 5 on the RH 2<sup>nd</sup> row seat.

---

**Affected VIN(s)** Affected Model X vehicles built before January 1, 2016.

**NOTE:** This is a simplified summary of the affected VIN list. Refer to the VIN/Bulletin Tracker or Customer/Vehicle profile to determine applicability of this bulletin for a particular vehicle.

For feedback on the accuracy of this document, email [ServiceBulletinFeedback@teslamotors.com](mailto:ServiceBulletinFeedback@teslamotors.com).