

Replace Lower Rear Control Arm Assemblies

Classification	Campaign Bulletin	Section/Group	31 - Suspension	Country/Region	Canada, Austria, Germany, and Norway
Years	2013, 2014	Model	Model S	Version	All

Bulletin Classification: This campaign bulletin addresses a known non-safety-related condition and provides recommended technical diagnosis and repair procedures. Apply this procedure to all vehicles in the affected VIN range listed. These instructions assume knowledge of motor vehicle and high voltage electrical component repairs, and should only be executed by trained professionals. Tesla assumes no liability for injury or property damage due to a failure to properly follow these instructions or repairs attempted by unqualified individuals.

This Service Document supersedes SB-19-31-001 R1, dated 17-May-19. Each content change is marked by a vertical line in the left margin. Discard the previous version and replace it with this one.

Condition

On certain Model S vehicles, either lower rear control arm might crack, causing excessive negative camber of the rear suspension.

Correction

Replace both LH and RH lower rear control arm assemblies with updated parts. Perform an alignment check and, if necessary, adjust.

Correction Description		Correction	Time
SB-19-31-001 Not Applicable		S011931001	0.00
Replace LH and RH Lower Rear Control Arm Assemb (Includes Four Wheel Alignment Check)	lies Due To Potential Cracking	S021931001	1.45
Replace LH and RH Lower Rear Control Arm Assemb (Includes Four Wheel Alignment Check and Adjust)	lies Due To Potential Cracking	S031931001	2.00

Required Part(s):	Part Number	Description Use either of the following:	Quantity		
	1027459-99-A or 1021416-00-D	RR SUSP LCA ASSY RR SUSP LCA ASSY	2 2		
	2007090-00-C	NUT HF M10x1.25 PC10 PTP COLORED	2		
	Shop supplies: Pink paint pen				
	These part numbers were current at the time of publication. Use the revisions listed or later, unless otherwise specified in the Parts Manual.				
Special Tool(s):	1071271-00-A 1090881-00-A	Chassis Height Measurement Tool Brake Pedal Depressor			

Procedure

- 1. Replace both the LH and RH lower rear control arm assemblies (refer to Service Manual procedure 31031102).
- 2. Perform a four wheel alignment check (refer to Service Manual procedure 31002100), and, if necessary, adjust (refer to Service Manual procedure 31000100).

Affected VIN(s) Affected Model S vehicles built between approximately June 4, 2013 and February 7, 2014.

NOTE: This is a simplified summary of the affected VIN list. Refer to the VIN/Bulletin Tracker or Customer/Vehicle profile to determine applicability of this bulletin for a particular vehicle.

For feedback on the accuracy of this document, email <u>ServiceBulletinFeedback@tesla.com</u>.