

		Tesla, Inc. Service Bulletin	Replace Charge Port Carrier Assembly For Ice Buildup, Eastern Canada	
SB-19-44-001 August 23, 2019				
Classification		Section/Group	Mobile Service	
Campaign Bulletin		44 - High Voltage System	Can Perform* *Where permitted	
Model Year	Model	Country/Region	Version	
2018 - 2019	Model 3	Canada	All	
The model(s) and model year(s) listed are a general approximation of the affected VIN list. Refer to the VIN/Bulletin Tracker or Customer/Vehicle profile to determine applicability of this bulletin for a particular vehicle.				

Campaign Bulletin: This campaign bulletin addresses a known non-safety-related condition and provides recommended technical diagnosis and repair procedures. Apply this procedure to all vehicles in the affected VIN list.

Condition

Certain Model 3 vehicles were manufactured with charge port latch actuators that could allow ice to build up and prevent insertion or removal of the charge handle from the charge port.

Correction

Replace the charge port carrier and latch actuator with an updated assembly.

Correction Description	Correction	Time
SB-19-44-001 Not Applicable	S011944001	0.00
Replace Charge Port Carrier and Latch Actuator	S021944001	0.65

	Part Number	Description	Quantity
Parts Required	1492302-10-B	LATCH SUB ASSY,SERVICE,CP,NA,M3	1
	1111033-00-E	M3 2R BOLSTER CLIP	1
	1117252-00-A	BOLT,HF,M12x40,STL[109],ZN,ADH,MAT	1
These part numbers were current at the time of publication. Use the revisions listed or later, unless otherwise specified in the Parts Catalog.			
Special Tools	1108272-00-B	CAP, LOGIC CONN, INV, 3DU	
	1130480-00-A	TEST PROBES, SLIM, FLUKE TP38	

Procedure

1. Replace the charge port carrier assembly (refer to Service Manual procedure 44012102).