TESLA	Tesla, Inc. Service Bulletin	Rework Decor Trim Bracket	
SB-21-14-002			
August 4, 2021			
Classification		Section/Group	Mobile Service
Campaign Bulletin		14 - Instrument Panel & Pedals	Can Perform (where permitted)
Model Ye	ar Model	Country/Region	Version
2021	Model 3	Europe	LHD
	nd model year(s) listed are a ger his bulletin for a particular vehicle	eral approximation of the affected VIN list. Refer to the VIN/Bulletin Tracker or Cus	tomer/Vehicle profile to determine

Campaign Bulletin: This campaign bulletin addresses a known non-safety-related condition and provides recommended technical diagnosis and repair procedures. Apply this procedure to all vehicles in the affected VIN list.

Condition

On certain Model 3 vehicles sold in Europe, the glove box might not fully open.

Correction

Rework the decor trim bracket. If necessary, replace the instrument panel decor trim and glove box.

Correction Description	Correction	Time
SB-21-14-002 Not Applicable	S012114002	0.00
Rework Decor Trim Bracket	S022114002	0.10
Rework Decor Trim Bracket; Replace Decor Trim	S032114002	0.15
Rework Decor Trim Bracket; Replace Decor Trim And Glove Box	S042114002	0.35

	Part Number	Description	Quantity
Parts Required	1048647-00-A	NET PAD, 40X8X3.5	1
If Necessary	1619569-00-A	IP, LHD, DECOR ASY, WOOD Or	1
	1621493-00-A	IP, DECOR ASY, ALUMINUM	1
	1083340-00-J	M3, IP, GLOVE BOX, ASY, BASE	1

These part numbers were current at the time of publication. Use the revision listed or later, unless otherwise specified in the Parts Catalog.

Special Tools 1115241-00-A AIR BAG, INFLATABLE

Shop Supplies Super Glue, Permatex 82190 BSI Insta-Set Adhesive Accelerator

Procedure

- 1. Remove the main instrument panel decor trim (refer to Service Manual procedure 14057002).
- 2. Cut 2 strips of net pad, each 2 cm long (Figure 1).

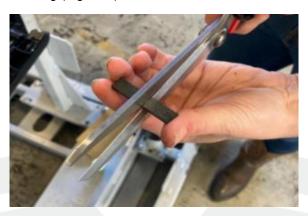


Figure 1

3. Glue 1 net pad on top of the rightmost decor trim bracket (Figures 2 and 3), and then glue the 2nd pad on top of the 1st pad (Figures 4 and 5). Allow the glue to dry for 1 minute.

CAUTION: Carefully apply the glue, and do not apply excess amounts of glue; the glue can damage the glove box or other customer-visible parts.



Figure 2



Figure 4



Figure 3



Figure 5

4. Protect all nearby customer-visible surfaces with cardboard and/or tape, and then spray adhesive accelerator on the net pad (Figure 6).

WARNING: Perform this step in a well-ventilated area and wear appropriate PPE such as gloves, eye protection, and face protection. Read the manufacturer's safety data sheet for more information.



Figure 6

- 5. Replace any damaged clips on the main instrument panel decor trim, and then install the trim on the instrument panel (refer to Service Manual procedure <u>14057002</u>).
 - NOTE: Do not install the air wave bezel caps or instrument panel end caps yet.
- 6. Open and close the glove box 3 times to verify the rework.
 - If the glove box consistently opens and closes without getting stuck, install all other components that were removed for access, and then discontinue this procedure.
 - If the glove box does not consistently open and close:
 - i. Remove the main instrument panel decor trim (refer to Service Manual procedure 14057002).
 - ii. Carefully use a urethane scraper to remove the net pads from the decor trim bracket.
 - CAUTION: Take care not to damage the instrument panel or other customer-visible parts.
 - NOTE: Some leftover pad or adhesive residue is acceptable.
 - iii. Install a new main instrument panel decor trim (refer to Service Manual procedure 14057002).
 - **NOTE:** Do not install the air wave bezel caps or instrument panel end caps yet.
- 7. Open and close the glove box 3 times to verify the new main instrument panel decor trim.
 - If the glove box consistently opens and closes without getting stuck, install all other components that were removed for access, and then discontinue this procedure.
 - If the glove box does not consistently open and close, install a new glove box, and then install all other components that were removed for access (refer to Service Manual procedure 14051012).
 - NOTE: If after replacing the glove box, the issue persists, escalate a Toolbox session to Service Engineering and wait for further instruction.