	esla, Inc. ervice Bulletin	Install Updated Tow Bar Label on Trailer Hitch Bar				
SB-21-19-002		THE Bai				
May 20, 2021						
Classification		Section/Group	Mobile Service			
Repair Bulletin		19 - Labels	Can Perform (where permitted)			
Model Year	Model	Country/Region	Version			
2016 - 2020	Model X	Europe	All			
The model(s) and model year(s) listed are a general approximation of the affected VIN list. Refer to the VIN/Bulletin Tracker or Customer/Vehicle profile to determine applicability of this bulletin for a particular vehicle.						

Repair Bulletin: This repair bulletin provides instructions on addressing a noted condition or possible customer concern regarding the operation of Tesla vehicles. These instructions should only be performed by trained professionals.

## Condition

Some Model X vehicles were built with a tow bar label on the trailer hitch bar that shows a lower "D-value" (12,67 kN) than the value for which the trailer hitch is homologated (12,96 kN).

## Correction

Upon customer complaint, install the updated tow bar label on the trailer hitch bar.

Correction Description	Correction	Time
SB-21-19-002 Not Applicable	S012119002	0.00
Install Updated Tow Bar Label	S022119002	0.05

	Part Number	Description	Quantity		
If needed	1672361-00-A	MX TOW BAR LABEL WITH UPDATE D-WEIGHT	1		
	This part number was current at the time of publication. Use the revision listed or later, unless otherwise specified in the <a href="Parts Catalog">Parts Catalog</a> .				
Shon sunnlies	IPA wines				

## **Procedure**

1. Remove the dust cover from the trailer hitch housing (Figure 1).



Figure 1

2. Locate the tow bar label on the trailer hitch bar and confirm that the D-value printed on the label is 12,67 kN (Figure 2). If the D-value on the label is 12,96 kN, discontinue this procedure.



Figure 2

## 3. Install the new label:

a. Peel off the old label.

CAUTION: Do not use a sharp object to peel off the label as this could damage the trailer hitch bar

- b. Use an IPA wipe to clean the surface of the trailer hitch bar.
- c. Install the new label with the correct "D-value" (12,96 kN) (Figure 3).

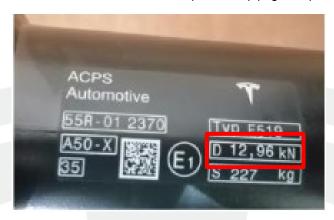


Figure 3

4. Reinstall the dust cover to the trailer hitch housing (Figure 4).



Figure 4