V .	esla, Inc. ervice Bulletin	Update Manufacturing Certification Label	
SB-21-19-003			
June 25, 2021			
Classification		Section/Group	Mobile Service
Repair Bulletin		19 - Labels	Can Perform (where permitted)
Model Year	Model	Country/Region	Version
2020 - 2021	Model 3	Australia, New Zealand	All
	odel year(s) listed are a gene ulletin for a particular vehicle.	ral approximation of the affected VIN list. Refer to the VIN/Bulletin Tracker or Custo	omer/Vehicle profile to determine

Repair Bulletin: This repair bulletin provides instructions on addressing a noted condition or possible customer concern regarding the operation of Tesla vehicles. These instructions should only be performed by trained professionals.

Condition

Some vehicles Australia and New Zealand were delivered to customers with incorrect manufacturing certification labels at the base of the RH B-pillar.

Correction

Upon customer complaint, perform a visual check of the certification label. Replace it with an updated label, if necessary.

Correction Description	Correction	Time
Vehicle Inspection Only; Manufacturing Certification Label Replacement Not Required	S012119003	0.05
Replace Manufacturing Certification Label	S022119003	0.10

	Part Number	Description	Quantity		
Parts Required	1502068-00-A	LBL, BLANK MFG CERTIFICATION RHD	1		
	These part numbers were current at the time of publication. Use the revisions listed or later, unless otherwise specified in the Parts Catalog .				
Shop Supplies	Alcohol wipes Touch up paint				

Procedure

1. Open the RH front door to access the manufacturing certification label near the base of the B-pillar (Figure 1).



Figure 1

- Inspect the label:
 - If the label has "E6RB" on a Standard Range vehicle or "E5DB" for Long Range vehicle (Figures 2 and 3), no additional work is required. Discontinue this procedure.
 - If the label does not have "E6RB" on a Standard Range vehicle or "E5DB" for Long Range vehicle (Figures 2 and 3), continue this procedure.



Figure 2 - Standard Range Vehicle



Figure 3 - Long Range Vehicle

3. Gently peel the label off the B-pillar using a plastic trim tool, starting from one corner, and then discard the label (Figure 4).

CAUTION: Take care not to damage the body paint.



Figure 4

- 4. Remove any remaining adhesive or label shreds from the area with an alcohol wipe and allow to completely dry.
- 5. Confirm the VIN on the new label matches the VIN plate before installing it (Figure 5).



Figure 5

- 6. Install the updated label onto the same location on the B-pillar.
 - NOTE: Position the label so that it is readable when standing outside of the vehicle.
- 7. If necessary, use touch up paint to cover any nicks or scratches created during removal of the old label.