	esla, Inc. ervice Bulletin	Replace Front Passenger Airbag			
SB-21-20-003					
September 28, 2021					
Classification		Section/Group	Mobile Service		
Repair Bulletin		20 - Safety and Restraint	Can Perform (where permitted)		
Model Year	Model	Country/Region	Version		
2018 - 2019	Model 3	Asia Pacific, EU	All		
The model(s) and model year(s) listed are a general approximation of the affected VIN list. Refer to the VIN/Bulletin Tracker or Customer/Vehicle profile to determine applicability of this bulletin for a particular vehicle.					

Repair Bulletin: This repair bulletin provides instructions on addressing a noted condition or possible customer concern regarding the operation of Tesla vehicles. These instructions should only be performed by trained professionals.

Condition

On some Model 3 vehicles sold in Asia Pacific and European regions, an electrical issue with the push type connector of the front passenger airbag may cause the airbag warning indicator on the touchscreen to illuminate. The operation of the airbag is unaffected.

Correction

Upon customer complaint, replace the front passenger airbag with an updated part.

Correction Description Correctio			n Time	
Replace the Fron	t Passenger Airbag	S012120003	1.90	
	Part Number	Description	Quantity	
Parts Required	1077824-00-F	M3/MY - PASSENGER A/B, NAR	1	
	1116594-00-B	BOLT, EHS, M6x19,[88], ZN, SMAT, ADH	4	
	1028053-00-A	AIRBAG HARNESS RETAINING CLIP	1	
	1458818-00-B	BOLT, PF, M10-1.5x36,[109], G0310[B], SMAT	4	
	These part numbers were current at the time of publication. Use the revisions listed or later, unless otherwise specified in the <u>Parts Catalog</u> .			

Procedure

Replace the front passenger airbag (refer to Service Manual procedure 20010302).