7	Tesla, Inc.
TESLA	Service Bulletin

Update Vehicle Firmware To Correct Track Mode Speedometer

SB-22-00-008April 22, 2022

April 22,	2022				
Classification	n	Section/Group	Mobile Service	Configuration	
Recall Bulletin		00 - Inspection & Service	Can Perform (where permitted)	Performance	
Model Year	Model	Country/Region	Build Location	Build Location	
2018 - 2022	Model 3	All	Fremont, Giga Shanghai		

The model(s) and model year(s) listed are a general approximation of the affected VIN list. Refer to the VIN/Bulletin Tracker or Customer/Vehicle profile to determine applicability of this bulletin for a particular vehicle.

Recall Bulletin: Recall Bulletins are mandatory service procedures that must be carried out by Tesla-certified Service Centers. Recall work performed by uncertified technicians could lead to unsafe conditions or voided warranty provisions.

Condition

Certain Model 3 Performance vehicles with firmware version 2021.44.25 or later, but before version 2022.12, might not display the unit of speed (MPH or KM/H) on the touchscreen speedometer when Track Mode is activated.

Correction

Inspect the vehicle firmware version, and if necessary, update the vehicle firmware to version 2022.12 or later.

Correction Description	Correction	Time
Inspect Vehicle Firmware Version; No Update Necessary	S012200008	0.05
Inspect And Update Vehicle Firmware To Correct Track Mode Speedometer	S022200008	0.05

Procedure

On the vehicle touchscreen, touch **Controls** (vehicle icon) > **Software**, and then scroll down to display the vehicle firmware version

- If the vehicle firmware version is before 2021.44.25, no action is necessary. Use correction code \$012200008.
- If the vehicle firmware version is 2022.12 or later, no action is necessary. Use correction code S012200008.
- If the vehicle firmware version is 2021.44.25 or later, but before version 2022.12, update to version 2022.12 or later (refer to Service Manual procedure 00020003). Use correction code S022200008.