Technical Note

Freedom Remote 512-0085-01-01 Rev 1

Gas Igniters and the Xantrex Freedom Remote cable

We have recently observed some problems related to gas igniters for LP furnaces, stoves, water heaters, and refrigerators. If the Freedom Remote cable is routed in close proximity to the igniter control wiring or the spark gap, it can cause a lock-up condition on the Freedom Inverter unit, the remote panel, or both. The lock-up condition is indicated by no operation of either the charger or the inverter modes, and the remote indicators are blank. A reset from a lock-up condition may require disconnecting and reconnecting the remote cable, disconnecting and reconnecting the batteries, or all of these at the same time.

This problem can usually be corrected by moving the Freedom Remote cable to a distance of three feet or greater from the igniter wiring and the spark gap. If the problem still exists a capacitor can be placed across (in parallel) the DC input wiring from the appliance that is causing the problem.

Xantrex is a registered trademark of Xantrex International. $\[mathbb{C}\]$ 2003 Xantrex International. All rights reserved.

Technical Note: Gas Igniters and the Xantrex Freedom Remote cable © March 1996 Xantrex International

UNLESS SPECIFICALLY AGREED TO IN WRITING, XANTREX TECHNOLOGY INC. ("XANTREX"):

(a) MAKES NO WARRANTY AS TO THE ACCURACY, SUFFICIENCY OR SUITABILITY OF ANY TECHNICAL OR OTHER INFORMATION PROVIDED IN ITS MANUALS OR OTHER DOCUMENTATION.

(b) ASSUMES NO RESPONSIBILITY OR LIABILITY FOR LOSS OR DAMAGE, WHETHER DIRECT, INDIRECT, CONSEQUENTIAL OR INCIDENTAL, WHICH MIGHT ARISE OUT OF THE USE OF SUCH INFORMATION. THE USE OF ANY SUCH INFORMATION WILL BE ENTIRELY AT THE USER'S RISK.

Part number: 512-0085-01-01 Rev 1

Contact information:

Phone:	1-800-670-0707 (toll-free in North America)	
--------	---	--

Fax: 1-604-420-2145 (outside North America)

Email: CustomerService@xantrex.com

Web: <u>www.xantrex.com</u>