User's Manual

Models UD310, UD320, UD350 Manual Setters



Note: This user's manual (IM 05F01F12-41E) is a re-edited, A4-size version of the IM 05F01F12-01E user's manual that is supplied along with the product shipped. Therefore, both manuals have the same contents, except for some minor differences in the cross-referenced page numbers.

Revision Record

●Manual No.: IM 05F01F12-41E(3rd Edition)

●Title : Models UD310,UD320,UD350 Manual Setters

Edition	Date	Revised Item
First	Feb.,2001	Newly published
Second	Sep.,2003	Correct
Third	Jun.,2004	Change of the company name.

Please read through this user's manual to ensure correct usage of the manual setter and keep it handy for quick reference.

CONTENTS

1.	Notice	. 2
2.	What is on the Front Panel?	. 3
3.	Installing the Manual Setter	. 4
4.	Panel Cutout Dimensions and External Dimensions	. 5
5.	Wiring	. 6
6.	Hardware Specifications	. 9
7.	Key Operations	10
8.	Troubleshooting	17

■ Checking Package Contents

Before using the product, check that its model & suffix codes are as you ordered.

Model and Suffix Codes

Model Suffix co		ix code	Description
UD310 UD320 UD350			UD310 Manual Setter 4 to 20 mADC output (48×48×100 mm) UD320 Manual Setter 4 to 20 mADC output (48×96×100 mm) UD350 Manual Setter 4 to 20 mADC output (96×96×100 mm)
Fixed code -0			Always 0
Fixed code 0		0	Always 0
Option /V24		/V24	Power Supply 24V DC / 24V AC

 $^{\ ^{*}}$ 2 Alarm outputs and PV retransmission output in 4 to 20 mA built in as standard.

Check the package contents against the list below.

• Manual Setter 1

• Mounting bracket · · · · · · 1 for UD310

2 for UD320, UD350

• User's manual · · · · · 1

1. NOTICE

The following safety symbol is used both on the product and in this user's manual.



This symbol stands for "Handle with Care." When displayed on the product, the operator should refer to the corresponding explanation given in the user's manual in order to avoid injury or death of personnel and/or damage to the product. In the manual the symbol is accompanied by an explanation of the special care that is required to avoid shock or other dangers that may result in injury or loss of life.

The following symbols are used in this manual only.



Indicates that operating the hardware or software in a particular manner may lead to damage or result in system failure.




Draws attention to information that is essential for understanding the operation and/or features of the product.

■ Exemption from Responsibility

Make sure that all of the precautions are strictly adhered to. Yokogawa Electric Corporation assumes no liability for any damage resulting from use of the instrument in contradiction to the precautions. Also, Yokogawa Electric Corporation assumes no liability to any party for any loss or damage, direct or indirect, caused by the use or any unpredictable defect of the instrument.

2. WHAT IS ON THE FRONT PANEL?

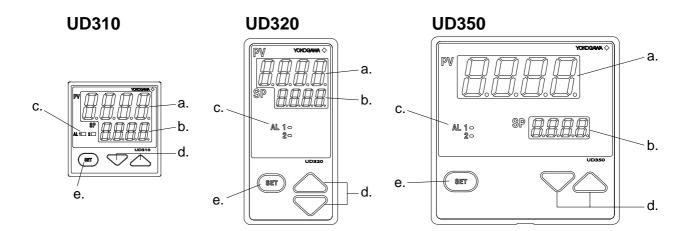

■ Monitoring Parts

	Name Function	
a.	PV display (red)	Indicates PV (measured value) and character information such as parameter codes and error codes. PV goes out when the setup parameter "PVD" is set to OFF.
b.	SP display (green)	Indicates SP (target setpoint) and character information such as parameter setpoints.
c.	AL1, AL2 lamps (red)	AL1 : Lit when alarm 1 is activated. AL2 : Lit when alarm 2 is activated.

■ Operating Parts (See 7. Key operations)

	Name	Function	
d.	Data change key	 Changes SP(target setpoint) and the parameter values. Pressing this key increases the data value. SP (target setpoint) will be output in 3 seconds after the change. Holding down the key will gradually increase the speed of changes. 	
	Data change key	 Changes SP(target setpoint) and the parameter setpoints. Pressing this key decreases the data value. SP (target setpoint) will be output in 3 seconds after the change. Holding down the key will gradually decrease the speed of changes. 	
e.	SET key (parameter data registering key)	 Registers the parameter setpoint changed using the data change keys. Switches between parameter setting displays sequentially. Pressing the key for 3 seconds or longer in the operating display retrieves the operating parameter setting display. Pressing the key for 3 seconds or longer in operating or setup parameter setting display transfers back to operating display. 	

3. INSTALLING THE MANUAL SETTER



To prevent electric shock, the source of power to the manual setter must be turned off when mounting the manual setter on to a panel.




To install the manual setter, select a location where:

- 1. No-one may accidentally touch the terminals;
- 2. Mechanical vibrations are minimal;
- 3. Corrosive gas is minimal;
- 4. The temperature can be maintained at about 23°C with minimal fluctuation;
- 5. There is no direct heat radiation;


- 6. There are no resulting magnetic disturbances;
- 7. The terminal board (reference junction compensation element, etc.) is protected from wind;
- 8. There is no splashing of water; and
- 9. There are no flammable materials.

Never place the manual setter directly on flammable items.


If the manual setter has to be installed close to flammable items or equipment, be sure to enclose the manual setter in shielding panels positioned at least 150mm away from each side. These panels should be made of either 1.43mm thick metal-plated steel plates or 1.6mm thick uncoated steel plates.

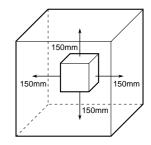


 ●Mount the manual setter at an angle within 30° from horizontal with the screen facing upward. Do not mount it facing downward.



■ Mounting the Manual Setter

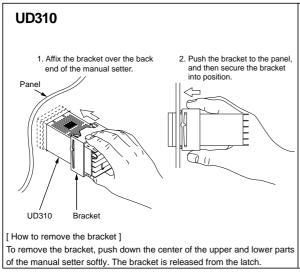

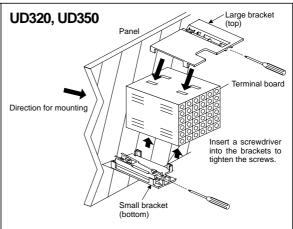

Insert the manual setter into the opening with the terminal board facing the front. Set and tighten the top and bottom brackets on the manual setter to fix it on the panel

PANEL CUTOUT DIMENSIONS AND **EXTERNAL DIMENSIONS**



Splash-proof construction is not available when the side-by-side close mounting method shown in the following figures, is chosen for any of the manual setters.

1. General Mounting **UD310** max. 44.8 47.8 Unit: mm 100 2. Side-by-side Close Mounting 44.8 $[(N-1)\times 48 + 45]_{0}^{+0.6}$ max. 4 N is the number of manual setters. If N \geq 5, then measure the actual length Panel thickness 1 to 10 1. General Mounting **UD320** max. 44.6 Unit: mm 45 Ē. 100 7 | गुर्काक्गुकाकाकाकाकाका max. ११.८ 112 2. Side-by-side Close Mounting max. $[(N-1)\times 48 + 45]_{0}^{+0.6}$ 92 +0.8 N is the number of manual setters. If N≥5, then measure the actual length 1. General Mounting **UD350** Unit: mm min. 145 92,08 92 t^{0.8} 2. Side-by-side Close Mounting max. 91.8 112

96

1 to 10

J**ze**zu J

(SET)

 $[(N-1)\times 96 + 92]_{0}^{+0.8}$

N is the number of manual setters.

If N≥5, then measure the actual length

max.

WIRING



- 1) Before you start wiring, turn off the power source and use a tester to check that the manual setter and cables are not receiving any power in order to prevent electric shock.
- 2) For safety, be sure to install a circuit breaker switch (of 5A and 100V AC or 220V AC, and that conforms to IEC60947) near the instrument so as to be operated easily, and clearly indicate that the device is used to de-energize the instrument.
- 3) Wiring should be carried out by personnel with appropriate electrical knowledge and experience.



- 1) Use a single-phase power source. If the source has a lot of noise, use an isolation transformer for the primary side and a line filter (we recommend TDK's ZAC2205-00U product) for the secondary side. When this noise-prevention measure is taken, keep the primary and secondary power cables well apart. Since the manual setter has no fuse, be sure to install a circuit breaker switch (of 5A and 100V AC or 220V AC, and that conforms to IEC standards) and clearly indicate that the device is used to de-energize the manual setter.
- 2) For thermocouple input, use shielded compensating lead wires. For RTD input, use shielded wires which have low resistance and no resistance difference between the 3 wires. See the table given later for the specifications of the cables and terminals and the recommended products.
- 3) The alarm output relay cannot be replaced even though it has a limited service life (100,000 relay contacts for the resistance load). Thus, an auxiliary relay should be used so that the load can be turned on and off.
- 4) When using an inductive load (L) such as an auxiliary relay and solenoid valve, be sure to insert a CR filter (for AC) or diode (for DC) in parallel as a spark-rejecting surge suppressor to prevent malfunctions or damage to the relay.
- 5) When there is the possibility of being struck by external lightening surge, use the arrester to protect the insturment.




- Always fix a terminal cover bracket to the UD310 manual setter before wiring if an optional antielectric-shock terminal cover (part number: L4000FB) is used.
- Two types of optional anti-electric-shock terminal covers (part numbers T9115YE and T9115YD) are available for the UD320 and UD350 manual setters, respectively.


● Cable Specifications and Recommended Products


Power supply and relay contact output	600V vinyl insulated wire/cable, JIS C3307, 0.9 to 2.0mm ²	
Thermocouple input	Shielded compensating lead wire, JIS C1610	
RTD input	Shielded wire (3-wire), UL2482 (Hitachi cable)	
Other signals	Shielded wire	

Recommended Terminals

  Use M3.5 screw-compatible crimp-on terminals with an insulating sleeve, as shown below.





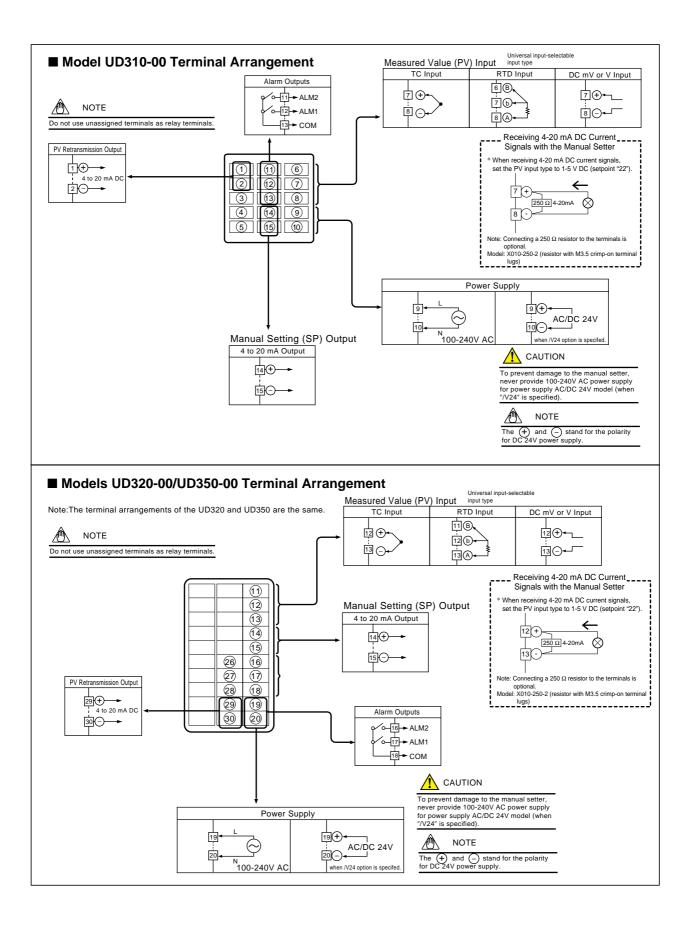

HARDWARE SPECIFICATIONS

Measured Value (PV) Input

- Input: 1 point
- Input type: Universal; can be selected by software
- Input accuracy (at 23 ±2°C ambient temperature)
- Thermocouple: ±2°C ±1digit However.
 - ±4°C for thermocouple input –200 to –100°C

 - ±3°C for thermocouple input –100 to 0°C ±5°C for types R and S (±9°C for 0 to 500°C)
- ±9°C for type B (accuracy is not guaranteed for 0 to 400°C)
- RTD: ±1°C ±1digit •Voltage(mV, V): ±0.3% ±1digit
- Sampling period for measured value input: 500ms Burn-out detection: Functions for thermocouple or RTD input
- (burn-out upscale only; cannot be switched off) • Input resistance: $1M\Omega$ or greater for thermocouple
- or DC mV input. Approx. $1 M\Omega$ for DC V input Maximum allowable signal source resistance :
- 250Ω for thermocouple or DC mV input
- 2kΩ for DC V input

 Maximum allowable wiring resistance for RTD input: 10Ω/wire (The resistance values of three wires must be the same.)
- ◆ Allowable input voltage: ±10V DC for thermocouple or DC mV input
 ±20V DC for DC V input
- Noise rejection ratio: Normal mode noise: Min. 40dB (50/60Hz) Common mode noise: Min. 120dB (Min. 90dB for DC V input)
- Error of reference junction compensation:±1.5°C (at 15-35°C) ±2.0°C (at 0-50°C)

The reference junction compensation cannot be switched off.

• Applicable standards: Thermocouple and resistance temperature detector(RTD) JIS/IEC/DIN (ITS90)

Manual Setting (SP) Output

SP (target setpoint) will be output in 3 seconds after the change

- Output: 1 point
- Output type: Current output Output signal: 4 to 20mA current output Maximum load resistance: 600Ω Output accuracy: ±0.3% of span (at 23±2°C ambient temperature)

Alarm Functions

■Alarm Functions

- Alarm types: 22 types
- (waiting action can be set by software): PV high limit, PV low limit, Deviation high limit, Deviation low limit, De-energized on deviation high limit, De-energized on deviation low limit, Deviation high and low limits, Deviation within high and low limits, De energized on PV high limit, De-energized on PV low limit, Fault diagnosis output, FAIL output
- · Alarm output: 2 relay contacts Relay contact capacity: 1A at 240V AC or 1A at 30V DC (with resistance load) (COM terminal is common) Note: The alarm output relays cannot be replaced by users

Retransmission Output

- Output signal: Measured value in 4-20mA DC, can be scaled.
- Maximum load resistance: 600Ω
- Output accuracy: ±0.3% of span (at 23±2°C ambient temperature)

Safety and EMC Standards

 Safety: Compliant with IEC/EN61010-1: 2001, approved by CSA1010, approved by UL508. Installation category : CAT. II (IEC/EN61010, CSA1010) Pollution degree : 2 (IEC/EN61010,

Measurement category: I (CAT. I: IEC/EN61010) Rated measurement input voltage : 10V DC max.(across terminals), 300V AC max.(across

Rated transient overvoltage: 1500V (Note)
Note: It is a value on the safety standard which is assumed by IEC/EN61010-1 in measurement category I, and is not the value which guarantees an apparatus performance. Caution: This equipment has Measurement category I, therefore do not use the equipment for measurements within measurement categories II, III and IV.



	surement ategory	Description	Remarks	
Ι	CAT. I	For measurements performed on circuits not directly connected to MAINS.		
П	CAT. I	For measurements performed on circuits directly connected to the low voltage installation.	Appliances, portable equipments, etc.	
П	CAT.Ⅲ	For measurements performed in the building installation.	Distribution board, circuit breaker, etc.	
IV	CAT.IV	For measurements performed at the source of the low-voltage installation.	Overhead wire, cable systems, etc.	

 EMC standards: Complies with EN61326. The instrument continues to operate at a measuring accuracy of within ±20% of the range during tests.

Power Supply and Isolation

■Power Supply

Power supply	Voltage	Rated at 100-240VAC (±10%) AC/DC 24V, 20 to 29V of allowable range when "/V24" is specified.	
	Frequency	50 or 60Hz	
Maximum	power consumption	8VA max. (4W max.) 3W max. when "/V24" is specified.	
Memory		Non-volatile memory	
Withstanding voltage	Between primary terminals and secondary terminals (See Notes 1 and 2.)	1500V AC for 1 minute	
Insulation resistance	Between primary terminals and secondary terminals (See Notes 1 and 2.)	20MΩ or more at 500V DC	

Note 1: The primary terminals are the power supply terminals and alarm output terminals.

The secondary terminals are the analog input and output terminals. Note 2: AC/DC 24V terminals are secondary terminals.

■ Isolation

The bold lines below indicate reinforced isolation, and the broken line indicates functional isolation

the oronen fine maleut	ne oronen mie marentes ranenonar isolationi				
Power supply terminals	Power supply terminals AC/DC 24V (When "/V24" is specified.				
(100-240V AC)	Measured value input terminals				
• Alarm output terminals (2 relay contacts)	Manual setting output terminals : 4-20 mA Retransmission output terminals : 4 20 mA				

Note: The measured value input terminals is isolated from the internal circuit.

Construction, Mounting, and Wiring

- Construction: Dust-proof and drip-proof front panel conforming to IP65 [Model UD310] and IP55 [Models UD320 and UD350]. For side-by-side close installation the controller loses its dust-proof and drip-proof protection
- Casing: ABS resin and polycarbonate
- Case color: Black
- Weight: UD310 approx. 200g UD320 - approx. 300g
- UD350 approx. 400g Mounting: Flush panel mounting

Environmental Conditions

■Normal Operating Conditions Warm-up time: At least 30 minutes

- Ambient temperature:0-50°C (0-40°C when mounted side-by-side)
- Rate of change of temperature: 10°C/h or less
- Ambient humidity: 20-90% RH (no condensation allowed)
- Magnetic field: 400A/m or less
- Continuous vibrations of 5 to 14Hz: Amplitude of 1.2mm or less
- Continuous vibrations of 14 to 150Hz: 4.9m/s² (0.5G) or less Short-period vibrations: 14.7m/s² (1.5G) for 15 seconds or less
- Shock: 98m/s² (10G) for 11 milliseconds or less • Mounting angle: Upward incline of up to 30
- degrees; downward incline is not allowed.

 Altitude: 2000m or less above sea level

■ Maximum Effects from Operating Conditions

- (1) Temperature effects

 Thermocouple, DC mV and DC V input: ±2µV/°C or ±0.02% of F.S./°C, whichever is larger
- Resistance temperature detector: ±0.05°C/°C
 Analog output: ±0.05% of F.S./°C
- (2) Effect from fluctuation of power supply voltage (within rated voltage range)

 • Analog input: ±0.2µV/V or ±0.002% of F.S./V,
- whichever is larger
- Analog output: ±0.05% of F.S. /V

■Transportation and Storage Conditions

- Temperature: −25 to 70°C
- Humidity: 5 to 95% RH (no condensation allowed)
- Shock: Package drop height 90cm (when packed in the dedicated package)

7. KEY OPERATIONS



To prevent electric shock, the manual setter should be mounted on the panel so as not to accidentally touch the terminals when power is being applied.

- (1) You can move between parameter setting displays using the (1) key.
- (2) To change the parameter setpoint,
 - (i) Change the display value with the \bigcirc or \bigcirc key (the period flashes).
 - (ii) Press the (a) key to register the setpoint.
- (3) In the operating display, pressing the () key for at least 3 seconds retrieves the operating parameter setting display.
- (4) In the operating parameter setting display, pressing the key for at least 3 seconds transfers back to the operating display. Registering the key-lock parameter LOC to "-1" retrieves the setup parameter setting display.
- (5) In the setup parameter setting display, pressing the (set) key for at least 3 seconds transfers back to the operating display.

UD310/UD320/UD350 Measured Input Type and Ranges

Input type Range (°C)		Range code (°C)	Range (°F)	Range code (°F)		
U	nspecifed		OFF			
		−270 to 1370°C	1	−300 to 2500°F	31	
	K	0.0 to 600.0°C	2	32.0 to 999.9°F	32	
	K	0.0 to 400.0°C	3	32.0 to 750.0°F	33	
		−199.9 to 200.0°C	4	−300 to 400°F	34	YCKCOMM.
e	J	−199.9 to 999.9°C	5	−300 to 2100 °F	35	
Thermocouple	T	−199.9 to 400.0°C	6	−300 to 750°F	36	
၂ ဗွ	Е	−199.9 to 999.9°C	7	−300 to 1800°F	37	
Ĭ,	R	0 to 1700°C	8	32 to 3100°F	38	
he	S	0 to 1700°C	9	32 to 3100°F	39	UD910
L	В	0 to 1800°C	10	32 to 3200°F	40	
	N	−200 to 1300°C	11	−300 to 2400°F	41	
	L	−199.9 to 900.0°C	12	−300 to 1600°F	42	1 / / /
	U	−199.9 to 400.0°C	13	−300 to 750°F	43	[' ',]
	Platinel 2	0 to 1390°C	14	32 to 2500°F	44] \ /
		−199.9 to 850.0°C	15	-199.9 to 999.9°F	45	
	Pt100	0.0 to 400.0°C	16	32.0 to 750.0°F	46	For example, to select
E E	11100	−199.9 to 200.0°C	17	−300 to 400°F	47	thermocouple type J (°F),
"		−19.9 to 99.9°C	18	-199.9 to 999.9°F	48	set the range code to 35.
	JPt100	−199.9 to 500.0°C	19	·		30t the range code to 33.
ge	0 to 100mV	0.0 to 100.0	20			
voltage	0 to 5V	0.000 to 5.000 User-scalable	21			
Š	1 to 5V	1.000 to 5.000 User-scalable	22			
DC	0 to 10V	0.00 to 10.00	23			



At power-on, the manual setter displays the operating display, but if the measured input type setting remains OFF, "IN" appears. In this case, press the key to display the measured input range code you want to use, then press the key to register it. (Refer to the flowchart below.)



The manual setter is shipped with the parameters set at the factory-set defaults. Check the default values against the "Parameter Lists" in the page 13 and 14, and change the parameter setpoints that need to be changed.

This section explains how to set and register parameter setpoints.

The procedure for changing Target Setpoint(SP) and Alarm 1 Setpoint(A1) can be found on "Changing Target Setpoint(SP)" and "Changing Alarm 1 Setpoint(A1)".

You can set the other parameters in the same way.

■ Changing Target Setpoint (SP)

The following instructions assume that the manual setter is already receiving power.

SP (target setpoint) value will be output in 3 seconds after the change.

Step 1:


Confirm that the manual setter shows the operating display during normal operation (PV and SP are displayed on the indicators).



Step 2:

Press the or key to change the SP display value to the required setpoint. In this example, SP is changed to 200°C.



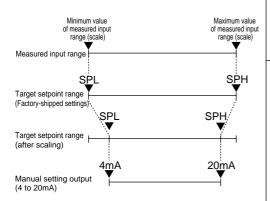

■ Changing Alarm 1 Setpoint (A1)

Check alarm type before setting the alarm setpoint. Factory-set settings:

Alarm 1 type : OFF Alarm 2 type : OFF

Step 1:

Confirm that the manual setter shows the operating display during normal operation (PV and SP are displayed on the indicators).



Step 2:

To enter the operating parameter setting display, press the key for at least 3 seconds.



Step 3:

Press the or key to change the current A1 setpoint to a required setpoint. In this example, A1 is changed to 200°C.



The period flashes while the setpoint is being changed. -

 
Step 4:

Press the wy once to register the setpoint.

The period goes out.

Al is now changed.

Another press of the wey calls up the Alarm 2




setpoint(A2) display. To return to the operating

display, press the (ser) key for at least 3 seconds.



Changing certain setup parameter may atomatically initialize the operating parameters. Therefore, after you change the setup parameters, always check the operating parameter setpoints to find out if appropriate values have been set for them. If the operating parameters have been initialized, set them to their appropriate values.

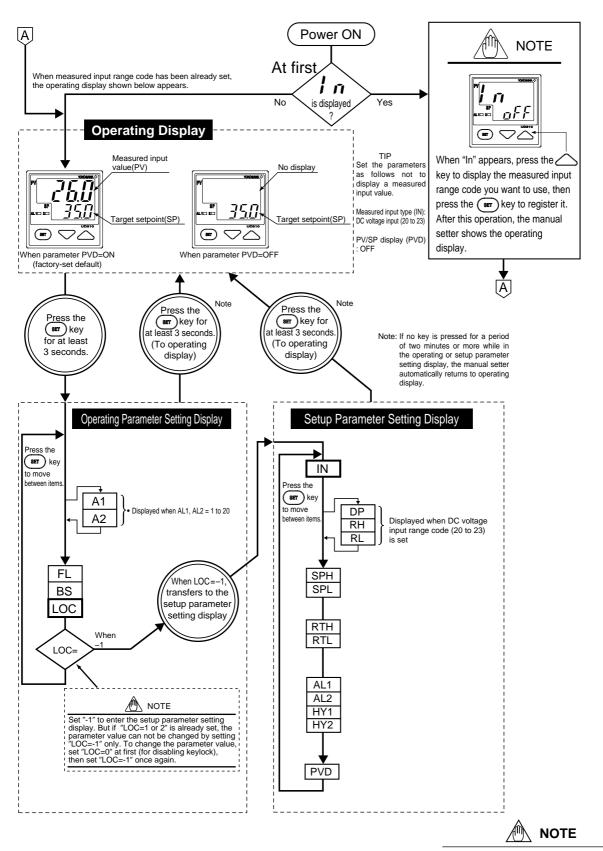

Changing certain setup parameters may automatically initialize the operating parameters. Therefore, after you change the setup parameters, always check the operating parameter settings to find out if appropriate values have been set for them. If the operation parameters have been initialized, set them to their appropriate values.


■ Parameter Lists


 ${\bf (1)\ Operating\ Parameters: Parameters\ changed\ rather\ frequently\ during\ operation.}$

	Code Name		Setting range and unit	Default	User setting
A1	R I	Alarm 1 setpoint	■ PV alarm Unit: °C/°F Setting range: [minimum value - (maximum value - minimum value)] to maximum value of measured	Depends on the alarm 1 type.	
A2	A2	Alarm 2 setpoint	input range (scale) Deviation alarm Unit: °C/°F Setting range: –100 to 100% of the measured input range (scale) span	Depends on the alarm 2 type.	
FL	FL	PV input filter	OFF, 1 to 120 seconds This function should be used when the PV display value may fluctuate greatly, for example, when the measured input signal contains noise. The filter is of the first-order lag type, and FL sets the time constant. If a larger time constant is set, the filter can remove more noise. Input 2-seconds filter 10-seconds fi	OFF	
BS	6 5	PV input bias	-100 to 100% of measured input range (scale) span This function adds a bias value to the measured input value, and the result is used for display and retransmission output. [PV value inside the manual setter] = [measured input value] + [PV input bias] This function is useful for carrying out fine adjustment when the PV value is within the required accuracy but it differs from the value obtained by other equipment.	0% of measured input range (scale) span	
LOG	LoE	Key lock	0: No key lock 1: Prevents parameter from being changed of except for SP in the operating display. 2: Prevents all parameter changing operations including SP in the operating display. -1: Set "-1" to enter the setup parameter setting display. But if "LOC=1 or 2" is already set, the parameter value can not be changed by setting "LOC=-1" only. To change the parameter value, set "LOC=-0" at first (for disabling keylock), then set "LOC=-1" once again.	0	

(2) Setup Parameters: Parameters rarely changed in normal use after once having been set.


(=	(2) Setup Parameters : Parameters rarely changed in normal use after once having been set. Code Name Setting range and unit Default User settin						
	1 to 23, 31 to 48 (See input range code list.)		OFF, or the input	User setting			
IN	l n	Measured input type	OFF: No input (If no input type is specified at the time of ordering, you must set the input type.)	range code specified with order			
DP	dР	Decimal point position of measured input	0: No decimal place (nnnn) 1: One decimal place (nnn.n) 2: Two decimal places (nn.nn) 3: Three decimal places (n.nnn)	1			
RH	гH	Maximum value of measured input scale	$\label{eq:continuity} \mbox{(Displayed at voltage input)}$ $\mbox{(RL}+1) \mbox{ to } 9999$	100.0			
RL	rL	Minimum value of measured input scale	(Displayed at voltage input) -1999 to (RH -1)	0.0			
SPH	5PH	Maximum value of target setpoint range (Setpoint for manual setting output 20mA)	SPH setting range: (SPL+1digit) to the maximum value of the measured input range (scale); Unit: °C/°F SPL setting range: Minimum value of the measured input range (scale) to (SPH -1digit); Unit: °C/°F Minimum value of measured input range (scale) Measured input range (scale) Measured input range	Maximum value of measured input range (scale)			
SPL	5PL	Minimum value of target setpoint range (Setpoint for manual setting output 4mA)	Target setpoint range (Factory-set default) SPL SPH Target setpoint range (after scaling) 4mA 20mA Manual setting output (4 to 20mA)	Minimum value of measured input range (scale)			
RTH	rEH	Maximum value of retransmission output	Temperature input : Within measured input range Voltage input : (RTL+1digit) to max. value of measured input scale(RH) Min. value of measured input scale(RL) to (RTH-1digit) However, RTL <rth (scale)="" (scale)<="" input="" measured="" minimum="" of="" range="" td="" value=""><td>Maximum value of measured input range (scale)</td><td></td></rth>	Maximum value of measured input range (scale)			
RTL	rEL	Minimum value of retransmission output	RTL RTH Retransmission range (Factory-set default) RTL RTH Retransmission range (after scaling) 4mA 20mA Retransmission output (4 to 20mA)	Minimum value of measured input range (scale)			
AL1	AL I	Alarm 1 type	OFF or a value from 1 to 22 (see the table of alarm	OFF			
AL2	AL 2	Alarm 2 type	function list), and either	OFF			
HY1	HY !	Alarm 1 hysteresis	0.0 to 100.0% of measured input range (scale) span	0.5% of measured input range (scale) span			
HY2	H35	Alarm 2 hysteresis	Unit: °C/°F	0.5% of measured input range (scale) span			
PVE	PUd	PV/SP display	ON: Displays PV (measured input) and SP (target setpoint) OFF: Displays SP (target setpoint) Measured input(PV) Factory-shipped setting (PVD=ON) Target setpoint(SP) Even if a measured input (PV) is not displayed, the PV retransmission output and the alarm action work normally.	ON			

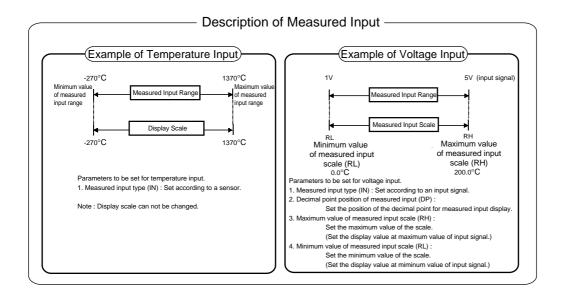

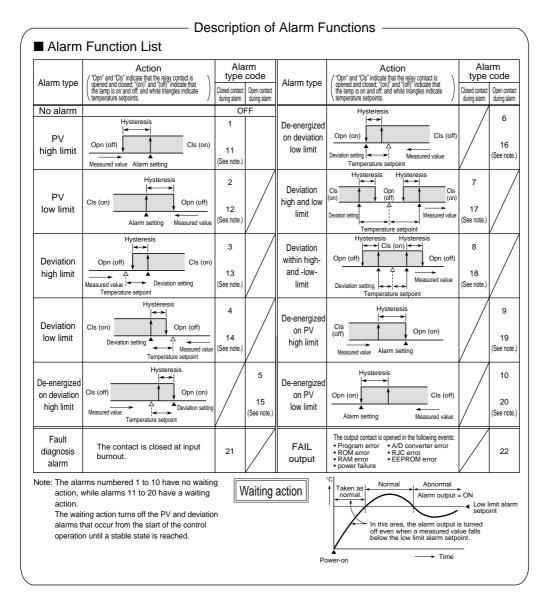


Description of Alarm hysteresis

The alarms are output as relay outputs. Since a relay has a limited service life, excessive on/off actions will shorten the life of the relay. To prevent this, you can set a hysteresis for both alarm 1 and alarm 2 to moderate excessive on/off actions.

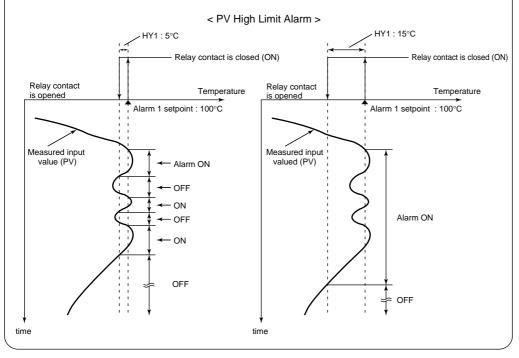

8. TROUBLESHOOTING

In the event of an abnormality, perform the following checks as outlined by the flowchart.

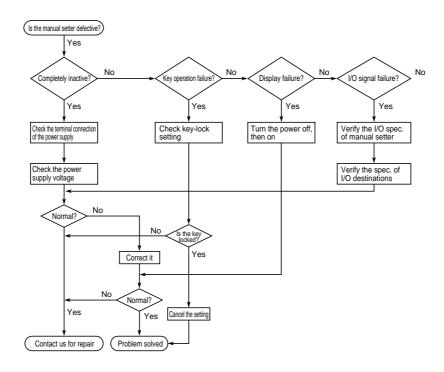

■ Error Display during Operation

(1) If the manual setter displays one of the following, carry out the appropriate remedy for the particular error.

Display	Error content	Remedy	
P.Er P.Er	The parameter is abnormal	Check the setpoints of all the parameters and set them at their proper values.	
b . a _{B.o}	Input burnout	Check the sensor wiring and correct it. Not display when the setup parameter PVD=OFF.	
	PV over-scale (PV exceeds its effective range.) PV under-scale (PV falls below its effective range.)	Check the measured input type and scale settings and correct them. Not display when the setup parameter PVD=OFF.	
No PV display		Set the setup parameter PVD=ON to display PV.	

⁽²⁾ The manual setter needs to be repaired if any of the indications in the table below appear.

In these cases, do not try to repair the manual setter yourself.

Order a new manual setter or contact us for repair.

Display	Error content		Display	Error content
Unknown (at power-on)	CPU failure		Flashing "Err" (at power-on)	RAM or ROM failure
All extinguished (at power-on)	Power source failure		Flashing "Err"	A/D converter failure,
"Err" (at power-on)	Calibration abnormal]	(during operation)	RJC failure, or EEPROM failure

■ When Power Failure Occurred during Operation

- Momentary power failures shorter than 20ms (or shorter than 1ms when "/V24" is specified). have no effect on the manual setter operation (i.e., normal operation continues).
- For power failures of 20ms or longer(or 1ms or longer when "/V24" is specified), however the status will be as follows.

(The manual setter action at power recovery is the same as at power-on.)

- Alarm action: Continues (but alarms with a waiting action enter the waiting state once)
- Setting parameters : Maintained



Yokogawa Electric Corporation

YOKOGAWA ELECTRIC CORPORATION Network Solutions Business Division

2-9-32, Nakacho, Musashino-shi, Tokyo, 180-8750 JAPAN Phone: +81-422-52-7179 Facsimile: +81-422-52-6793

Sales Branch Offices

Tokyo, Nagoya, Osaka, Hiroshima, Fukuoka

YOKOGAWA CORPORATION OF AMERICA

Headquaters

2 Dart Road, Newnan, GA. 30265-1094 U.S.A. Phone: +1-770-253-7000 Facsimile: +1-770-251-0928 Sales Branch Offices / Texas, Chicago, Detroit, San Jose

YOKOGAWA EUROPE B. V.

Headquaters

Databankweg 20, 3821 AL Amersfoort THE NETHERLANDS Phone: +31-334-64-1611 Facsimile: +31-334-64-1610

Sales Branch Offices / Houten (The Netherlands), Wien (Austria), Zaventem (Belgium), Ratingen (Germany), Madrid (Spain), Bratislava (Slovakia), Runcorn (United Kingdom), Milano (Italy), Velizy villacoublay(France), Johannesburg(Republic of South Africa)

YOKOGAWA AMERICA DO SUL S.A.

Headquarters & Plant

Praca Acapulco, 31-Santo Amaro, Sao Paulo/SP, BRAZIL CEP-04675-190

Phone: +55-11-5681-2400 Facsimile: +55-11-5681-4434

YOKOGAWA ENGINEERING ASIA PTE. LTD.

Head office

5 Bedok South Road, Singapore 469270 SINGAPORE Phone: +65-6241-9933 Facsimile: +65-6241-2606

YOKOGAWA ELECTRIC KOREA CO., LTD.

395-70, Shindaebang-dong, Dongjak-gu, Seoul,156-010, KOREA Phone: +82-2-3284-3000 Facsimile: +82-2-3284-3019

YOKOGAWA TAIWAN CORPORATION

Head office 17F, No.39, Sec. 1, Chung Hwa Road Taipei, 100 TAIWAN Phone: +886-2-2314-9166 Facsimile: +886-2-2314-9918

YOKOGAWA AUSTRALIA PTY. LTD.

Head office Centrecourt D1, 25-27 Paul Street North, North Ryde, N. S. W. 2113, AUSTRALIA Phone: +61-2-9805-0699 Facsimile: +61-2-9888-1844

YOKOGAWA INDIA LTD.

Head office

40/4 Lavelle Road, Bangalore, 560 001, INDIA Phone: +91-80-227-1513 Facsimile: +91-80-227-4270

LTD. YOKOGAWA ELECTRIC

Grokholskiy per. 13, Build. 2, 4th Floor, 129010, Moscow, RUSSIA FEDERATION

Phone: +7-095-737-7868 Facsimile: +7-095-737-7869