OPERATOR, ORGANIZATIONAL, DIRECT SUPPORT

AND GENERAL SUPPORT MAINTENANCE

MANUAL INCLUDING REPAIR PARTS LIST

FOR

SAW, POWER HACK

MODEL 3 HY DUTY

(KELLER MANUFACTURING) (3405-00-729-3917)

THIS PUBLICATION IS A COURTESY QUICK COPY FROM THE UNITED STATES ARMY PUBLICATIONS DISTRIBUTION CENTER, ST.LOUIS, MISSOURI, TO MEET YOUR NEEDS WHILE WE REPLENISH OUR REGULAR STOCK.

HEADQUARTERS, DEPARTMENT OF THE ARMY NOVEMBER 1980

TECHNICAL MANUAL]

No.9-3405-214-14&P

HEADQUARTERS DEPARTMENT OF THE ARMY WASHINGTON DC, *28 November 1980*

OPERATOR'S ORGANIZATIONAL, DIRECT SUPPORT AND GENERAL SUPPORT MAINTENANCE MANUAL INCLUDING REPAIR PARTS LIST FOR SAW, POWER HACK MODEL 3 HY DUTY (KELLER MANUFACTURING) (NSN 3405-00-729-3917)

REPORTING ERRORS AND RECOMMENDING IMPROVEMENTS

You can help improve this manual. If you find any mistakes or if you know of a way to improve the procedures, please let us know. Mail your letter, DA Form 2028 (Recommended Changes to Publications and Blank Forms), or DA Army Armament Materiel Readiness Command, ATTN: DRSAR-MAS, Rock Island, IL 61299.A reply will be furnished directly to you.

NOTE

This manual is published for the purpose of identifying an authorized commercial manual for the use of the personnel to whom this saw is issued.

Manufactured by: Keller Manufacturing 1428 Cliff Road Burnsville, MN 55337 Procured under Contract No.DAAA09-78-C-4970

This technical manual is an authentication of the manufacturers' commercial literature and does not conform with the format and content specified in AR 310-3, Military Publications. This technical manual does, however, contain available information that is essential to the operation and maintenance of the equipment.

i/(ii blank)

INSTRUCTIONS FOR REQUISTIONING PARTS

NOT IDENTIFIED BY NSN

When requisitioning parts not identified by National Stock Numbers, it is mandatory that the following information be furnished the supply officer

- 1 Manufacturer's Federal Supply Code Number 6A606 N
- 2 Manufacturer's Part Number exactly as listed herein.
- 3 Nomenclaturer's exactly as listed herein, including dimensions, if necessary.
- 4 Manufacturer's Model t umber Model 3 HY DUTY
- 5 Manufacturer's Serial Number (End Item)
- 6 Any other information such as Type, Frame Number, and Electrical Characteristics, if applicable.

7 - If DD Form 1348 is used, fl11 in all blocks except- 4, 5, 6, and remark field in accordance with Al 725-50.

Complete Form as Follow:

- (a) In blocks 4, 5, 6, list manufacturer's Federal Supply Code Number - 6A606 N followed by a colon and manufacturer's Part Number for the repair part.
- (b) Complete Remarks field as follows: Noun: (nomenclature of repair part) For: NSN: 3405-00-729-3917 Manufacturer: Keller Manufacturing

Model: 3 EY DUTY Serial: (of end item)

Any other pertinent information such as Frame Number, Type. Dimensions, etc.

iii/(iv blank)



-1-

OPERATING INSTRUCTIONS

This saw is an extremely simple machine to operate. However, there are just a few general instructions which should be followed. This saw is completely wired, ready to run. However, when connecting reversible motors, be sure crank disc is revolving in counterclockwise direction as shown by the arrow. Oil each hole daily, except the motor. Do not drop the saw blade on the work.

HYDRAULIC LIFT ADJUSTMENT

Before using machine for the first time, fill Hydraulic Lift Tank to proper oil level as indicated on decal. Use No.10 Non-Detergent Motor Oil. Run machine 15 to 20 minutes to work the air out of the Hydraulic Lift System.

- " To INCREASE Lift: Lengthen Push Rod with the two jam nuts on cam or eccentric lever.
- " CAUTION: DO NOT lengthen too far as plunger will bottom on cylinder. The lift should not exceed 1/8-inch at handle end of guide bar.
- " TO DECREASE Lift: Reverse the Procedure to shorten push rod.

ADJUSTABLE BRONZE GIBS. Guide bar operates on bronze gibs in saw frame. Gibs may be adjusted by take-up screws in the saw frame to compensate for wear and to maintain proper alignment.. The bronze gibs are easily and inexpensively replaced.

TEN HOUR CHECK. After the new saw has been in operation for about ten hours, the bronze gibs should be tightened to compensate for normal wear-in of the

machine.

HYDRAULIC LIFT. The hydraulic lift mechanism automatically lifts blade on return stroke. Blades last longer, run cooler and cut better.

VARIABLE FEED PRESSURE CONTROL. Simply turn knob clockwise to increase feed pressure for heavy bar stock, etc., and turn counter-clockwise for sawing thinwall, tubing, softer metals, etc. On cabinet base Hy-Duty models, the maximum feed pressure is 200 lbs. CAUTION: Do not apply excessive pressure to work. Few jobs require over 150 lbs. working pressure. For maximum cutting efficiency, select the correct sawing combination. Follow the suggestions listed on page 3.The pressure Feed Control is located on the front of the Hy-Duty models.

FOR ANGLE CUTTING. Simply swivel the vise up to 45 degrees and tighten.

provides a 45 degree angle.

VARI-SPEED DRIVE provides infinite adjustment of cutting speed from 65 to 170 strokes per minute.

- 2 -

HOW TO SELECT AND USE POWER HACK SAW BLADES

Power hack saws automatically take a Full Stroke each time, automatically Lift the blade on reverse stroke and apply steady cutting pressure throughout the length of the stroke.

The proper tensioning of the power hack saw blade is most important. Insufficiently tensioned blades wear rapidly, cut inaccurately and deliver a blank with a poor finish. A blade tensioned too tightly breaks prematurely or pulls out at the pin hole.



If chips are burned you are finding too heavy. If chips are fine and Wry you are feeding too light. Act with nicely curled chips indicates ideal feeding pressure, fastast cutting time and longest blade life.

For most cutting jobs, the all-hard blade is first choice for straight, accurate cutting. The all- hard tungsten blade is unexcelled for retaining its sharp teeth. It handles work hardening materials, abrasive materials, stainless, high manganese steels and the low machinability bronzes. Molybdenum blades are good for fast, accurate cutting, but especially on low or medium alloy steels, iron and most non-ferrous metals.

You gain more by selecting the COARSEST TOOTH for the work. This is necessary for good chip appearance as more pressure can be applied for a better bite, without clogging.(Of course, the feedpressure-per tooth must be kept below the point of fracturing the teeth). Large Sections and soft materials require coarse teeth. Thin sections and hard-to-machine materials require fine teeth.

USE HEAVY FEED PRESSURE

Normally you should set the feed pressure as heavy as possible without breaking the teeth or making the blade cut crooked. Excessive pressure and stroke speed increase the cutting rate at the expense of blade wear.[When in doubt, keep pressure at maximum but reduce the stroke speed).

The heaviest practical pressure and the fastest reasonable stroke speed produce the most efficient cutting.

A feed-rate that is too light results in rubbing instead of cutting; (tooth points overheat, soften and break down). For optimum feed rate: Use heavy feed for hard, very dense material-light feed for thin, soft material. For maximum production, you can increase feed by using coarse blades on soft materials. But remember to use moderate feed when straight, accurate cutting is required.

USE PLENTY OF COOLANT

Start the coolant flow before the first cutting stroke. Coolant is needed on all materials (except cast iron, copper and some brasses) to reduce friction, blade wear, and chip clogging. Keep coolant flowing until job is finished and the blade is stopped.

-3-

REPAIR PARTS FOR #3 HY DUTY HACK SAW

- 1C Cabinet Base
- 2C Cabinet Door
- 3C Motor Shelf Bracket
- 4C Motor Shelf
- 5C Motor Shelf Pin
- 6C Saw Table
- 7C Tension Screw
- 8C Tension Screw Handle
- 9C Pressure Yoke
- 10C Pressure Yoke Springs (2 to set)
- 11C Tension Bar
- 12C Foot Lever Pad Assembly
- 13C Switch
- 14C Stop Post and Shut-Off Assembly
- 18C Flenge Casting for Pressure Lever
- 19C Pressure Lever
- 20C Guide Bar Support Arm
- 21C Crank Shaft Disc Assembly
- 21C-1 Hydraulic Pump Cam Lever
- 22C V-Belt
- 23C Main Bearing
- 24C Drive Shaft Pinion Assembly
- 25C Set Collar
- 26C Drive Gear
- 29C V-Drive Pulley



~ 7 ~	
270	Gear Guard
28C	Stock Support Bracket
30C	Hookup Bar Assembly
32C	Gauge Bar Clamp
330	Gauge Bar Assembly
330	
350	Saw Frame-Only
36C	Guide Bar
36C-1	Guide Bar Handle & Pin
37C	Brass Gibs for Saw
	Frame (4 to set)
380	Connecting Rod Wrist Pin
200	Connecting Rod Whist I II
330	
40C	Saw Blade Support Bar
41C	Saw Blade Tension Bar
42C	Saw Blade Tension Nut
43C	Saw Blade Tension Clamp
44C	Stud Bolt for Saw Frame
45C	Solid Vise Jaw
400	Viac Doile (2 to oot)
460	
47C	Loose Vise Jaw
48C	Vise Nut
49C	Vise Screw Assembly
50C	Vise Complete
54C	Lower Coolant Line
550	Elexible Coolant Tube
000	Assembly
560	Coolant Pump
500	Transformers for Coolant During
570	Transformer for Coolant Pump
	(Required only on Three
	Phase Electrics)
94C	Automatic Oiler
95C	Hi-Lo Motor Pulley
97C	Variable Speed Control
	Assembly
98C	Handwheel for Variable
000	Speed Control
1000	Oil Beachair Tank
1000	
1000-1	
101C	Oil Reservoir Cover
102C	Hydraulic Cylinder Assembly
103C	Hydraulic Pump Assembly
104C	Hydraulic Pump Elbow
106C	Hydraulic Pump Push Rod
107C	Hydraulic Lines
1090	Brass Hose Fitting Pump
1200	Belt Guard Assembly
1200	Cropk Diog Cuerd
1210	GIALIK DISC GUALU





Model 3HY-DUTY Power Hack Saw (1) JARDS REMOVED)

(DOWN 33") (UP 57 1/2")-

FLOOR

. 10 10

TOP OF HOOK-UP BAR TOP OF SAW FRAME

-6-

By Order of the Secretary of the Army:

E.C.MEYER General, United States Army Chief of Staff

Official:

J.C.PENNINGTON Major General, United States Army The Adjutant General

DISTRIBUTION:

U.S ARMY ADUST GENERAL PUBLICATIONS CENTER, ST. LOUIS, MO, 1985 PIN: 047571-000

7 5	1		Someti	JONG	WRONG	WITH THIS PUBL	ICATION?	
		THEN. J DOPE ABO FORM, CA OUT, FOLI	OT DOWN THE DUT IT ON THIS REFULLY TEAR IT D IT AND DROP IT	FROM:	(PRINT YOUR U	NIT'S COMPLETE ADOR	iess)	
IN THE MAIL!					DATESENT			
PUBLICATION	NUMBER		PUBLICATION D	ATE	PUBLICATION TI	TLE		
BE EXACT.	PIN-POINT WHE	TABLE NO.	IN THIS SPACE TELL I AND WHAT SHOULD I	WHAT IS	WRONG ABOUT IT:		<u></u>	
PRINTED NAM	E. GRADE OR TITLE	. AND TELEPH	ONE NUMBER	SIGN HE	RE:			