

Service Technical Information

MODEL NO. NSX-F959, KF979, F958, F969, MT960, AVF960, A959
SUBJECT FL No DISPLAY



REF.No. :G - 99 - 014 - E0


DATE :24. MAY. 1999

<CONTENTS>

In the case that PR107 is open circuit in the above model, FL No DISPLAY may occur.

<REMEDIES>

Replace the PR107 on FRONT C.B., and must affix the new LABEL FUSE as specified in the following table.

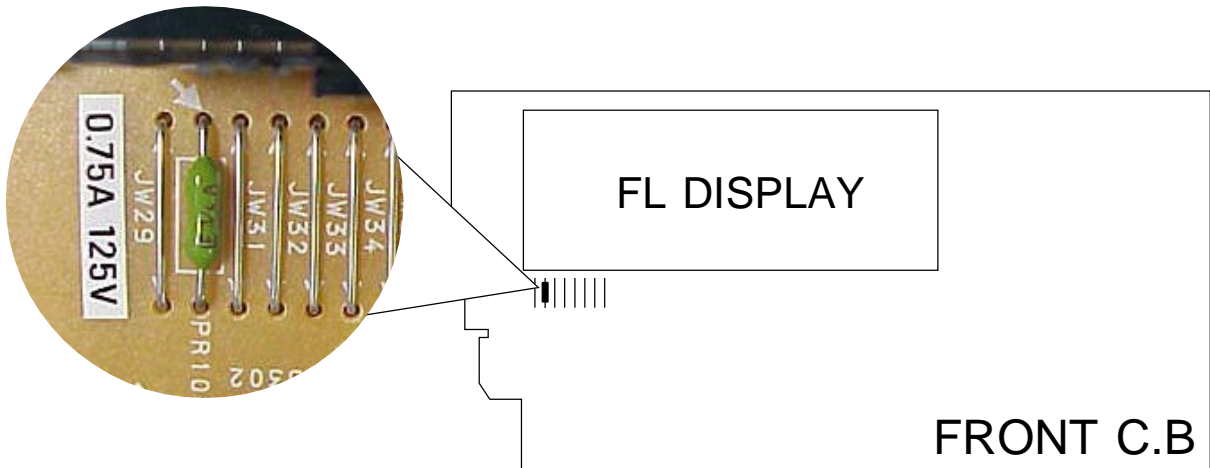

Ref.	Parts Code	Description	Remarks
PR107	87-A91-469-080	FUSE, 750mA 125V T 473	-
-	88-NF3-674-010	LABEL,FUSE 0.75A 125V	-

G	R	Code No.	Access Code	Modified Ser. No.	Parts Schedule
-	-	-	-	-	26-JULY