



Site Master
Model S332D
Cable, Antenna, and Spectrum Analyzer
MAINTENANCE MANUAL

SiteMaster 

Anritsu

Table of Contents

1. Introduction	1
2. Description	1
3. VNA Frequency Accuracy	1
4. VNA Return Loss Verification	2
5. InstaCal Module Verification	3
6. Spectrum Analyzer Frequency Accuracy	4
7. Spectrum Analyzer Phase Noise Verification	5
8. Spectrum Analyzer Second Harmonic Distortion Test	6
9. Spectrum Analyzer Residual Spurious Response Test	7
10. Spectrum Analyzer Resolution Bandwidth Accuracy Test	9
11. Spectrum Analyzer Measurement Accuracy Verification	12
12. Power Monitor Verification (Option 5)	21
13. Bias Tee Verification (Option 10)	22
14. Bias Tee Verification (Option 10A)	23
15. Transmission Measurement Verification (Option 21)	24
16. Power Meter Verification (Option 29)	26
17. FCN4760 Frequency Converter Verification	29
18. Battery Pack Removal and Replacement	35
19. Battery Information	37
20. Front Panel Assembly Removal and Replacement	38
21. LCD Assembly Replacement	40
22. Key Pad PCB Replacement	40
23. Key Pad Membrane Replacement	41
24. Main PCB Assembly Replacement	41
25. Option 5 Power Monitor PCB Assembly Replacement	43
26. Accessories and Replaceable Parts	44
27. Customer Service	46

1. Introduction

This manual provides maintenance instructions for the Site Master Model S332D Cable, Antenna and Spectrum Analyzer. It describes the product and provides performance verification procedures, parts replacement procedures, and a replaceable parts list.

2. Description

The Site Master is a handheld SWR/RL (standing wave ratio/return loss), Distance-To-Fault, spectrum analysis, and power meter (optional) measurement instrument. It combines a synthesized source, VSWR bridge, receiver, and spectrum analyzer circuitry in a compact instrument.

The following sections contain tests that can be used to verify the performance of the Site Master Model S332D.

Throughout this manual, the term “VNA” denotes Return Loss, SWR, Cable Loss and DTF modes, and the term “SPA” denotes Spectrum Analyzer mode. All other modes are referenced individually.

3. VNA Frequency Accuracy

The following test can be used to verify the CW frequency accuracy of the Site Master. Measurement calibration of the Site Master is not required for this test.

a. **Equipment Required:**

- Spectrum Analyzer Anritsu Model MS2665C or equivalent
- 10 MHz Reference Standard

b. **Procedure:**

1. Connect a 10 MHz Reference signal to the 10 MHz STD Ref In of the MS2665C or equivalent.
2. Press and hold the **ESCAPE/CLEAR** key, then press the **ON/OFF** key to turn on the Site Master. (This sets the instrument to the factory preset state.)

NOTE: Before continuing, allow a five minute warm up for the internal circuitry to stabilize.

3. Press the **FREQ/DIST** key, then press the F1 soft key and set F1 to 1000 MHz, then press the **ENTER** key.
4. Press the F2 soft key, set F2 to 1000 MHz, then press the **ENTER** key.
5. Press the **MEAS/DISP** key, then press the Fixed CW soft key to turn Fixed CW On.
6. Connect the RF cable from the Site Master Reflection Test Port to the RF Input on the MS2665C or equivalent.
7. Set up the MS2665C as follows:
 - (a) Press the **Preset** key, then select **Preset All** (F1).
 - (b) Press the **Frequency** key.
 - (c) Press the **1** key and then the **GHz** key to change the Center Frequency to 1 GHz.
 - (d) Press the **Span** key.
 - (e) Press the **7, 5, 0,** and **kHz** keys sequentially to change the Frequency Span to 750 kHz.
 - (f) Press the **RBW** key.
 - (g) Press the **1, 0** and **kHz** keys sequentially to change the RBW to 10 kHz.
 - (h) Press the **VBW** key.
 - (i) Press the **Filter Off** soft key (F3) to turn the VB filter off.
 - (j) Press the **Amplitude** key.

- (k) Press the **0**, and **dBm** keys sequentially to change the Reference Level to 0 dBm.
- (l) Press the **Log Scale** soft key (F5)
- (m) Select **2 dB/Div** (F3) and the press the **return** soft key.

*NOTE: If the Site Master has gone into the hold mode, press the **RUN/HOLD** key to return to normal mode.*

8. When a peak response appears on the Spectrum Analyzer, press the **Marker Peak Search** key on the Spectrum Analyzer. Verify that the marker peak readout value is 1000 MHz \pm 75 kHz.
9. On the Site Master, press the **MEAS/DISP** key then the Fixed CW soft key to turn Fixed CW off.

4. VNA Return Loss Verification

The following test can be used to verify the accuracy of return loss measurements. Measurement calibration of the Site Master is required for this test.

a. **Equipment Required:**

- 20 dB offset, Anritsu SC7423
- 6 dB offset, Anritsu SC7424
- Open/Short, Anritsu 22N50
- 50 Ohm Termination, Anritsu 28N50-2 or SM/PL

b. **Procedure:**

1. Press and hold the **ESCAPE/CLEAR** key, then press the **ON/OFF** key to turn on the Site Master. (This sets the instrument to the factory preset state.)

NOTE: Before continuing, allow a five minute warm up for the internal circuitry to stabilize.

2. Press the **MODE** key.
3. Use the Up/Down arrow key to highlight Return Loss, then press **ENTER**.
4. Press the **START CAL** key.
5. Follow the instructions on the screen to perform a calibration using a 22N50 Open/Short and 28N50-2 or SM/PL Termination.
6. Connect the 20 dB offset to the Refl Test Port and verify that the reading is 20 dB \pm 1.7 dB.
7. Connect the 6 dB offset to the Refl Test Port and verify that the reading is 6 dB \pm 1.2 dB.

5. InstaCal Module Verification

This test verifies the performance of the Anritsu Site Master InstaCal Calibration Module. The InstaCal Module, part number ICN50, is an optional accessory for the S332D.

a. **Equipment Required:**

- InstaCal Module, part number ICN50
- 20 dB offset, Anritsu SC5270
- 6 dB offset, Anritsu SC5237

b. **Procedure**

1. Press and hold the **ESCAPE/CLEAR** key, then press the **ON/OFF** key to turn on the Site Master. (This sets the instrument to the factory preset state.)

NOTE: Before continuing, allow a five minute warm up for the internal circuitry to stabilize.

2. Press the **MODE** soft key.
3. Use the Up/Down arrow key to highlight **RETURN LOSS**, then press **ENTER**.
4. Press the **START CAL** key. The message “CONNECT OPEN or InstaCal TO RF Out PORT” will appear in the display.
5. Connect the InstaCal module to the RF Out port and press the **ENTER** key.

NOTES: If this particular InstaCal module has been used to calibrate this Site Master before, the Site Master senses the familiar InstaCal module and automatically calibrates the unit using the OSL procedure.

If the Site Master senses that the characterization data for the InstaCal module connected to this Site Master is different than the one currently stored, it will display soft key options to keep or replace the InstaCal characterization data.

Selecting the YES soft key transfers all of the characterization data from this InstaCal module to the Site Master. The transfer may take up to three minutes. This option is preferred if this InstaCal module is to stay with this particular Site Master. Once completed, the data will not need to be transferred again for this combination of Site Master and InstaCal module.

Selecting the NO soft key will temporarily transfer only the portion of the characterization data necessary for this particular calibration. This transfer takes approximately 30 to 60 seconds, and will have to be repeated every time a calibration is done using this combination of Site Master and InstaCal module.

6. Verify that the calibration has been properly performed by checking that the **CAL ON!** message is displayed in the upper left corner of the display.
7. Remove the InstaCal module from the RF Out port and connect the 20 dB Offset to the RF Out port.
8. Measure the return loss of the 20 dB Offset. The level should be 20 dB, ± 2 dB across the calibrated frequency range.
9. Remove the 20 dB Offset from the RF Out port and connect the 6 dB Offset to the RF Out port.
10. Measure the return loss of the 6 dB Offset. The level should be 6 dB, ± 1.2 dB across the calibrated frequency range.

6. Spectrum Analyzer Frequency Accuracy

The following test can be used to verify the CW frequency accuracy of the Site Master Spectrum Analyzer.

a. **Equipment Required:**

- Anritsu MG3692A Synthesized Signal Source, with option 15A or equivalent
- Anritsu 34RSN50 50 ohm adapter or equivalent
- Anritsu 15NNF50-1.5C RF Coaxial Cable or equivalent
- 10 MHz Reference Standard
- BNC male to BNC male coaxial cable

b. **Procedure:**

1. Connect the 10 MHz reference source to the Anritsu MG3692A Synthesized Signal Source.
2. Connect the output of the source to the RF Input of the Site Master.
3. Connect the external power supply (Anritsu part number 40-168) to the Site Master.
4. Press and hold the **ESCAPE/CLEAR** key, then press the **ON/OFF** key to turn on the Site Master. (This sets the instrument to the factory preset state.)
5. Turn on the 10 MHz reference source and the Anritsu MG3692A Synthesized Signal Source.
6. Set the MG3692A output to 2000 MHz CW, with an RF output level of 0 dBm.

NOTE: Before continuing, allow a 30-minute warm up for the internal circuitry to stabilize.

7. On the Site Master, press the **MODE** key. Use the up/down arrow key to highlight Spectrum Analyzer and press **ENTER** to select spectrum analyzer mode.
8. Press the **AMPLITUDE** key and the Ref Level soft key.
9. Enter 20 and press the **ENTER** key to set the Reference Level to 20 dBm.
10. Press the **FREQ/DIST** key and the Center soft key.
11. Enter 2000 and press **ENTER** to set the center frequency to 2000 MHz.
12. Press the Span soft key, enter 20, and press the kHz soft key to set the span to 20 kHz.
13. Confirm that the RBW is 100 Hz, and the VBW is 30 Hz. If adjustment of the RBW and VBW are required:
 - (a) Press the **MEAS/DISP** key and the Bandwidth soft key.
 - (b) Press the RBW Manual soft key and use the Up/Down arrow key to select 100 Hz. Press **ENTER** to set the resolution bandwidth to 100 Hz.
 - (c) Press the VBW Manual soft key and use the Up/Down arrow key to select 30 Hz. Press **ENTER** to set the video bandwidth to 30 Hz.
14. Press the **MARKER** key, then the M1 soft key.
15. Select the Edit soft key and use the Up/Down arrow key to center the marker on the waveform. Verify that the marker frequency is 2000 MHz \pm 4 kHz.

7. Spectrum Analyzer Phase Noise Verification

This test can be used to verify the phase noise of the Site Master Spectrum Analyzer.

a. **Equipment Required:**

- Anritsu MG3692A Synthesized Signal Source, with options 2A, 4 and 15A, or equivalent
- Anritsu 34RSN50 50 ohm adapter or equivalent
- Anritsu 15NNF50-1.5C RF Coaxial Cable or equivalent

b. **Procedure:**

1. Connect the output of the source to the Site Master RF Input.
2. Connect the external power supply (Anritsu part number 40-168) to the Site Master.
3. Press and hold the **ESCAPE/CLEAR** key, then press the **ON/OFF** key to turn on the Site Master. (This sets the instrument to the factory preset state.)

NOTE: Before continuing, allow a 30-minute warm up for the internal circuitry to stabilize.

4. Set the MG3692A output to 1000 MHz CW, with an RF output level of –30 dBm.
5. On the Site Master, press the **MODE** key. Use the Up/Down arrow key to highlight Spectrum Analyzer, then, press the **ENTER** key to select spectrum analyzer mode.
6. Press the **MEAS/DISP** key and the Bandwidth soft key.
7. Press the RBW Manual soft key and use the Up/Down arrow key to select 1 kHz. Press **ENTER** to set the resolution bandwidth to 1 kHz.
8. Press the VBW Manual soft key and use the Up/Down arrow key to select 30 Hz. Press **ENTER** to set the video bandwidth to 30 Hz.
9. Press the **FREQ/DIST** key and the CENTER soft key.
10. Enter 1000 and press the **ENTER** key to set the center frequency to 1000 MHz.
11. Press the **SPAN** soft key and enter 0.1. Press the **ENTER** key to set the span to 0.100 MHz.
12. Press the **AMPLITUDE** key.
13. Press the REF LEVEL soft key and enter –27. Press **ENTER** to set the reference level to –27 dBm.
14. Press the **MARKER** key, then the M1 soft key.
15. Press EDIT and enter 1000. Press **ENTER** to set the M1 marker frequency to 1000 MHz.
16. Press the BACK soft key and the M2 soft key.
17. Press EDIT and enter 1000.03. Press **ENTER** to set the M2 marker frequency to 1000.03 MHz (30 kHz higher than the center frequency).
18. Press the DELTA (M2–M1) soft key.
19. Press the **RUN/HOLD** key and read and record the $\Delta 2$ reading
20. Press the **RUN/HOLD** key to read and record five values, then calculate the average of the five recorded values.
21. Subtract 30 dB from the average value and verify that the result is ≤ -75 dBc/Hz. (For example: –45 dBc measured – 30 dB = –75 dBc/Hz.)

NOTE: The measured value is converted to dBc/Hz using the following formula:

$$\text{dBc / Hz} = - \left| \text{measured dBc} \right| - \left[10_{\log} \left(\frac{\text{RBW}}{1\text{Hz}} \right) \right]$$

$$\text{At 1 kHz RBW, } 10_{\log} \left(\frac{\text{RBW}}{1\text{Hz}} \right) = 30, \text{ so dBc / Hz} = - \left| \text{measured dBc} \right| - 30.$$

22. Press the **BACK** soft key and the M3 soft key.
23. Press the **EDIT** key and enter 999.97. Press **MHz** to set the M3 marker frequency to 999.97 MHz (30 kHz lower than the center frequency).
24. Press the **DELTA (M3-M1)** soft key.
25. Press the **RUN/HOLD** key. Read and record the $\Delta 3$ reading.
26. Press the **RUN/HOLD** key to read and record five values, then calculate the average of the five recorded values.
27. Subtract 30 dB from the average value and verify that the result is ≤ -75 dBc/Hz. (For example: -45 dBc measured $- 30$ dB = -75 dBc/Hz.)

8. Spectrum Analyzer Second Harmonic Distortion Test

The following test can be used to verify the input related spurious response of the Site Master Spectrum Analyzer.

a. **Equipment Required:**

- Anritsu MG3692A Synthesized Signal Source with options 2A, 4 and 15A, or equivalent
- Anritsu 34RSN50 50 ohm adapter or equivalent
- Anritsu 15NNF50-1.5C RF Coaxial Cable or equivalent
- 10 MHz Reference Standard
- 50 MHz Low Pass Filter (Anritsu part number 1030-96)
- BNC male to BNC male coaxial cable

b. **Procedure:**

1. Connect the 10 MHz reference source to the Anritsu MG3692A Synthesized Signal Source.
2. Connect one end of the 50 MHz Low Pass Filter to the output of the source and the other end to the Site Master Spectrum Analyzer RF Input with the coaxial cable.
3. Connect the external power supply (Anritsu part number 40-168) to the Site Master.
4. On the Site Master, press and hold the **ESCAPE/CLEAR** key, then press the **ON/OFF** key to turn on the Site Master. (This sets the instrument to the factory preset state.)
5. Turn on the 10 MHz reference source and the Anritsu MG3692A Synthesized Signal Source.
6. Set the MG3692A output to 40 MHz CW, with an RF output level of -30 dBm.

NOTE: Before continuing, allow a 30-minute warm up for the internal circuitry to stabilize.

7. On the Site Master, press the **MODE** key. Use the Up/Down arrow key to highlight Spectrum Analyzer, then, press the **ENTER** key to select spectrum analyzer mode.
8. Press the **AMPLITUDE** key and the Ref Level soft key.
9. Enter -27 and press the **ENTER** key to set the Reference Level to -27 dBm.
10. Press the **Scale** soft key and enter 7 then press **ENTER**.
11. Press the **Atten/Preamp** soft key and then the **Manual** soft key.
12. Enter 0 and press **ENTER** to set the attenuation to 0 dB.
13. Press the **FREQ/DIST** key and then the **Center** soft key.
14. Enter 40 and press the **MHz** soft key to set the center frequency to 40 MHz.
15. Press the **Span** soft key and enter 0.2. Press the **MHz** soft key to set the span to 0.200 MHz.
16. Press the **MEAS/DISP** key and the **Bandwidth** soft key.

17. Press the RBW Manual soft key and use the Up/Down arrow key to select 10 kHz. Press **ENTER** to set the resolution bandwidth to 10 kHz.
18. Press the VBW Manual soft key and use the Up/Down arrow key to select 3 kHz. Press **ENTER** to set the video bandwidth to 3 kHz.
19. Press the **MARKER** key, then the M1 soft key.
20. Select the Edit soft key, then enter 40. Press the MHz soft key to set M1 to 40 MHz .
21. On the MG3692A Synthesized Signal Source, adjust the output level so that the M1 reading of Site Master Spectrum Analyzer is -30 dBm at 40 MHz.
22. On the Site Master, press the **FREQ/DIST** key and then the Center soft key.
23. Enter 80 and press the MHz soft key to set the center frequency to 80 MHz.
24. Press the **MARKER** key and the M1 soft key.
25. Select the Edit soft key, then enter 80. Press the MHz soft key to set M1 to 80 MHz .
26. Record the amplitude of the signal at M1 80 MHz:

Second Harmonic Level @ 80 MHz = _____ dBm

27. Convert this measured value to dBc using the following formula:
 Input Related Spurious Response (dBc) = [Second Harmonic Level @ 80 MHz]
 + 30 dBm = _____ dBc

Specifications for this measurement are -45 dBc with -30 dBm into the first mixer.

9. Spectrum Analyzer Residual Spurious Response Test

The following test can be used to verify the residual spurious response of the Site Master Spectrum Analyzer. This test is performed using the positive peak detection mode.

a. **Equipment Required:**

- Anritsu 28N50-2 or SM/PL 50 ohm Termination or equivalent

b. **Procedure:**

1. Connect the 50 ohm termination to the Site Master RF Input.
2. On the Site Master, press and hold the **ESCAPE/CLEAR** key, then press the **ON/OFF** key to turn on the Site Master. (This sets the instrument to the factory preset state.)

NOTE: Before continuing, allow a 30-minute warm up for the internal circuitry to stabilize.

3. On the Site Master, press the **MODE** key. Use the Up/Down arrow key to highlight Spectrum Analyzer, then, press the **ENTER** key to select spectrum analyzer mode.
4. Press the **AMPLITUDE** key and the Ref Level soft key.
5. Enter -75 and press the **ENTER** key to set the Reference Level to -75 dBm.
6. Press the Scale soft key and enter 5, then press **ENTER**.
7. Press the **MEAS/DISP** key and the Bandwidth soft key.
8. Press the RBW Manual soft key and use the Up/Down arrow key to select 10 kHz. Press **ENTER** to set the resolution bandwidth to 10 kHz.
9. Press the VBW Manual soft key and use the Up/Down arrow key to select 3 kHz and press **ENTER** to set the video bandwidth to 3 kHz.
10. Press the **FREQ/DIST** key and the Start soft key.

11. Enter 100 and press the kHz soft key to set the start frequency to 100 kHz.
12. Press the Stop soft key and enter 10, then press the MHz soft key to set the stop frequency to 10 MHz.
13. Wait till one full sweep is complete.
14. Press the **MARKER** key and then the M1 soft key.
15. Press the Marker To Peak soft key.
16. Record the M1 amplitude reading and verify whether it is less than or equal to -80 dBm.

NOTE: If a spur with an amplitude larger than -80 dBm occurs, wait another full sweep and observe whether the spur occurs at the same point on the second sweep. If the spur does not occur at the same point on the second sweep, then the spur on the first sweep was not real.

17. Press the **FREQ/DIST** key and the Start soft key.
18. Enter 10 and press the MHz soft key to set the start frequency to 10 MHz.
19. Press the Stop soft key and enter 1000, then press the MHz soft key to set the stop frequency to 1000 MHz.
20. Wait until one full sweep is complete.
21. Press the **MARKER** key and record the M1 amplitude reading and verify it is ≤ -90 dBm.

NOTE: If a spur with an amplitude larger than -90 dBm occurs, wait another full sweep and observe whether the spur occurs at the same point on the second sweep. If the spur does not occur at the same point on the second sweep, then the spur on the first sweep was not real.

22. Press the **FREQ/DIST** key and the Start soft key.
23. Enter 1000 and press the MHz soft key to set the start frequency to 1000 MHz.
24. Press the Stop soft key and enter 2000, then press the MHz soft key to set the stop frequency to 2000 MHz.
25. Wait until one full sweep is complete.
26. Press the **MARKER** key and record the M1 amplitude reading and verify it is ≤ -90 dBm.

NOTE: If a spur with an amplitude larger than -90 dBm occurs, wait another full sweep and observe whether the spur occurs at the same point on the second sweep. If the spur does not occur at the same point on the second sweep, then the spur on the first sweep was not real.

27. Press the **FREQ/DIST** key and the Start soft key.
28. Enter 2000 and press the MHz soft key to set the start frequency to 2000 MHz.
29. Press the Stop soft key and enter 3000, then press the MHz soft key to set the stop frequency to 3000 MHz.
30. Wait until one full sweep is complete.
31. Press the **MARKER** key and record the M1 amplitude reading and verify it is ≤ -90 dBm.

NOTE: If a spur with an amplitude larger than -90 dBm occurs, wait another full sweep and observe whether the spur occurs at the same point on the second sweep. If the spur does not occur at the same point on the second sweep, then the spur on the first sweep was not real.

10. Spectrum Analyzer Resolution Bandwidth Accuracy Test

The following test can be used to verify the resolution bandwidth accuracy of the Site Master Spectrum Analyzer at different frequencies.

a. **Equipment Required:**

- Anritsu MG3692A Synthesized Signal Source with options 2A, 4 and 15, or equivalent
- Anritsu 34RSN50 50 ohm adapter or equivalent
- Anritsu 15NNF50-1.5C RF Coaxial Cable or equivalent
- 10 MHz Reference Standard
- BNC male to BNC male coaxial cable

b. **Procedure:**

1. Connect the 10 MHz reference source to the Anritsu MG3692A Synthesized Signal Source.
2. Connect the output of the Anritsu MG3692A Synthesized Signal Source to the Site Master Spectrum Analyzer RF Input.
3. On the Site Master, press and hold the **ESCAPE/CLEAR** key, then press the **On/Off** key to turn on the Site Master. (This sets the instrument to the factory preset state.)

NOTE: Before continuing, allow a 30-minute warm up for the internal circuitry to stabilize.

4. Set the MG3692A output to 1 GHz, with an RF output level of -30 dBm.
5. On the Site Master, press the **MODE** key. Use the Up/Down arrow key to highlight Spectrum Analyzer, then, press the **ENTER** key to select spectrum analyzer mode.
6. Press the **AMPLITUDE** key and the Ref Level soft key.
7. Enter -27 and press the **ENTER** key to set the Reference Level to -27 dBm.
8. Press the Scale soft key and enter 3, then press **ENTER**.
9. Press the **FREQ/DIST** key and the Center soft key.
10. Enter 1 and press the GHz soft key to set the center frequency to 1 GHz.

NOTE: The Measured Occupied BW value for each RBW setting can be recorded in Table 1, page 11.

1 MHz RBW Test

11. Press the Span soft key, enter 1.5 and press the MHz soft key to set the span to 1.5 MHz.
12. Press the **MEAS/DISP** key and the Bandwidth soft key.
13. Press the RBW Manual soft key and use the Up/Down arrow key to select 1 MHz. Press **ENTER** to set the resolution bandwidth to 1 MHz.
14. Press the VBW Manual soft key and use the Up/Down arrow key to select 3 kHz and press **ENTER** to set the video bandwidth to 3 kHz and select **BACK**.
15. Press the Measure soft key, the OBW soft key, the dBc soft key, and then the **ENTER** key.
16. Press the Measure soft key, then the **MARKER** key. Press the M2 soft key and then the Delta (M2-M1) soft key. The displayed $\Delta 2$ frequency should be $\pm 5\%$ of the RBW.

300 kHz RBW Test

17. Press the **FREQ/DIST** key.
18. Press the Span soft key, enter 450 and press the kHz soft key to set the span to 450 kHz.
19. Press the **MEAS/DISP** key and the Bandwidth soft key.

20. Press the RBW Manual soft key and use the Up/Down arrow key to select 300 kHz. Press **ENTER** to set the resolution bandwidth to 300 kHz and select **BACK**.
21. Press the Measure soft key and then the **MARKER** key.
22. Press the M2 soft key. The displayed $\Delta 2$ frequency should be $\pm 5\%$ of the RBW.

100 kHz RBW Test

23. Press the **FREQ/DIST** key.
24. Press the Span soft key, enter 150 and press the kHz soft key to set the span to 150 kHz.
25. Press the **MEAS/DISP** key and the Bandwidth soft key.
26. Press the RBW Manual soft key and use the Up/Down arrow key to select 100 kHz. Press **ENTER** to set the resolution bandwidth to 100 kHz and select **BACK**.
27. Press the Measure soft key and then the **MARKER** key.
28. Press the M2 soft key. The displayed $\Delta 2$ frequency should be $\pm 5\%$ of the RBW.

30 kHz RBW Test

29. Press the **FREQ/DIST** key.
30. Press the Span soft key, enter 45 and press the kHz soft key to set the span to 45 kHz.
31. Press the **MEAS/DISP** key and the Bandwidth soft key.
32. Press the RBW Manual soft key and use the Up/Down arrow key to select 30 kHz. Press **ENTER** to set the resolution bandwidth to 30 kHz and select **BACK**.
33. Press the Measure soft key to measure the bandwidth, then press the **MARKER** key.
34. Press the M2 soft key. The displayed $\Delta 2$ frequency should be $\pm 5\%$ of the RBW.

10 kHz RBW Test

35. Press the **FREQ/DIST** key.
36. Press the Span soft key, enter 15 and press the kHz soft key to set the span to 15 kHz.
37. Press the **MEAS/DISP** key and the Bandwidth soft key.
38. Press the RBW Manual soft key and use the Up/Down arrow key to select 10 kHz. Press **ENTER** to set the resolution bandwidth to 10 kHz and select **BACK**.
39. Press the VBW Manual soft key and use the Up/Down arrow key to select 30 Hz. Press **ENTER** to set the video bandwidth to 30 Hz and select **BACK**.
40. Press the Measure soft key, then the **MARKER** key.
41. Press the M2 soft key. The displayed $\Delta 2$ frequency should be $\pm 5\%$ of the RBW.

3 kHz RBW Test

42. Press the **FREQ/DIST** key.
43. Press the Span soft key, enter 4.5 and press the kHz soft key to set the span to 4.5 kHz.
44. Press the **MEAS/DISP** key and the Bandwidth soft key.
45. Press the RBW Manual soft key and use the Up/Down arrow key to select 3 kHz. Press **ENTER** to set the resolution bandwidth to 3 kHz and select **BACK**.
46. Press the Measure soft key to measure the bandwidth, then press the **MARKER** key.
47. Press the M2 soft key. The displayed $\Delta 2$ frequency should be $\pm 5\%$ of the RBW.

1 kHz RBW Test

48. Press the **FREQ/DIST** key.

49. Press the Span soft key, enter 1.5 and press the kHz soft key to set the span to 1.5 kHz.
50. Press the **MEAS/DISP** key and the Bandwidth soft key.
51. Press the RBW Manual soft key and use the Up/Down arrow key to select 1 kHz. Press **ENTER** to set the resolution bandwidth to 1 kHz and select **BACK**.
52. Press the Measure soft key then the **MARKER** key.
53. Press the M2 soft key. The displayed $\Delta 2$ frequency should be $\pm 5\%$ of the RBW.

300 Hz RBW Test

54. Press the **FREQ/DIST** key.
55. Press the Span soft key, enter 450 and press the Hz soft key to set the span to 450 Hz.
56. Press the **MEAS/DISP** key and the Bandwidth soft key.
57. Press the RBW Manual soft key and use the Up/Down arrow key to select 1 kHz. Press **ENTER** to set the resolution bandwidth to 300 Hz and select **BACK**.
58. Press the Measure soft key then the **MARKER** key.
59. Press the M2 soft key. The displayed $\Delta 2$ frequency should be $\pm 5\%$ of the RBW.

100 Hz RBW Test

60. Press the **FREQ/DIST** key.
61. Press the Span soft key, enter 150 and press the Hz soft key to set the span to 150 Hz.
62. Press the **MEAS/DISP** key and the Bandwidth soft key.
63. Press the RBW Manual soft key and use the Up/Down arrow key to select 100 Hz. Press **ENTER** to set the resolution bandwidth to 100 Hz and select **BACK**.
64. Press the Measure soft key then the **MARKER** key.
65. Press the M2 soft key. The displayed $\Delta 2$ frequency should be $\pm 5\%$ of the RBW.

Table 1. RBW Check

RBW Setting	Lower Limit	Measured Value	Upper Limit
1 MHz	0.95 MHz		1.05 MHz
300 kHz	285 kHz		315 kHz
100 kHz	95 kHz		105 kHz
30 kHz	28.5 kHz		31.5 kHz
10 kHz	9.5 kHz		10.5 kHz
3 kHz	2.85 kHz		3.15 kHz
1 kHz	0.95 kHz		1.05 kHz
300 Hz	285 Hz		315 Hz
100 Hz	95 Hz		105 Hz

11. Spectrum Analyzer Measurement Accuracy Verification

The tests in this section verify the level accuracy of the Site Master Spectrum Analyzer. There are two parts to this test:

- Level Accuracy with Frequency Test
- Level Accuracy with Power Test

Level Accuracy with Frequency Test

a. **Equipment Required:**

- Anritsu MG3692A Synthesized Signal Source, with options 2A, 4 and 15A
- Anritsu ML2438A Dual Channel Power Meter or equivalent
- Anritsu MA2442A High Accuracy Power Sensors or equivalent (2)
- Anritsu N241A50 Power Splitter or equivalent
- Anritsu 34NN50A 50 ohm adapter or equivalent
- Anritsu 34RSN50 50 ohm adapter or equivalent
- Anritsu 34RKNF50 50 ohm adapter or equivalent
- Anritsu 15NNF50-1.5C RF Coaxial Cable or equivalent
- Weinschel 1-10 10 dB Fixed Attenuator

b. **Procedure**

1. Turn on the power meter and signal source.

NOTE: Before continuing, allow a 30-minute warm up for the internal circuitry to stabilize.

2. On the power meter, press the Channel key, the Setup soft key and then the CHANNEL soft key to display Channel 2 setup menu. Press the INPUT key twice to set the Input Configuration to B. Press the Sensor key to display both Sensor A and Sensor B readings.
3. Connect the power sensors to the power meter and calibrate the sensors.
4. Set the MG3692A output power level to 5 dBm.
5. Set the MG3692A output to 30 MHz CW.
6. On the power meter, press the Sensor key, the Cal Factor soft key, and then the FREQ soft key. Use the keypad to enter 30 MHz as the input signal frequency, which sets the power meter to the proper power sensor cal factor. Press the SENSOR key on the power meter to display the power reading.
7. Connect Sensor A to the MG3692A output, measure the output power level and record the value in column A of Table 2.
8. Disconnect Sensor A from the MG3692A output.
9. Connect the power splitter to the MG3692A output and Sensor B to one of the power splitter outputs. Install the 10 dB Fixed Attenuator to the other power splitter output and then connect Sensor A to the end of the Attenuator. Refer to Figure 1.
10. Record the new sensor A reading in column B of Table 2.
11. Record the Sensor B reading in column D of Table 2.
12. Calculate the Splitter/Attenuator Combined Loss using the following formula and record the result in column C of Table 2: $C = A - B$
13. Calculate the Sensor B path Power Splitter Loss using the following formula and record the result in column E of Table 2: $E = A - D$

14. Repeat steps 5 through 13 for 50 MHz, 550 MHz, 1000 MHz, 1244 MHz, 1411 MHz, 2000 MHz, 2512 MHz, 2850 MHz and 2925 MHz.

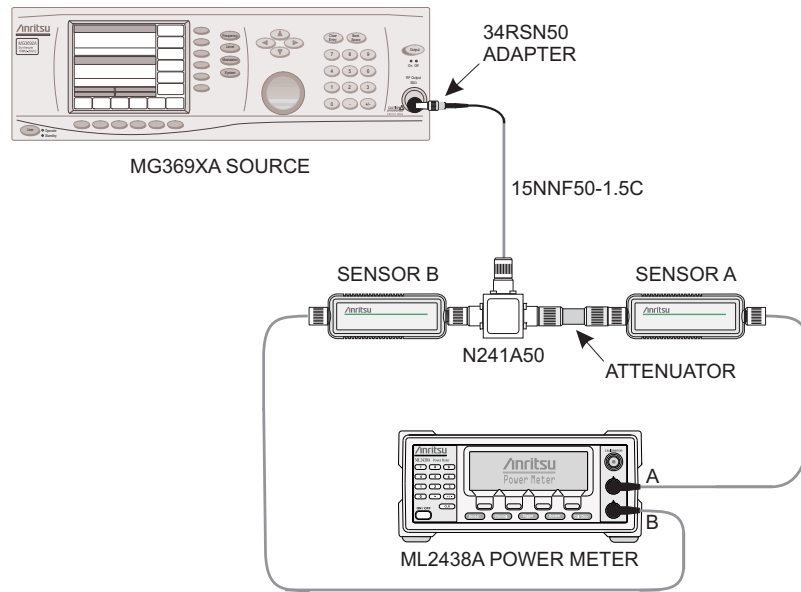


Figure 1. Level Accuracy with Frequency Test Setup

Table 2. Output Power Level

	A	B	C	D	E
Freq (MHz)	Sensor A Reading @ Source Output	Sensor A Reading @ end of Attenuator	Splitter/Attenuator Combined Loss	Sensor B Reading @ Power Splitter Output	Sensor B Path Power Splitter Loss
30					
50					
550					
1000					
1244					
1411					
2000					
2512					
2850					
2925					

15. Calculate the desired Sensor B reading for 0 dBm and -39 dBm Test Power Level using the following formula: Desired Sensor B reading = Desired Test Power Level + C - E

16. Record the calculated results in Table 3.

Table 3. Level Accuracy with Frequency Test Setting

Freq (MHz)	Desired Sensor B reading for 0 dBm @ Attenuator output	Desired Sensor B reading for -39 dBm @ Attenuator output
30		
550		
1000		
1244		
1411		
2000		
2512		
2850		
2925		

17. Using the power splitter, coaxial cable, adapters and fixed attenuator, connect the Site Master to the signal source and the power sensor as shown in Figure 2.

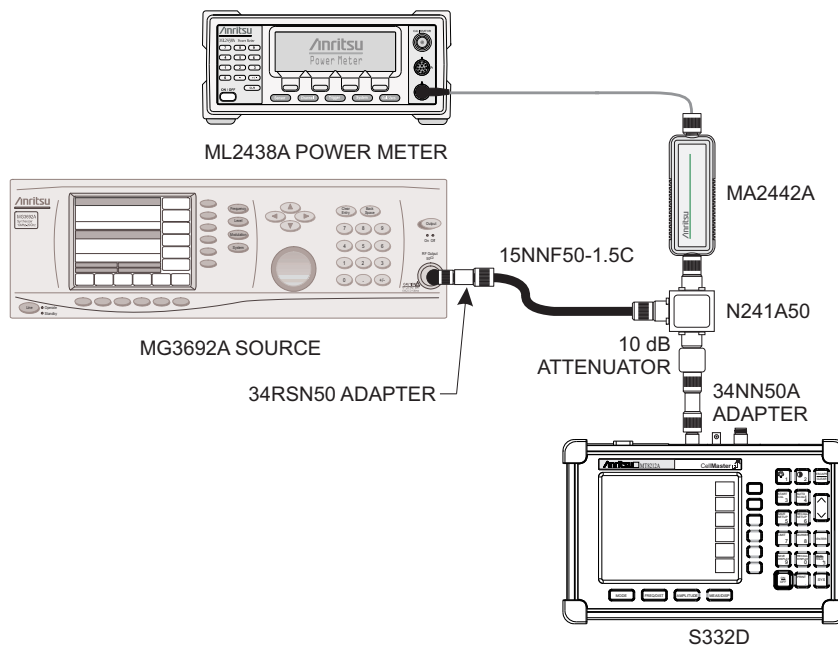


Figure 2. Level Accuracy Test Setup

18. Connect the external power supply (Anritsu part number 40-168) to the Site Master.
19. On the Site Master, press and hold the **ESCAPE/CLEAR** key, then press the **ON/OFF** key to turn on the Site Master. (This sets the instrument to the factory preset state.)
20. On the Site Master, press the **MODE** key. Use the up/down arrow key to highlight Spectrum Analyzer and press **ENTER** to select spectrum analyzer mode.

21. Press the **MEAS/DISP** key and the Bandwidth soft key.
22. Press the RBW Manual soft key and use the Up/Down arrow key to select 1 kHz. Press **ENTER** to set the resolution bandwidth to 1 kHz.
23. Press the VBW Manual soft key and use the Up/Down arrow key to select 100 Hz. Press **ENTER** to set the video bandwidth to 100 Hz.
24. Press the **FREQ/DIST** key.
25. Press the Span soft key and enter .10, then press the MHz key to set the span to 0.10 MHz.
26. Press the **AMPLITUDE** key.
27. Press the Ref Level soft key, enter 10 and press the **ENTER** key to set the reference level to +10 dBm.
28. Press the **FREQ/DIST** key and the Center soft key.
29. Enter 30 and press the MHz soft key to set the center frequency to 30 MHz.
30. On the Power Meter, press the Sensor key and then the CalFactor soft key. Select the FREQ soft key and enter 30 MHz for the Input Signal Frequency. This sets the power meter to the proper power sensor cal factor. Press the Sensor key to display the power reading.
31. Set the MG3692A output to 30 MHz CW. Adjust the source power level so that the power meter displays the corresponding desired Sensor B reading for 0 dBm (as recorded in Table 3).
32. On the Site Master, press the **MARKER** key, then the M1 soft key.
33. Select the Marker To Peak soft key to position the marker at the center of the response for the test frequency.
34. Verify that the M1 reading is within the specification stated in Table 4 or Table 5.

NOTE: For units with serial number 405039 and below, use the specifications in Table 4. For units with serial number 405040 and above, use the specifications in Table 5.

35. Repeat steps 29 to 35 for 550 MHz, 1000 MHz, 1244 MHz, 1411 MHz, 2000 MHz, 2512 MHz, and 2925 MHz.

36. Repeat steps 29 to 36 for a power level of -39 dBm.

NOTE: Change the reference level to -30 dBm.

Table 4. Level Accuracy with Frequency for Units with Serial Number 405039 and Below

Freq (MHz)	@ 0 dBm	@ -39 dBm	Specification
30			±1 dB
550			±1 dB
1000			±1 dB
1244			±1 dB
1411			±1 dB
2000			±1 dB
2512			±1.5 dB
2925			±1.5 dB

Table 5. Level Accuracy with Frequency for Units with Serial Number 405040 and Above

Freq (MHz)	@ 0 dBm	@ -39 dBm	Specification
30			±1.5 dB
550			±1.5 dB
1000			±1.5 dB
1244			±1.5 dB
1411			±1.5 dB
2000			±1.5 dB
2512			±1.5 dB
2925			±1.5 dB

Level Accuracy with Power Test

c. **Equipment Required:**

- Anritsu MG3692A Synthesized Signal Source, with options 2A, 4 and 15A
- Anritsu ML2438A Dual Channel Power Meter or equivalent
- Anritsu MA2442A High Accuracy Power Sensor or equivalent (Two each)
- Anritsu N241A50 Power Splitter or equivalent
- Anritsu 34NN50A 50 ohm adapter or equivalent
- Anritsu 34RSN50 50 ohm adapter or equivalent
- Anritsu 34RKNF50 50 ohm adapter or equivalent
- Anritsu 15NNF50-1.5C RF Coaxial Cable or equivalent
- Aeroflex/Weinschel Model 44-10, 10 dB Fixed Attenuator
- Aeroflex/Weinschel Model 44-30, 30 dB Fixed Attenuator

d. **Procedure:**

1. Use the recorded values for 50 MHz in Table 2, calculate the desired Sensor B Reading for Test Power Level > -50 dBm at 50 MHz using the following formulas:
Desired Sensor B Reading = Test Power Level + C - E
2. Record the calculated results in Table 6 (next page).

Table 6. Level Accuracy with Power Test Setting

Test Power Level (dBm) @ 50 MHz	Desired Sensor B Reading
+3	
0	
-11	
-13	
-19	
-27	
-32	
-39	
-49	
-51	
-53	
-60	

3. Using the power splitter, coaxial cable, adapters and fixed attenuator, connect the Site Master to the signal source and the power sensor as shown in Figure 2.
4. On the power meter, press the **Sensor** key and then the **CalFactor** soft key. Select the **FREQ** soft key and enter 50 MHz for the Input Signal Frequency. This sets the power meter to the proper power sensor cal factor. Press the **Sensor** key to display the power reading.
5. Connect the external power supply (Anritsu part number 40-168) to the Site Master.
6. On the Site Master, press and hold the **ESCAPE/CLEAR** key, then press the **ON/OFF** key to turn on the Site Master. (This sets the instrument to the factory preset state.)
7. On the Site Master, press the **MODE** key. Use the up/down arrow key to highlight Spectrum Analyzer and press **ENTER** to select spectrum analyzer mode.
8. Press the **MEAS/DISP** key and the Bandwidth soft key.
9. Press the **RBW Manual** soft key and use the Up/Down arrow key to select 1 kHz. Press **ENTER** to set the resolution bandwidth to 1 kHz.
10. Press the **VBW Manual** soft key and use the Up/Down arrow key to select 100 Hz. Press **ENTER** to set the video bandwidth to 100 Hz.
11. Press the **FREQ/DIST** key.
12. Press the **Span** soft key and enter .10, then press the **MHz** soft key to set the span to 0.10 MHz.
13. Press the **AMPLITUDE** key.
14. Press the **Ref Level** soft key, enter 10 and press the **ENTER** key to set the reference level to +10 dBm.
15. Press the **FREQ/DIST** key and the **Center** soft key.
16. Enter 50 and press the **MHz** soft key to set the center frequency to 50 MHz.
17. Set the MG3692A output to 50 MHz CW. Adjust the source power so that the power meter displays the corresponding desired Sensor B Reading for +3 dBm (as recorded in Table 6).
18. Press the **MARKER** key, then the **M1** soft key.

19. Select the Marker To Peak soft key to position the marker at the center of the response for the test frequency.
20. Verify that the M1 reading is within the specification from the input signal.

NOTE: For units with serial number 405039 and below, use the specifications in Table 7. For units with serial number 405040 and above, use the specifications in Table 8.

21. Repeat steps 15 through 20 for input levels of 0 dBm, -11 dBm, -13 dBm, -19 dBm, -27 dBm, -32 dBm, -39 dBm and -49 dBm.

NOTE: Change the reference level as indicated in Table 7 or 8 for the corresponding test power level.

22. Disconnect the power splitter and attenuator from the Site Master.
23. Set the MG3692A output power level to 5 dBm.
24. Connect sensor A to the MG3692A output, measure the output power level and record the value in column A of Table 9.

Table 7. Output Power Level

	A	B	C	D	E
Freq (MHz)	Sensor A Reading @ Source Output	Sensor A Reading @ End of Attenuator	Splitter/Attenuator Combined Loss	Sensor B Reading @ Pwr Splitter Output	Sensor B Path Power Splitter Loss
50					

25. Disconnect sensor A from the MG3692A output.
26. Connect the power splitter to the MG3692A output and connect Sensor B to one of the power splitter outputs. Install the 30 dB fixed attenuator to the other power splitter output, and connect Sensor A to the attenuator. Refer to Figure 1.
27. Record the new sensor A reading in column B of Table 9.
28. Record the Sensor B reading in column D of Table 9.
29. Calculate the Splitter/Attenuator Combined Loss using the following formula and record the result in column C of Table 9: $C = A - B$
30. Calculate the Sensor B path Power Splitter Loss using the following formula and record the result in column E of Table 9: $E = A - D$
31. Calculate the desired Sensor B Reading for Test Power Level < -50 dBm using the following formulas: $\text{Desired Sensor B Reading} = \text{Test Power Level} + C - E$
32. Record the calculated results in Table 6.
- 33.

Using the power splitter, coaxial cable, adapters and 30 dB fixed attenuator, connect the Site Master to the signal source and the power sensor as shown in Figure 3.

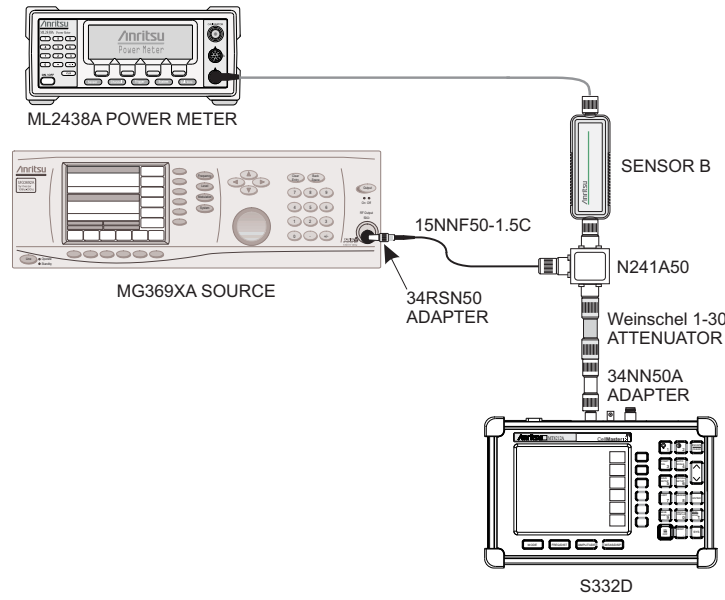


Figure 3. Level Accuracy Setup, 30 dB Attenuator

34. Adjust the MG3692A output power level so that the power meter displays the corresponding desired Sensor B reading for -51 dBm (as recorded in Table 6).
35. Press the **MARKER** key, then the M1 soft key.
36. Select the Marker To Peak soft key to position the marker at the center of the response for the test frequency.
37. Verify that the M1 reading is within the specification from the input signal.

NOTE: For units with serial number 405039 and below, use the specifications in Table 7. For units with serial number 405040 and above, use the specifications in Table 8.

38. Repeat steps 34 to 37 for Test Power Levels of -53 dBm and -60 dBm.

NOTE: Change the reference level as indicated in Table 7 or 8 for the corresponding test power level.

Table 8. Level Accuracy with Power for Units with Serial Number 405039 and Below

Input Power Level (dBm)	Reference Level (dBm)	Specification (dB)	Marker Reading (dBm)
+3	+10	±1	
0	+10	±1	
-11	-10	±1	
-13	-10	±1	
-19	-10	±1	
-27	-20	±1	
-32	-30	±1	
-39	-30	±1	
-49	-40	±1	
-51	-40	±1	
-53	-50	±1	
-60	-50	±1	

Table 9. Level Accuracy with Power for Units with Serial Number 405040 and Above

Input Power Level (dBm)	Reference Level (dBm)	Specification (dB)	Marker Reading (dBm)
+3	+10	±1.5	
0	+10	±1.5	
-11	-10	±1.5	
-13	-10	±1.5	
-19	-10	±1.5	
-27	-20	±1.5	
-32	-30	±1.5	
-39	-30	±1.5	
-49	-40	±1.5	
-51	-40	±1.5	
-53	-50	±1.5	
-60	-50	±1.5	

12. Power Monitor Verification (Option 5)

The following test can be used to verify the accuracy of the power monitor function.

a. **Equipment Required:**

- Anritsu MG3692A Synthesized Signal Source, with options 2A, 4 and 15A
- Anritsu ML2438A Dual Channel Power Meter or equivalent
- Anritsu MA2442D High Accuracy Power Sensor or equivalent
- Anritsu 34NN50A 50 Ohm adapter or equivalent
- Anritsu 34RKNF50 50 Ohm adapter or equivalent
- Anritsu 15NN50-1.5C RF Coaxial Cable or equivalent
- Anritsu 560-7N50B N Type RF Detector
- Aeroflex/Weinschel 1870A Power Splitter

b. **Procedure:**

1. Turn on the power meter and signal source.

NOTE: Before continuing, allow a five minute warm up for the internal circuitry to stabilize.

2. Set the MG3692A output power level to 5 dBm.
3. Set the MG3692A output to 1 GHz CW.
4. Connect the power sensors to the power meter and calibrate the sensors.
5. On the power meter, press the Sensor key, the Cal Factor soft key, and then the FREQ soft key. Use the keypad to enter 1 GHz as the input signal frequency, which sets the power meter to the proper power sensor cal factor. Press the SENSOR key on the power meter to display the power reading.
6. Connect MG3692A, power meter, RF detector, Power Splitter and Power Sensor as shown in Figure 4.
7. Connect the external power supply (Anritsu part number 40-168) to the Site Master.

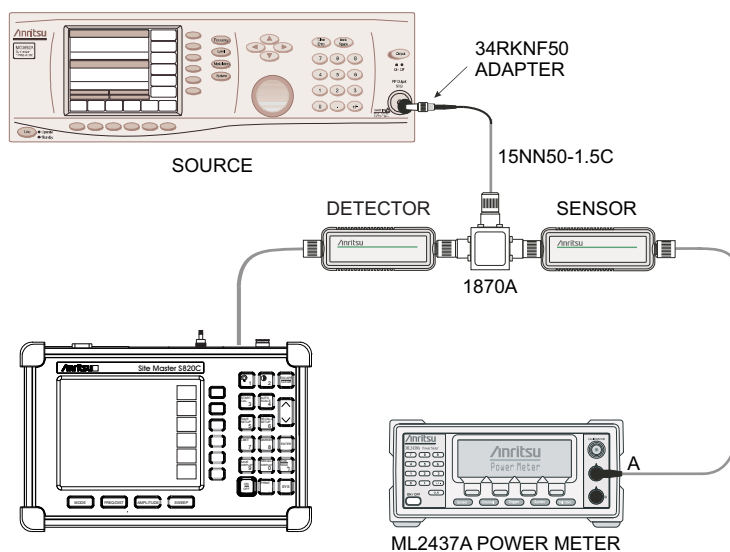


Figure 4. Power Monitor Verification Setup

8. On the Site Master, press and hold the **ESCAPE/CLEAR** key, then press the **ON/OFF** key to turn on the Site Master. (This sets the instrument to the factory preset state.)
9. Press the **MODE** key. Use the Up/Down arrow key to highlight Power Monitor and then press **ENTER**.
10. On the MG3692A press the Level key, then use the knob to adjust the power level so that the power meter reads -40 dBm.
11. Verify that the Site Master reading is -40 dBm \pm 1.0 dB.
12. Repeat steps 10 and 11 for the other power level settings shown in Table 10.

Table 10. Power Monitor Test Levels

Power In @ 1 GHz	Specification
0 dBm	\pm 1 dB
-7 dBm	\pm 1 dB
-21 dBm	\pm 1 dB
-40 dBm	\pm 1 dB

13. Bias Tee Verification (Option 10)

If the Bias Tee (Option 10) is installed in the Site Master, the following test can be used to verify the performance of the bias termination.

a. **Equipment Required:**

- 105 Ohm, 1 Watt, Low Current Load, Anritsu T3377
- Site Master External Power Supply, Anritsu Part Number 40-168

b. **Procedure:**

1. Connect the external power supply (Anritsu part number 40-168) to the Site Master.
2. On the Site Master, press and hold the ESCAPE/CLEAR key, then press the On/Off key to turn on the Site Master and set the instrument to the factory preset state.

NOTE: Before continuing, allow a 5-minute warm up for the internal circuitry to stabilize.

3. Press the System Options key, then select the Application Options soft key.
4. Connect the 105 Ohm load to the RF In test port.
5. Press the Bias Tee (On/Off) soft key to turn the Bias Tee On.
6. Verify the voltage and current readings displayed on the upper left side of the screen are within the specifications shown in Table 11.

Table 11. Bias Tee Verification, 105 Ohm Load

Voltage Setting (V)	18
Voltage Specification (V)	\pm 1.0
Current Specification (mA)	120 - 220

7. Press the Bias Tee (On/Off) soft key to turn the Bias Tee Off.

14. Bias Tee Verification (Option 10A)

If the Bias Tee (Option 10A) is installed in the Site Master, the following test can be used to verify the performance of the bias termination.

a. **Equipment Required:**

- 105 Ohm, 1 Watt, Low Current Load, Anritsu T3377
- 40 Ohm, 5 Watt, High Current Load, Anritsu T2904
- Site Master External Power Supply, Anritsu Part Number 40-168

b. **Procedure:**

1. Connect the external power supply (Anritsu part number 40-168) to the Site Master.
2. Press the On/Off key to turn on the Site Master.
3. Press the Recall Setup (6) key, then select the Default mode setting.
4. Press the Enter key.

NOTE: Before continuing, allow a five minute warm up for the internal circuitry to stabilize.

Bias Tee Test

5. Press the System Options key, then select the Application Options soft key and the Bias Tee soft key.
6. Select the Bias Tee Voltage soft key and enter 12 then press the Enter key.
7. Connect the 105 Ohm load to the RF In test port.
8. Press the Bias Tee On/Off soft key to turn the Bias Tee On.
9. Verify the voltage and current readings displayed on the top left side of the screen are within the specifications shown in Table xx.
10. Press the Bias Tee On/Off soft key to turn the Bias Tee Off
11. Select each of the voltage settings and verify the voltage and current readings displayed on the top left side of the screen are within the specifications shown in Table 12.

Table 12. Bias Tee Verification, 105 Ohm Load, Low Current

Voltage Setting (V)	Voltage Specification (V)	Current Specification (mA)
12	± 0.5	85-145
15	± 0.6	113-173
18	± 0.7	142-202
21	± 0.8	172-230
24	± 1.0	199-259

Fault Test

12. Disconnect the 105 Ohm load and connect the 40 Ohm load to the RF In port.
13. Select the Bias Tee Voltage soft key and enter 17 then press the Enter key.
14. Press the Bias Tee On/Off soft key to turn the Bias Tee On.
15. Verify that the instrument makes a clicking sound and the Bias Tee Error/Fault dialog appears on the screen.

Press the Bias Tee On/Off soft key to turn the Bias Tee Off.

15. Transmission Measurement Verification (Option 21)

The tests in this section can be used to verify the Transmission Measurement functionality (Option 21) of a Site Master equipped with Option 21. There are three parts to this test:

- Transmission Power Verification
- Insertion Loss Verification
- Isolation Test

Transmission Power Verification

a. **Equipment Required:**

- Anritsu 15NN50-1.5C RF Coaxial Cable or equivalent

b. **Procedure:**

1. On the Site Master, press and hold the **ESCAPE/CLEAR** key, then press the **ON/OFF** key to turn on the Site Master. (This sets the instrument to the factory preset state.)
2. On the Site Master, press the **MODE** key. Use the up/down arrow key to highlight Transmission Measurement and press **ENTER** to select Transmission Measurement mode.
3. On the display, verify that the Trans. Meas Cal Off message is displayed and that the RBW is 1 MHz, the VBW is 300 kHz, the Ref Level is 0.0 dBm, and Atten is Dynamic.
4. Use the 15NN50-1.5C RF Coaxial Cable to connect the RF In port of the Site Master to the RF Out port.
5. Press the **LIMIT** key, select the Single Limit soft key and then the Edit soft key. Use the keypad to enter -21 and press **ENTER** to set the limit line to -21 dBm.
6. Verify that the signal is above the -21 dBm limit line.

NOTE: Ignore the "Fail if data is: Above Line" message on the bottom of the display.

Insertion Loss Verification

c. **Equipment Required:**

- Anritsu 15NN50-1.5C RF Coaxial Cable or equivalent
- Weinschel 44-20, 20 dB attenuator

d. **Procedure:**

1. On the Site Master, press and hold the **ESCAPE/CLEAR** key, then press the **ON/OFF** key to turn on the Site Master. (This sets the instrument to the factory preset state.)
2. On the Site Master, press the **MODE** key. Use the Up/Down arrow key to highlight Transmission Measurement and press **ENTER** to select Transmission Measurement mode.
3. Press the **MEAS/DISP** key and select the Calibrate TM soft key.
4. Use the 15NN50-1.5C RF Coaxial Cable to connect the RF In port of the Site Master to the RF Out port. Press the **ENTER** key on the Site Master to calibrate. The Site Master will beep when one sweep is completed.
5. Insert the 20 dB attenuator between the RF Coaxial cable and the RF Out port.
6. Press the **AMPLITUDE** key and select the Ref Level soft key. Use the Up/Down arrow key or the keypad to enter -15 and press the **ENTER** key to set the reference level to -15 dBm.

7. Press the **Scale** soft key and use the Up/Down arrow key or the keypad to enter 1 and press the **ENTER** key to set the scale to 1 dB/Div.
8. Press the **LIMIT** key and select the Multiple Upper Limits soft key.
9. Select the Segment 1 soft key and then the Edit soft key. Use the keypad to enter 25 and press the **ENTER** key to set the start frequency to 25 MHz.
10. Use the keypad to enter -18.5 and press **ENTER** key to set the start limit to -18.5 dB.
11. Use the keypad to enter 3 and press the GHz soft key to set the end frequency to 3 GHz.
12. Use the keypad to enter -18.5 and press **ENTER** key to set the end limit to -18.5 dB.
13. Press the **LIMIT** key and then select Multiple Lower Limits soft key.
14. Press the Segment 1 soft key and then press the Edit soft key. Use the keypad to enter 25 and press the **ENTER** key to set the start frequency to 25 MHz.
15. Use the keypad to enter -21.5 and press the **ENTER** key to set the start limit to -21.5 dB.
16. Use the keypad to enter 3 and press GHz soft key to set the end frequency to 3 GHz.
17. Use the keypad to enter -21.5 and press the **ENTER** key to set the end limit to -21.5 dB.
18. Verify that the trace is within the -18.5 and -21.5 limit lines.

Isolation Test

e. **Equipment Required:**

- Anritsu 28N50-2 or SM/PL 50 Ohm Termination
- Anritsu 15NN50-1.5C RF Coaxial Cable or equivalent

f. **Procedure:**

1. On the Site Master, press and hold the **ESCAPE/CLEAR** key, then press the **ON/OFF** key to turn on the Site Master. (This sets the instrument to the factory preset state.)
2. On the Site Master, press the **MODE** key. Use the Up/Down arrow key to highlight Transmission Measurement and press **ENTER** to select Transmission Measurement mode.
3. Press the **MEAS/DISP** key and then press the Calibrate TM soft key.
4. Use the 15NN50-1.5C RF Coaxial Cable to connect the RF In port of the Site Master to the RF Out port. Press the **ENTER** key on the Site Master to calibrate. The Site Master will beep when one sweep is completed.
5. Disconnect the RF cable from RF In Port and connect the 50 ohm Termination.
6. Press the **LIMIT** key and select the Multiple Upper Limits soft key.
7. Press the Segment 1 soft key and select the Edit soft key. Use the keypad to enter 25 and press the **ENTER** key to set the start frequency to 25 MHz.
8. Use the keypad to enter -80 and press the **ENTER** key to set the start limit to -80 dB.
9. Use the keypad to enter 1 and press the GHz soft key to set the end frequency to 1 GHz.

NOTE: For instruments with serial number 525001 and above, set the end frequency to 2 GHz.

10. Use the keypad to enter -80 and press the **ENTER** key to set the end limit to -80 dB.
11. Press the Next Segment soft key. Verify that Segment: 2 Upper appears at the bottom left corner of the display.
12. Press the Edit soft key. Use the keypad to enter 1 and press the GHz soft key to set the start frequency to 1 GHz.

NOTE: For instruments with serial number 525001 and above, set the start frequency to 2 GHz.

13. Use the keypad to enter -60 and press the **ENTER** key to set the start limit to -60 dB.
14. Use the keypad to enter 3 and press the GHz soft key to set the end frequency to 3 GHz.
15. Use the keypad to enter -60 and press the ENTER key to set the end limit to -60 dB.
16. Verify that the trace is below the limit lines.

16. Power Meter Verification (Option 29)

The following test can be used to verify the accuracy of the power measurements.

a. **Equipment Required:**

- Anritsu MG3692A Synthesized Signal Source, with options 2A, 4 and 15A
- Anritsu ML2438A Dual Channel Power Meter or equivalent
- Anritsu MA2442A High Accuracy Power Sensor or equivalent
- Anritsu 34NN50A 50Ω adapter or equivalent
- Anritsu 34RSN50 50Ω adapter or equivalent
- Anritsu 34RKNF50 50Ω adapter or equivalent
- Anritsu 15NNF50-1.5C RF Coaxial Cable or equivalent
- Aeroflex/Weinschel Model 1870A Power Splitter or equivalent
- Aeroflex/Weinschel Model 44-10 10 dB Fixed Attenuator

b. **Procedure:**

1. Turn on the power meter and signal source.

NOTE: Before continuing, allow a 30-minute warm up for the internal circuitry to stabilize.

2. On the power meter, press the Channel key, the Setup soft key and then the CHANNEL soft key to display Channel 2 setup menu. Press the INPUT key twice to set the input configuration to B. Press the Sensor key to display both Sensor A and Sensor B Readings.
3. Connect the power sensors to the power meter and calibrate the sensors.
4. Set the MG3692A output power level to 5 dBm.
5. Set the MG3692A output to 50 MHz CW.
6. On the power meter, press the Sensor key, the Cal Factor soft key, and then the FREQ soft key. Use the keypad to enter 50 MHz as the input signal frequency, which sets the power meter to the proper power sensor cal factor. Repeat for Sensor B. Press the SENSOR key on the power meter to display the power reading.

(continued next page)

7. Connect sensor A to the MG3692A output, measure the output power level and record the value in column A of Table 13.

Table 13. Output Power Level

	A	B	C	D	E
Freq (MHz)	Sensor A Reading @ Source Output	Sensor A Reading @ end of Attenuator	Splitter/Attenuator Combined Loss	Sensor B Reading @ Power Splitter Output	Sensor B Path Power Splitter Loss
50					
1000					
2000					

8. Disconnect Sensor A from the MG3692A output.
9. Connect the power splitter to the MG3692A output and the Sensor B to one of the power splitter outputs. Install the 10 dB Fixed Attenuator to the other power splitter output and then connect Sensor A to the end of the Attenuator. Refer to Figure 1.
10. Record the new sensor A reading in column B of Table 13.
11. Record Sensor B reading in column D of Table 13.
12. Calculate the Splitter/Attenuator Combined Loss using the following formula and record the result in column C of Table 13: $C = A - B$
13. Calculate the Sensor B path Power Splitter Loss using the following formula and record the result in column E of Table 13: $E = A - D$
14. On the power meter, press the INPUT soft key seven times and then press the System key to display the sensor A reading.
15. Repeat steps 4 through 11 for 1000 MHz, 2000 MHz and 2850 MHz.
16. Calculate the desired Sensor B Reading for -30 dBm Test Power Level at the end of 10 dB attenuator using the following formula: $\text{Desired Sensor B Reading} = \text{Test Power Level} + C - E$
17. Record the calculated results in Table 14.

Table 14. -30 dBm Test Power Level

Freq (MHz)	Desired Sensor B Reading for -30 dBm Input to Site Master
50	
1000	
2000	
2850	

- Using the power splitter, coaxial cable and adapters, connect the Site Master to the signal source and the power sensor as shown in Figure 5.

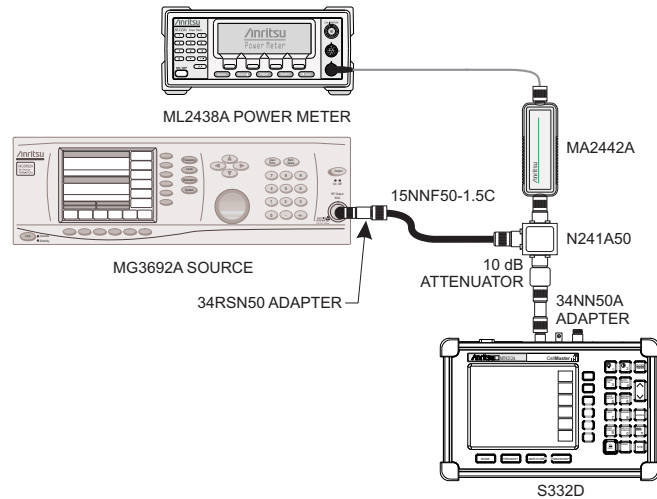


Figure 5. Power Meter Verification Setup

- Connect the external power supply (Anritsu part number 40-168) to the Site Master.
- On the Site Master, press and hold the **ESCAPE/CLEAR** key, then press the **ON/OFF** key to turn on the Site Master. (This sets the instrument to the factory preset state.)
- Press the **MODE** key. Use the Up/Down arrow key to highlight Power Meter and then press **ENTER**.
- Press the Center soft key and enter 50, then press the MHz soft key to set the center frequency to 50 MHz.
- Press the Span soft key and enter 3, then press the MHz key to set the span to 3 MHz.
- On the Power Meter, press the Sensor key and then the CalFactor soft key. Select the **FREQ** soft key and enter 50 MHz for the Input Signal Frequency. This sets the power meter to the proper power sensor cal factor. Press the Sensor key to display the power reading.
- Set the MG3692A output to 50 MHz CW and adjust the power level so that the power meter displays the corresponding desired Sensor B Reading for -30 dBm as recorded in Table 14.
- Verify that the Power Meter reading is within the specifications in Table 15.

NOTE: If the reading is unstable, turn on RMS Averaging by pressing the MEAS/DISP key, then the RMS Averaging soft key. The number of points to average can be set to low, medium or high.

Table 15. Output Power Level

Freq (MHz)	Measured Value	Specification for units with S/N 405039 and below	Specification for units with S/N 405040 and above
50		-30 dBm \pm 1 dB	-30 dBm \pm 1.5 dB
1000		-30 dBm \pm 1 dB	-30 dBm \pm 1.5 dB
2000		-30 dBm \pm 1 dB	-30 dBm \pm 1.5 dB
2850		-30 dBm \pm 1.5 dB	-30 dBm \pm 1.5 dB

- Repeat steps 22 and 26 for 1000 MHz, 2000 MHz, and 2850 MHz.

17. FCN4760 Frequency Converter Verification

The tests in this section verify the performance of Model FCN4760 Frequency Converter. The tests include:

- Phase Noise Verification
- Second Harmonic Distortion Test
- Residual Spurious Response Test
- Measurement Accuracy Verification

Phase Noise Verification

This test verifies the combined phase noise of the FCN4760 Frequency Converter and the Site Master Spectrum Analyzer.

a. **Equipment Required:**

- Anritsu FCN4760 Frequency Converter
- Anritsu MG3692A Synthesized Signal Source, with options 2A, 4 and 15A, or equivalent
- Anritsu 34RSN50 50 ohm adapter or equivalent
- Anritsu 15NNF50-1.5C RF Coaxial Cable or equivalent

b. **Procedure:**

1. Connect the output of the FCN4760 to the Spectrum Analyzer RF In port of the Site Master.
2. Connect the output of the source to the FCN4760 RF Input with the coaxial cable.
3. Connect the external power supply (Anritsu part number 40-168) to the Site Master.
4. Press and hold the **ESCAPE/CLEAR** key and press the **ON/OFF** key to turn on the Site Master. (This sets the instrument to the factory preset state.)

NOTE: Before continuing, allow a 30-minute warm up for the internal circuitry to stabilize.

5. Set the MG3692A output to 5999 MHz CW, with an RF output level of -45 dBm.
6. On the Site Master, press the **MODE** key. Use the Up/Down arrow key to highlight Spectrum Analyzer and press **ENTER** to select Spectrum Analyzer mode.
7. Press the **MEAS/DISP** key and select the Bandwidth soft key.
8. Press the RBW Manual soft key and use the Up/Down arrow key to select 1 kHz. Press **ENTER** to set the resolution bandwidth to 1 kHz.
9. Press the VBW Manual soft key and use the Up/Down arrow key to select 30 Hz. Press **ENTER** to set the video bandwidth to 30 Hz.
10. Press the **FREQ/DIST** key and select the Center soft key.
11. Use the keypad to enter 1000 and press the **ENTER** key to set the center frequency to 1000 MHz.
12. Press the Span soft key and use the keypad to enter 0.1. Press the **ENTER** key to set the span to 0.100 MHz.
13. Press the **AMPLITUDE** key.
14. Press the Ref Level soft key and enter -40 . Press **ENTER** to set the reference level to -40 dBm.
15. Press the **MARKER** key, then select the M1 soft key.
16. Press Edit and enter 5999. Press **ENTER** to set the M1 marker frequency to 5999 MHz.
17. Press the Back soft key and the M2 soft key.

18. Press Edit and enter 5999.03. Press **ENTER** to set the M2 marker frequency to 5999.03 MHz (30 kHz higher than the center frequency).
19. Press the Delta (M2-M1) soft key.
20. Press the **RUN/HOLD** key and read and record the $\Delta 2$ reading.
21. Press the **RUN/HOLD** key and read and record five values, then calculate the average of the five recorded values.
22. Subtract 30 dB from the average value and verify that the result is $= -65$ dBc/Hz.
(For example: -35 dBc measured $- 30$ dB $= -65$ dBc/Hz.)

NOTE: The measured value is converted to dBc/Hz using the following formula:

$$dBc / Hz = - |measured\ dBc| - \left[10_{\log} \left(\frac{RBW}{1Hz} \right) \right]$$

At 1 kHz RBW, $10_{\log} \left(\frac{RBW}{1Hz} \right) = 30$, so $dBc / Hz = - |measured\ dBc| - 30$.

23. Press the Back soft key and the M3 soft key.
24. Press the Edit soft key and enter 5998.97. Select the MHz soft key to set the M3 marker frequency to 5998.97 MHz (30 kHz lower than the center frequency).
25. Press the Delta (M3-M1) soft key.
26. Press the **RUN/HOLD** key and record the $\Delta 3$ reading.
27. Press the **RUN/HOLD** key to read and record five values, then calculate the average of the five recorded values.
28. Subtract 30 dB from the average value and verify that the result is ≤ -65 dBc/Hz.
(For example: -35 dBc measured $- 30$ dB $= -65$ dBc/Hz.)

Second Harmonic Distortion Test

The following test can be used to verify the combined input related spurious response of the FCN4760 Frequency Converter and Site Master Spectrum Analyzer.

c. **Equipment Required:**

- Anritsu MG3692A Synthesized Signal Source with options 2A, 4 and 15A, or equivalent
- Anritsu 34RSN50 50 ohm adapter or equivalent
- Anritsu 15NNF50-1.5C RF Coaxial Cable or equivalent
- 10 MHz Reference Standard
- BNC male to BNC male coaxial cable

d. **Procedure:**

1. Connect the 10 MHz reference source to the Anritsu MG3692A Synthesized Signal Source.
2. Connect the output of the FCN4760 to the Spectrum Analyzer RF In port of the Site Master.
3. Connect the output of the source to the FCN4760 RF Input with the coaxial cable.
4. Connect the external power supply (Anritsu part number 40-168) to the Site Master.
5. On the Site Master, press and hold the **ESCAPE/CLEAR** key and press the **ON/OFF** key to turn on the Site Master. (This sets the instrument to the factory preset state.)
6. Turn on the 10 MHz reference source and the Anritsu MG3692A Synthesized Signal Source.
7. Set the MG3692A output to 5 GHz CW, with an RF output level of -45 dBm.

NOTE: Before continuing, allow a 30-minute warm up for the internal circuitry to stabilize.

8. On the Site Master, press the **MODE** key. Use the Up/Down arrow key to highlight Spectrum Analyzer and press **ENTER** to select Spectrum Analyzer mode.
9. Press the **AMPLITUDE** key and the Ref Level soft key.
10. Enter -40 and press the **ENTER** key to set the Reference Level to -40 dBm.
11. Press the **Scale** soft key and enter 7 then press **ENTER**.
12. Press the **FREQ/DIST** key and then the Center soft key.
13. Enter 5 and press the GHz soft key to set the center frequency to 5 GHz.
14. Press the Span soft key and enter 0.2. Press the MHz soft key to set the span to 0.200 MHz.
15. Press the **MEAS/DISP** key and the Bandwidth soft key.
16. Press the RBW Manual soft key and use the Up/Down arrow key to select 1 kHz. Press **ENTER** to set the resolution bandwidth to 1 kHz.
17. Press the VBW Manual soft key and use the Up/Down arrow key to select 100 Hz. Press **ENTER** to set the video bandwidth to 100 Hz.
18. Press the **MARKER** key, then the M1 soft key.
19. Select the Edit soft key. Enter 5 and press the GHz soft key to set M1 to 5 GHz.
20. On the MG3692A Synthesized Signal Source, adjust the output level so that the M1 reading on the Site Master Spectrum Analyzer is -45 dBm at 5 GHz.
21. On the Site Master, press the **FREQ/DIST** key and then the Center soft key.
22. Enter 5750 MHz and press the MHz soft key to set the center frequency to 5750 MHz.
23. Press the **MARKER** key and the M1 soft key.
24. Select the Edit soft key. Enter 5750 and press the MHz soft key to set M1 to 5750 MHz .
25. Record the amplitude of the signal at M1 5750 MHz:

Second Harmonic Level @ 5750 MHz = _____ dBm

26. Convert this measured value to dBc using the following formula:

Input Related Spurious Response (dBc) = [Second Harmonic Level @ 5750 MHz] + 45 dBm = _____ dBc

Specifications for this measurement are -45 dBc with -45 dBm into the first mixer.

Residual Spurious Response Test

The following test can be used to verify the combined residual spurious response of the FCN4760 Frequency Converter and Site Master Spectrum Analyzer.

e. **Equipment Required:**

- Anritsu 28N50-2 or SM/PL 50 ohm Termination or equivalent

f. **Procedure:**

1. Connect the output of the FCN4760 to the Site Master Spectrum Analyzer RF In port.
2. Connect the 50 ohm termination to the FCN4760 RF Input.
3. On the Site Master, press and hold the **ESCAPE/CLEAR** key and press the **ON/OFF** key to turn on the Site Master. (This sets the instrument to the factory preset state.)

NOTE: Before continuing, allow a 30-minute warm up for the internal circuitry to stabilize.

4. On the Site Master, press the **MODE** key. Use the Up/Down arrow key to highlight Spectrum Analyzer and press **ENTER** to select Spectrum Analyzer mode.

5. Press the **AMPLITUDE** key and the Ref Level soft key.
6. Enter -75 and press the **ENTER** key to set the Reference Level to -75 dBm.
7. Press the Scale soft key and enter 5, then press **ENTER**.
8. Press the **MEAS/DISP** key and the Bandwidth soft key.
9. Press the RBW Manual soft key and use the Up/Down arrow key to select 10 kHz. Press **ENTER** to set the resolution bandwidth to 10 kHz.
10. Press the VBW Manual soft key and use the Up/Down arrow key to select 3 kHz and press **ENTER** to set the video bandwidth to 3 kHz.
11. Press the **FREQ/DIST** key and the Start soft key.
12. Enter 4.7 and press the GHz soft key to set the start frequency to 4.7 GHz.
13. Press the Stop soft key and enter 6, then press the GHz soft key to set the stop frequency to 6 GHz.
14. Wait till one full sweep is complete.
15. Press the **MARKER** key and then the M1 soft key.
16. Press the Marker To Peak soft key.
17. Record the M1 amplitude reading and verify whether it is less than or equal to -90 dBm.

NOTE: If a spur with an amplitude larger than -90 dBm occurs, wait another full sweep and observe whether the spur occurs at the same point on the second sweep. If the spur does not occur at the same point on the second sweep, then the spur on the first sweep was not real.

Measurement Accuracy Verification

The test in this section verifies the combined level accuracy of the FCN4760 Frequency Converter and Site Master Spectrum Analyzer.

Level Accuracy with Frequency Test

g. **Equipment Required:**

- Anritsu MG3692A Synthesized Signal Source, with options 2A, 4 and 15A
- Anritsu ML2430A-Series Power Meter or equivalent
- Anritsu MA2442A High Accuracy Power Sensor or equivalent (2)
- Anritsu 34NN50A 50 ohm adapter or equivalent
- Anritsu 34RSN50 50 ohm adapter or equivalent
- Anritsu 34RKNF50 50 ohm adapter or equivalent
- Anritsu 15NNF50-1.5C RF Coaxial Cable or equivalent
- Aeroflex/Weinschel Model 44-30, 30 dB Fixed Attenuator
- Aeroflex/Weinschel Model 1870A Power Splitter or equivalent

h. **Procedure:**

1. Turn on the power meter and signal source.

NOTE: Before continuing, allow a 30-minute warm up for the internal circuitry to stabilize.

2. On the power meter, press the Channel key, the Setup soft key and then the CHANNEL soft key to display Channel 2 setup menu. Press the INPUT key twice to set the Input Configuration to B. Press the Sensor key to display both Sensor A and Sensor B Readings.

3. Connect the power sensors to the power meter and calibrate the sensors.
4. Set the MG3692A output power level to 5 dBm.
5. Set the MG3692A output to 4750 MHz CW.
6. On the power meter, press the Sensor key, the Cal Factor soft key, and then the FREQ soft key. Use the keypad to enter 4750 MHz as the input signal frequency, which sets the power meter to the proper power sensor cal factor. Press the SENSOR key on the power meter to display the power reading.
7. Connect Sensor A to the MG3692A output, measure the output power level and record the value in column A of Table 16.

Table 16. Output Power Level

	A	B	C	D	E
Freq (MHz)	Sensor A Reading @ Source Output	Sensor A Reading @ end of Attenuator	Splitter/Attenuator Combined Loss	Sensor B Reading @ Power Splitter Output	Sensor B Path Power Splitter Loss
4750					
5153					
5284.9					
5800					

8. Disconnect Sensor A from the MG3692A output.
9. Connect the power splitter to the MG3692A output and Sensor B to one of the power splitter outputs. Install the 30 dB Fixed Attenuator to the other power splitter output and then connect Sensor A to the end of the Attenuator. Refer to Figure 1.
10. Record the new sensor A reading in column B of Table 16.
11. Record Sensor B reading in column D of Table 16.
12. Calculate the Splitter/Attenuator Combined Loss using the following formula and record the result in column C of Table 16: $C = A - B$
13. Calculate the Sensor B path Power Splitter Loss using the following formula and record the result in column E of Table 16: $E = A - D$
14. Repeat steps 5 to 13 for 5153 MHz, 5284.9 MHz, and 5800 MHz.
15. Calculate the desired Sensor B reading for -60 dBm Test Power Level using the following formula: $\text{Desired Sensor B reading} = \text{Desired Test Power Level} + C - E$
16. Record the calculated results in Table 17.

Table 17. Level Accuracy with Frequency Test Setting

Freq (MHz)	Desired Sensor B Reading for -60 dBm @ Attenuator Output
4750	
5153	
5284.9	
5800	

17. Using the power splitter, coaxial cable, adapters and fixed attenuator, connect the FCN4760 to the signal source and the power sensor as shown in Figure 3.

18. Connect the external power supply (Anritsu part number 40-168) to the Site Master.
19. Press and hold the **ESCAPE/CLEAR** key and press the **ON/OFF** key to turn on the Site Master.
20. On the Site Master, press the **MODE** key. Use the Up/Down arrow key to highlight Spectrum Analyzer and press **ENTER** to select Spectrum Analyzer mode.
21. Press the **MEAS/DISP** key and the Bandwidth soft key.
22. Press the RBW Manual soft key and use the Up/Down arrow key to select 1 kHz. Press **ENTER** to set the resolution bandwidth to 1 kHz.
23. Press the VBW Manual soft key and use the Up/Down arrow key to select 100 Hz. Press **ENTER** to set the video bandwidth to 100 Hz.
24. Press the **FREQ/DIST** key.
25. Press the Span soft key and enter .10, then press the MHz key to set the span to 0.10 MHz.
26. Press the **AMPLITUDE** key.
27. Press the Ref Level soft key, enter 10 and press the **ENTER** key to set the reference level to -40 dBm.
28. Press the **FREQ/DIST** key and the Center soft key.
29. Enter 4750 and press the MHz soft key to set the center frequency to 4750 MHz.
30. On the Power Meter, press the Sensor key and then the CalFactor soft key. Select the FREQ soft key and enter 4750 MHz for the Input Signal Frequency. This sets the power meter to the proper power sensor cal factor. Press the Sensor key to display the power reading.
31. Set the MG3692A output to 4750 MHz CW. Adjust the source power level so that the power meter displays the corresponding desired Sensor B reading for -60 dBm (as recorded in Table 17).
32. On the Site Master, press the **MARKER** key, then the M1 soft key.
33. Select the Marker To Peak soft key to position the marker at the center of the response for the test frequency.
34. Verify that the M1 reading is within ± 2.25 dB.
35. Repeat steps 28 to 34 for 5153 MHz, 5284.9 MHz, and 5800 MHz and verify that the M1 reading is within ± 2.25 dB for each frequency.

18. Battery Pack Removal and Replacement

This procedure provides instructions for removing and replacing the Site Master battery pack.

NOTE: Many of the procedures in this section are generic, and apply to many similar instruments. Photos and illustrations used are representative and may show instruments other than the Site Master.

1. With the Site Master standing upright on a stable surface, locate the battery access door (Figure 6).

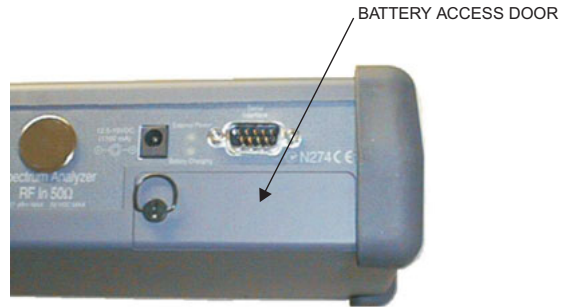


Figure 6. Battery Access Door Location

2. Lift up the access door handle and rotate it 90 degrees counterclockwise, as illustrated in Figure 7.



Figure 7. Rotate the Battery Access Door Handle

3. Lift the door and remove, as illustrated in Figure 8.

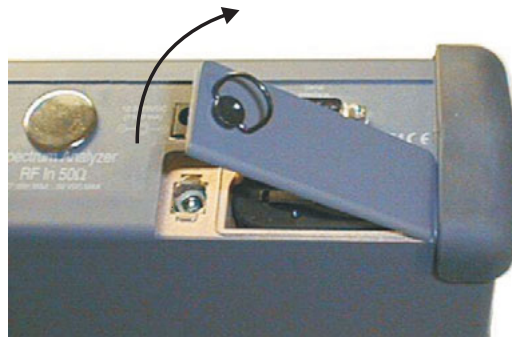


Figure 8. Removing the Battery Access Door

4. Grasp the battery lanyard and pull the battery straight up and out of the unit, as illustrated in Figure 9.

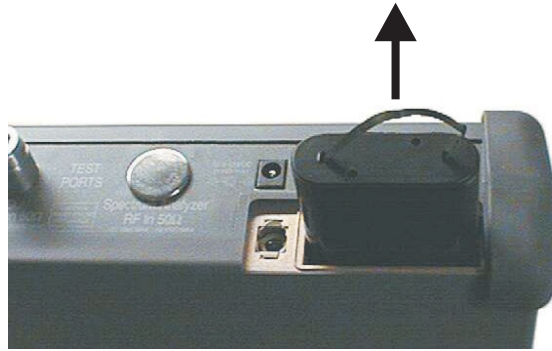


Figure 9. Removing the Battery

5. Replacement is the opposite of removal. Note the orientation of the battery contacts, and be sure to insert the new battery with the contacts facing the rear of the unit (Figure 10).

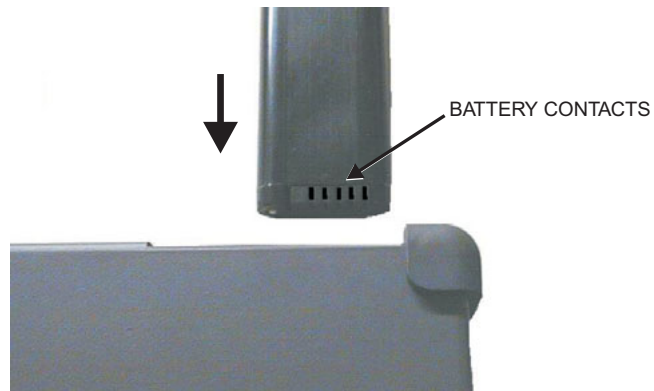


Figure 10. Battery Orientation

19. Battery Information

The following information relates to the care and handling of the Site Master battery, and NiMH batteries in general.

- The Nickel Metal Hydride (NiMH) battery supplied with the Site Master is shipped in a discharged state. Before using the Site Master, the internal battery must first be charged for three hours, either in the Site Master or in the optional battery charger (Anritsu part number: 2000-1029).
- Use only Anritsu approved battery packs.
- Recharge the battery only in the Site Master or in an Anritsu approved charger.
- With a new NiMH battery, full performance is achieved after three to five complete charge and discharge cycles.
- When the Site Master or the charger is not in use, disconnect it from the power source.
- Do not charge batteries for longer than 24 hours; overcharging may shorten battery life.
- If left unused a fully charged battery will discharge itself over time.
- Temperature extremes will affect the ability of the battery to charge: allow the battery to cool down or warm up as necessary before use or charging.
- Discharge an NiMH battery from time to time to improve battery performance and battery life.
- The battery can be charged and discharged hundreds of times, but it will eventually wear out.
- The battery may need to be replaced when the operating time between charging becomes noticeably shorter than normal.
- Never use a damaged or worn out charger or battery.
- Storing the battery in extreme hot or cold places will reduce the capacity and lifetime of the battery.
- Never short-circuit the battery terminals.
- Do not drop, mutilate or attempt to disassemble the battery.
- Do not dispose of batteries in a fire!
- Batteries must be recycled or disposed of properly. Do not place batteries in household garbage.
- Always use the battery for its intended purpose only.

19.1. Battery Testing Procedure

1. With the Site Master off and the battery installed, connect the Universal AC Adapter to the 12.5-15VDC (1350 mA) connector. The External Power LED and the Battery Charging LED will light.

NOTES: If the Battery Charging LED does not light, the battery may be too low to immediately start full charging. Leaving the unit connected to AC power for several hours may bring the battery up to a level where full charging can begin. Turn the unit off and back on to see if the Battery Charging LED lights indicating a full charge cycle has begun. Charging is inhibited below 0°C and above 45°C. If the unit is too hot, the battery will not start charging until the unit temperature has reached 43°C.

2. Disconnect the AC-DC Adapter when the Battery Charging LED turns off, indicating the battery is fully charged.
3. Press and hold the **ESCAPE/CLEAR** key, then press the **ON/OFF** key to turn on the Site Master. This sets the instrument to the factory preset state. Press **ENTER** when prompted to continue.
4. Press the **SYS** key, followed by the **STATUS** soft key. Verify that the indicated battery charge is $\geq 80\%$. If the value is 80% or above, press the **ESCAPE/CLEAR** key and continue with this procedure.

If the value is lower than 80%, a discharge/charge cycle may be needed to improve the battery capacity. Completely discharge the battery, as described in Steps 5 and 6 below, and then recharge the battery as described in Steps 1 and 2. If the battery capacity does not increase after a discharge/charge cycle, replace the battery.

5. Press the **START CAL** key (to keep the Site Master from going into HOLD mode) and make note of the test start time.
6. When the Site Master display fades and the Site Master switches itself off, make note of the test stop time.
7. The total test time (Step 5 to Step 6) should be ≥ 1.5 hours. If the battery charge started at 80% or more and the total battery test time is <70 minutes, replace the battery.

20. Front Panel Assembly Removal and Replacement

This procedure provides instructions for removing and replacing the Site Master front panel assembly. With the front panel assembly removed, the LCD display, keypad PCB, keypad membrane, and main PCB assemblies can be removed and replaced.

NOTE: Many of the procedures in this section are generic, and apply to many similar instruments. Photos and illustrations used are representative and may show instruments other than the Site Master.

1. Remove the external power supply, if installed, and remove the battery from the unit.
2. Place the Site Master face up on a stable work surface.

NOTE: The Site Master, like other high performance instruments, is susceptible to ESD damage. Technicians should be aware of the potential for ESD damage and take all necessary precautions, as outlined within industry standards like JEDEC-625 (EIA-625), MIL-HDBK-263, and MIL-STD-1686, which pertain to ESD and ESDS devices, equipment, and practices.

3. Remove the four rubber corner bumpers by carefully lifting and sliding the bumpers off of the case corners (Figure 11).



Figure 11. Removing the Corner Bumpers

4. With the bumpers removed, the access holes for the case screws are revealed. Use a Phillips screwdriver to remove the four screws securing the two halves of the Site Master case together.
5. Carefully lift up on the right side (as viewed from the front) of the front half of the case and begin to separate the two halves.

CAUTION

Do not force or pull the two halves of the case apart completely, as there are delicate cables attached between the two halves that must be disconnected first.

6. If the unit is equipped with a monochrome display, carefully depress the latch tab and disconnect the monochrome LCD display cable from J3 on the main PCB.
or
If the unit is equipped with a color display, carefully disconnect the display cable from J14 on the main PCB.
7. Carefully disconnect the keypad interface cable from J4 on the main PCB.
8. Carefully disconnect the LCD display backlight cable from J1 on the main PCB.

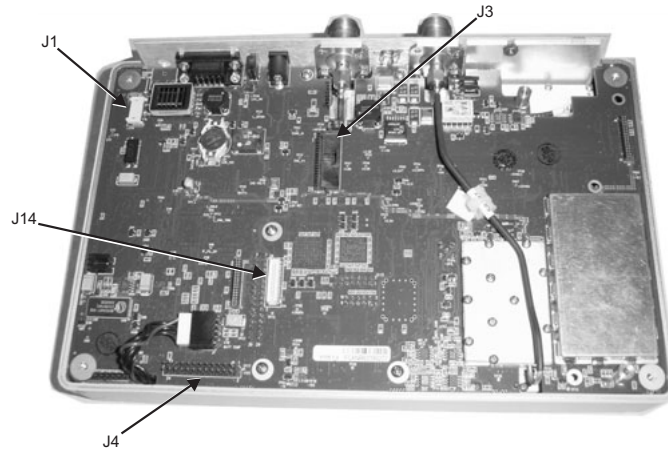


Figure 12. Site Master Front Panel Cable Connections

9. Remove the front panel assembly.
10. Reverse the above steps to replace the front panel assembly.

NOTE: The corner bumpers only mount one way. That is, the raised area inside one end of the bumper (Figure 13) is made to conform to the contour of the front cover only.



Figure 13. Corner Bumper Detail

21. LCD Assembly Replacement

This procedure provides instructions for removing and replacing the Liquid Crystal Display (LCD) once the front panel assembly has been separated from the Site Master.

1. Remove the front panel assembly as directed in section 20.
2. Place the front panel assembly face down on a protected work surface.
3. Remove the 14 Phillips screws that attach the backing plate to the front panel assembly.
4. Release the LCD display cable from the retaining clip on the front panel backing plate.

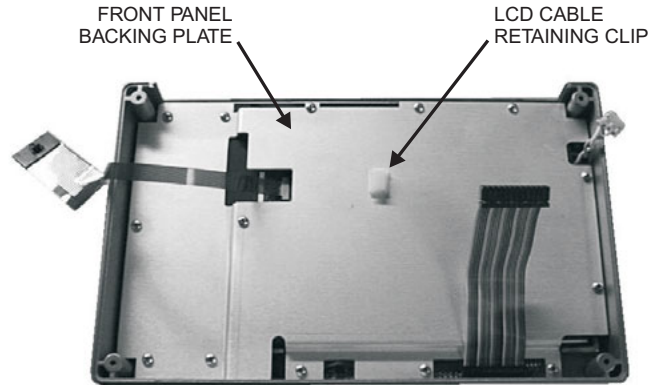


Figure 14. Front Panel Backing Plate

5. Remove the front panel backing plate, carefully feeding the LCD cable through the access hole to avoid damage to the cable or connector.
6. Remove the rubber cushion pad from the LCD assembly and remove the assembly.
7. Reverse the above steps to install the replacement assembly.

22. Key Pad PCB Replacement

This procedure provides instructions for removing and replacing the key pad PCB.

1. Remove the front panel assembly as directed in section 20.
2. Place the front panel assembly face down on a protected work surface.
3. Remove the 14 Phillips screws that attach the backing plate to the front panel assembly.
4. Release the LCD display cable from the retaining clip on the front panel backing plate (Figure 14).
5. Remove the front panel backing plate, carefully feeding the LCD cable through the access hole to avoid damage to the cable or connector.

6. Remove the rubber cushion pad from the key pad PCB and remove the PCB.

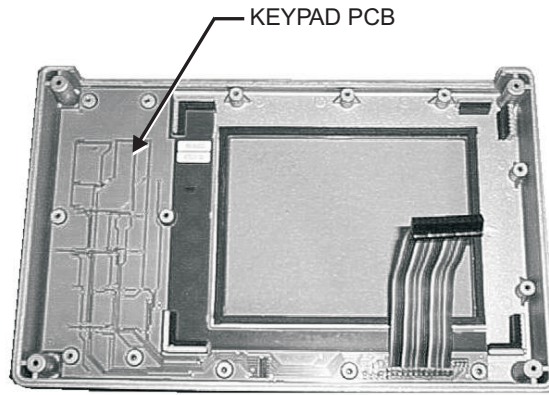


Figure 15. Front Panel Keypad PCB Location

7. Reverse the above steps to install the replacement assembly.

23. Key Pad Membrane Replacement

This procedure provides instructions for replacing the key pad membrane.

1. Remove the front panel assembly as directed in section 20.
2. Remove the key pad PCB as directed in section 22.
3. Remove the keypad membrane by gently pulling the membrane up and out of the holes in the front panel.

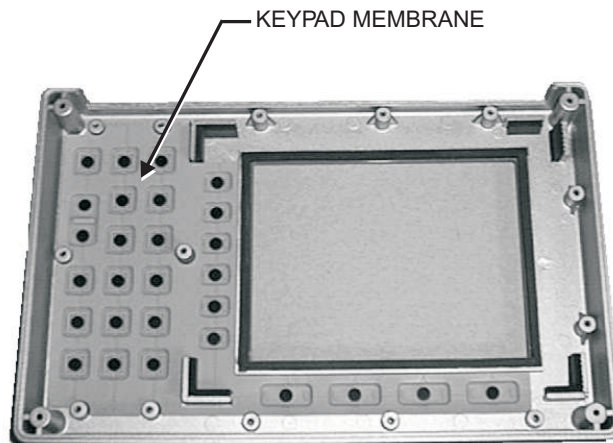


Figure 16. Front Panel Keypad Membrane

4. Reverse the above steps to install the replacement membrane.

24. Main PCB Assembly Replacement

This procedure provides instructions for replacing the main PCB assembly with the connector panel attached.

1. Remove the front panel assembly as directed in section 20.
2. Disconnect the battery connector from J7 on the main PCB.

3. Disconnect the semi-rigid coaxial cable from the RF In connector on the connector panel.
4. Remove the three PCB mounting screws and lift the Control PCB assembly with the connector panel attached slightly.

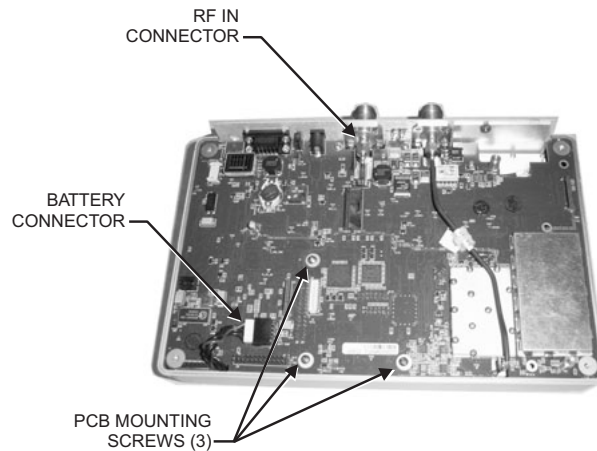


Figure 17. Main PCB (shown with optional T1/E1 PCB installed)

5. Carefully reach between the Main PCB and the SPA PCB and disconnect the cables from J2 and J4 on the SPA PCB.

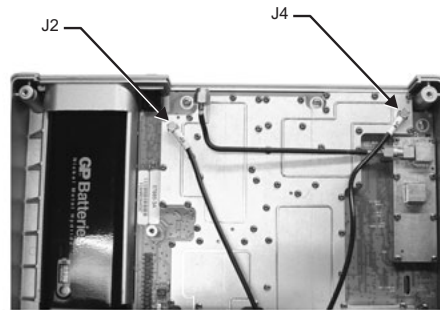


Figure 18. Spectrum Analyzer PCB

6. Remove the Main PCB.
7. Remove the three .25" standoffs and four Phillips screws and remove the Spectrum Analyzer PCB.
8. Reverse the above steps to install the new main PCB.

NOTE: The main PCB connector panel fits into grooves in the two halves of the case. Make sure the panel is correctly aligned with the grooves before reassembling the two halves together.

25. Option 5 Power Monitor PCB Assembly Replacement

This procedure provides instructions for replacing the Power Monitor PCB Assembly.

1. Remove the front panel assembly as directed in on page 38, Front Panel Assembly Removal and Replacement.
2. Remove the entire Main PCB assembly from the bottom case as directed on page 41.
3. On the upper right corner, locate and remove the nut that secures the blank plate to the connector panel.
4. Carefully remove the blank plate from the connector panel.
5. Install the new connector plate (p/n 61536) to the connector panel and secure it with the nut that was removed in step 4.
6. Peel off the rectangular portion from the overlay (p/n 61503) and stick it to the connector plate.
7. Install the three standoffs (p/n 785-405) to the main board on the side that faces the Front Panel assembly and secure them with three Phillips screws (p/n 900-720) from the side that faces the bottom case.
8. Install the Option 5 PCB assembly (p/n 63066-3) to the main board. Carefully align J1 to J6 of the main board when installing. Refer to Figure 19.
9. Secure the Option 5 PCB assembly to the standoffs using the last three Phillips screws.
10. Carefully push the DIN connector through the opening on the connector panel and secure it with the nuts (p/n 900-326) supplied.

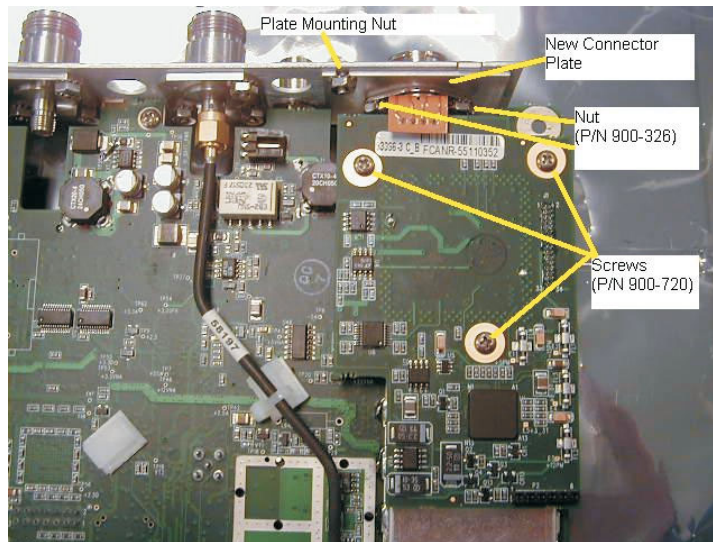


Figure 19. Power Monitor PCB Assembly Replacement

26. Accessories and Replaceable Parts

Accessories and replaceable parts for the Site Master S332D are listed below.

Accessories

Part Number	Description	Qty
10580-00079	User's Guide, Site Master S33xD	1
10580-00100	Programming Manual, Site Master S33xD (disk only)	1
2300-347	Handheld Software Tools	1
40-168	Power Supply	1
2000-1029	Battery Charger	1
22N50	Open/Short, N Male	1
SM/PL	Precision Termination, N Male	1
806-62	Automotive Power Adapter	1
806-16	Bantam Plug to Bantam Plug Cable Assembly	1
806-116	Bantam Plug to BNC Male Cable Assembly, 8 ft	1
806-117	Two Bantam Plugs to RJ48 Cable Assembly, 8 ft	1
800-441	Serial Interface Cable Assembly	1
65717	Soft Carrying Case	1

Replaceable Parts

Part Number	Description	Qty
510-87	N Male Connector	2
15-102	Monochrome Liquid Crystal Display Assembly	1
15-123	TFT Color Liquid Crystal Display Assembly	1
633-27	Rechargeable Battery, NiMH	1
ND62281	Main PCB Assembly, S332D, Serial Number ≤ 404999	1
ND63392	Main PCB Assembly, S332D, Serial Number 410001 through 538117, ≤ 538117 w/ Option 6	1
ND63393	Main PCB Assembly, S332D/10, Serial Number 410001 through 538117, ≤ 538117 w/ Option 6 or 10	1
ND65204	Main PCB Assembly, S332D/31, Serial Number 410001 through 538117, ≤ 538117 w/ Option 6	1
ND65205	Main PCB Assembly, S332D/10/31, Serial Number 410001 through 538117, ≤ 538117 w/ Option 6 or 10	1
ND65995	Main PCB Assembly, S332D, Serial Number ≥ 538118	1
ND65209	Main PCB Assembly, S332D/10A, Serial Number ≥ 538118	1
ND65996	Main PCB Assembly, S332D/31, Serial Number ≥ 538118	1
ND65210	Main PCB Assembly, S332D/10A/31, Serial Number ≥ 538118	1
ND68484	Main PCB Assembly, S332D, with Options 2 and 16	1
ND68495	Main PCB Assembly, S332D, with Options 2, 10A and 16	1
ND68496	Main PCB Assembly, S332D, with Options 2, 16 and 31	1
ND68497	Main PCB Assembly, S332D, with Options 2, 10A, 16 and 31	1
67199-3	Keypad PCB Assembly	1
46649-1	Keypad Membrane with contrast symbol	1
46649-6	Keypad Membrane without contrast symbol	1

Hardware

Part Number	Description	Qty
900-861	Pan Head Screw, 4-20, 0.365	19
900-791	Screw, 2-56, 0.375	77
900-720	Screw, 4-40, 0.187	6
900-326	Kep Nut, 4-40, 0.187	3
790-18	M-F Standoff, 4-40, 0.375, Hex	4
785-405	Plain Standoff, 4-40, 0.187, Hex	
785-927	M-F Standoff, 4-40, 0.625	3
761-79	Cap Vinyl, Black, round	2

Case Parts

Part Number	Description	Qty
46652-3	Top Case only for units with serial number 409999 and below	1
46652-8	Top Case only for units with serial number 410001 and above	1
61440-1	Top Case for units with TFT Color LCD Display	1
46653-3	Bottom Case only	1
48231-3	Battery Door	1
790-509 790-510 48241	Battery Door Latch (3 pieces)	1
790-511	Door Lock Receptacle	1
46655	Case Corner Bumpers	4
46662	LCD Retainer Plate	1
48241	Foam, LCD Corners	9
48278	Foam, LCD Window	1
46659	Foam, LCD Backing	1
46661	Foam, Keypad Backing	1
720-19	Cable Clamp	1
790-515	Spring, Battery Compartment	1
61396	ID Label, Model S332D	1

27. Customer Service

To locate the nearest Anritsu Customer Service Center, please refer to the Anritsu web page:

<http://www.anritsu.com/Contact.asp>

Anritsu

Discover What's Possible™