

Model: DADF-H1

Ref. No. : FF-T01-X-000041-01

Date : March 19, 2002

© Canon (UK) Limited

Location: Internal Components

Subject: Addition of a damper to the left hinge unit to alleviate noise generated when closing the DADF

Reason: To alleviate noise generated when closing the DADF, a damper is added to the left hinge unit.

Detail:

<Symptom>

Noise when closing the DADF (Banging noise is created when the DADF is closed.)

<Factory Measures>

Add a damper to the left hinge unit in order to alleviate the shock when the DADF is closed so that the noise can be also alleviated. (See the figure below.)

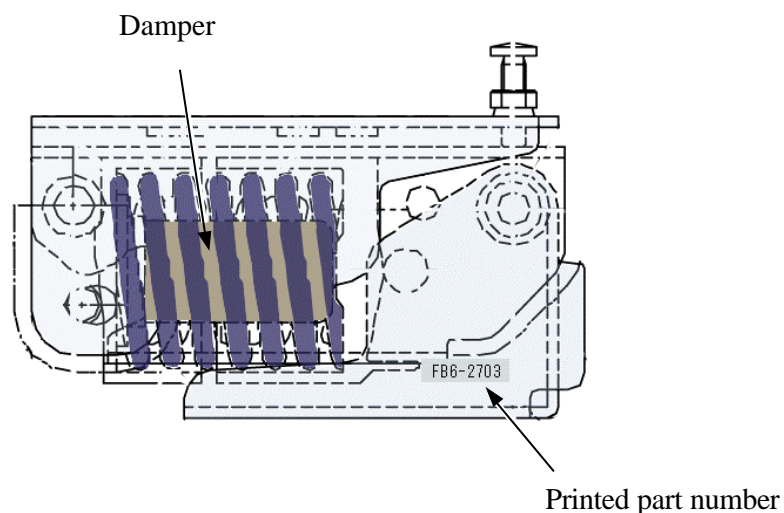


Figure: New type of left hinge unit

Servicing Work:

If you receive a complaint about the noise when closing the DADF, replace the left hinge unit with the new type.

Service Parts:

No.	Description		Part number	Q'ty	Stock	Inter-change-ability	P.C.
							Stock date
1	Old	LEFT HINGE UNIT	FB5-9385-000	1→0	C	<div> <div>↓</div> <div>No</div> </div> <div> <div>↑</div> <div>Yes</div> </div>	11
	New	LEFT HINGE UNIT	FB6-2703-000	0→1	D		Big. of Apr.

Affected Machines:

To be communicated as soon as identified.