



Service Information

COPIER

☐ HARDWARE

☒ SOFTWARE

Model : Canon PCL5e Printer Driver for Windows 2000 v4.40

Number: FF-T01-V1-000083-01

(00-OIPD0-B0047)

Date : May 17, 1999

©Canon UK Limited

Location : PCL5e Printer

Subject : PCL5e Printer Driver Version 4.40 for Windows2000 Release

Reason : PCL5e Printer Driver v4.40 for Windows2000 was released.

Support Language = US_English, UK_English

[History of Release]

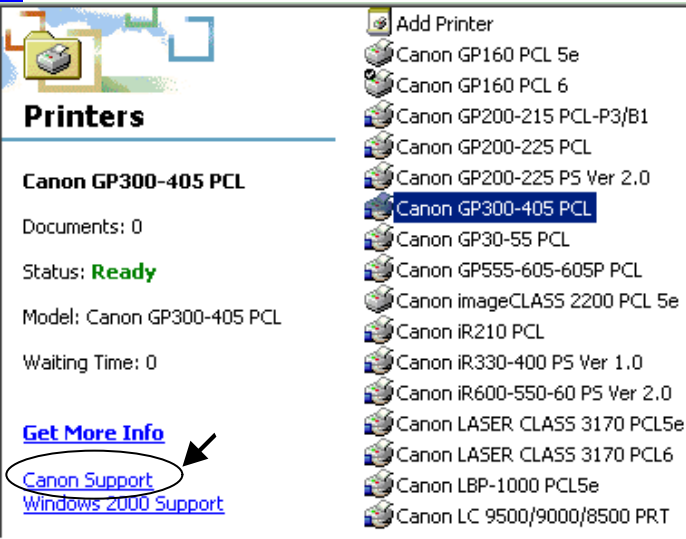
Service Info. No.	Ver. No.	Description	Date
FF-T01-V1-000083-01	PCL5e Drv v4.40	Windows2000 Support	May 17, 2000
RR-T02-RAX-000001-01	PCL5e Drv v4.30/ PCL6 Drv v2.00	- LBP-1000/LBP-1760/LBP-1760e Support	February 17, 2000
FF-T01-V1-000055-01	PRN Drv V4.20 FAX Drv V1.20/21	Localized version Release	January 17, 2000
99-OIPD0-B0077	PRN Drv V4.20 FAX Drv V1.20/21	- Network Multi PDL Printer Board-H1/K1 v2.0 Support - Multi PDL Board-B1/Printer Board-P3 Support (Windows9x) - Multi PDL Board-A1/Printer Board-P2 Support (Windows NT4.0 Only)	November 17, 1999

99-OIPD0-B0060	PRN Drv V4.10 FAX Drv V1.10	- Network Multi PDL Printer Board-D1/E1 v2.0 Support - Network Printer Board-F1 v2.0 Support - Multi PDL Board-B1/Printer Board-P3 Support (Windows NT4.0 Only)	September 8, 1999
99-OIPD0-B0026	PRN Drv V4.00/4.01 FAX Drv V1.00/1.01	New Release	March 30, 1999

Details :

PCL5e Driver v4.40 supports Windows2000 as Support OS.

To support Window2000, the following new functions are added.

No.	Item	Descriptions
1	Page Composer v2.25 Support	By supporting PageComposer, various sorts of printing, such as Scaling Printing, Nup Printing, and Booklet Printing, are implemented.
2	Embedded URL for Downloading Driver	<p>URL information to access each Printer Manufacturer's Web Site from Printer Folder in Windows2000 is embedded, so that Driver can be easily updated.</p> <p>The embedded URL is at: http://www.canon.com/support/index.html?model=%model%</p> 

Restrictions :

Here are the restrictions in the PCL5e Printer Driver v4.40 for Windows 2000.

No.	Item	Descriptions
1	Not supporting WHQL (Windows Hardware Quality Lab)	<p>Since this version has not passed the WHQL certification from Microsoft, a warning message is displayed at installation.</p> <p>However, the installation is performed correctly.</p>
2	Acquisition of GP30-55 MPDL Board-A1/GP200-215 MPDL Printer Board-B1 Device Information	The acquisition function of GP30-55 MPDL Board-A1/GP200-215 MPDL Printer Board-B1 device information is not supported as well as PCL5e printer driver Ver.4.30.
3	Acquisition of LBP-1000/LBP-1760/LBP-1760e Device Information	The acquisition function of LBP-1000/LBP-1760/LBP-1760e device information is not supported as well as PCL5e printer driver Ver.4.30.

Supported Devices :

This version supports the following devices.

GP300-405 PCL (UK) / iR330-400 PCL (US)
 GP555-605-605P PCL (UK) / iR600-550-60 PCL (US)

GP200-225 PCL (UK/US) / iR210 PCL (US)
GP200-215 PCL-P3/B1 (US/UK)
GP30-55 PCL (UK/US)
LBP-1000 PCL5e (UK)
LBP-1760/1760e PCL5e (UK) / LBP-1760 PCL (US)

Combination of ROMs :

Network Multi PDL Printer Board-D1/E1 (GP200-225/iR210)	Ver.2.0
NetWork Printer Board-F1 (GP605-555-605P/iR60-600)	Ver.2.0
Network Multi PDL Printer Board-H1/K1 (GP300-405/iR330-400)	Ver.2.0
Multi PDL Board-B1 (GP200-215)	Ver.4.01 or later(v6.03 is recommended)
Printer Board-P3 (GP200-215)	Ver.4.01 or later (v6.03 is recommended)
Multi PDL Board-A1 (GP55-30)	Ver.15.11
Printer Board-P2 (GP55-30)	Ver.15.12