4278A-08

S	Е	R	V	I	С	Е	Ν	0	Т	Е
							SUPERSEDE	ES: None	)	
4278	8A 1kF	Iz/1M	Hz Ca	pacita	ance M	eter				
Seria	l Numbo	ers: 000(	000000	/ 2936J	02833					
Mod	lificatio	on prev	ents c	loggin	ig mem	ory car	d socket			
Dupl	icate Sei	rvice No	tes: Nor	ne						
To B	e Perfor	med By:	Agilen	t-Qualif	ied Perso	onnel				
Parts	Requir	ed:								
Part	No.	Qty.	D	escripti	ion					
0427	8-66510	1	Ν	lemory	Card Soc	eket Assy				
0427	8-00637	1	Р	Plate						
0427	8-01205	1	А	Angle						
0515	-1550	2	S	crew						
0535	-0004	2	Ν	ut						
					Not					
							hat do not yet ha	ave		
	-	the dust-	prevent	ve cove	er installe	ed.				
								C	Continued	
							DATE: 04 Jun	o 1002		

## ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:									
MODIFICATION RECOMMENDED									
ACTION CATEGORY:	<ul> <li>IMMEDIATELY</li> <li>ON SPECIFIED FAILURE</li> <li>AGREEABLE TIME</li> </ul>	STANDARDS: Labor 0.5 Hour							
LOCATION CATEGORY:	<ul> <li>CUSTOMER INSTALLABLE</li> <li>ON-SITE</li> <li>SERVICE CENTER</li> </ul>	SERVICE RETURN USED RETURN INVENTORY: SCRAP PARTS: SCRAP SEE TEXT SEE TEXT							
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: 31 May 1994							
AUTHOR: YO	ENTITY: 3355	ADDITIONAL INFORMATION:							

© 1992 AGILENT TECHNOLOGIES PRINTED IN U.S.A.



## Situation:

The memory card socket of 4278A which used in a production line may clog up with dust.

## Solution/Action:

Replace the defective memory card socket assembly by installing the new one with the dust-preventive cover, refer to Figure 1.

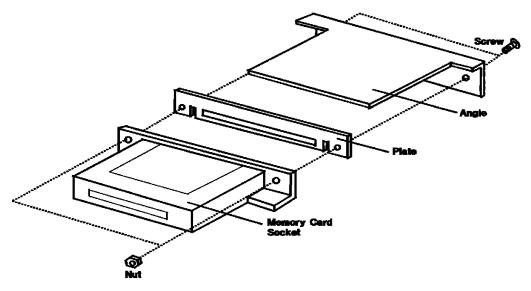


Figure 1. Dust-Preventive Cover Assembly

## Page 2