

S E R V I C E N O T E

SUPERSEDES: None

**8664A Synthesized Signal Generator**

**Serial Numbers:** 0000A00000 / 3035A00185

**I/O Assembly Replacement requires modification to Reference Assembly**

**Duplicate Service Notes:**

- 8664A-01
- 8665A-02
- 8665B-01
- 70322A-01

**Situation:**

When an I/O assembly (08665-69104 or 08665-60204) is replaced in instruments (serial numbers noted above) a component on the Reference assembly (P/N 08665-61006) must be removed to insure proper operation of the reference oscillator.

NOTE: Billings related to replacement of the I/O or Reference assemblies are not covered by this Service Note.

**Solution/Action:**


Remove L307 on the Reference assembly. Refer to Figure 1 for component location. Re-calibration is not required.

*Continued*

DATE: 09 October 1992

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:					
<b>MODIFICATION RECOMMENDED</b>					
ACTION CATEGORY:	<input type="checkbox"/> IMMEDIATELY <input checked="" type="checkbox"/> ON SPECIFIED FAILURE <input type="checkbox"/> AGREEABLE TIME	STANDARDS:	Labor 1.0 Hour		
LOCATION CATEGORY:	<input type="checkbox"/> CUSTOMER INSTALLABLE <input type="checkbox"/> ON-SITE <input checked="" type="checkbox"/> SERVICE CENTER	SERVICE INVENTORY:	<input type="checkbox"/> RETURN <input checked="" type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT	USED PARTS:	<input type="checkbox"/> RETURN <input checked="" type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: 01 November 1997			
AUTHOR: LHL	ENTITY: 1000	ADDITIONAL INFORMATION:			

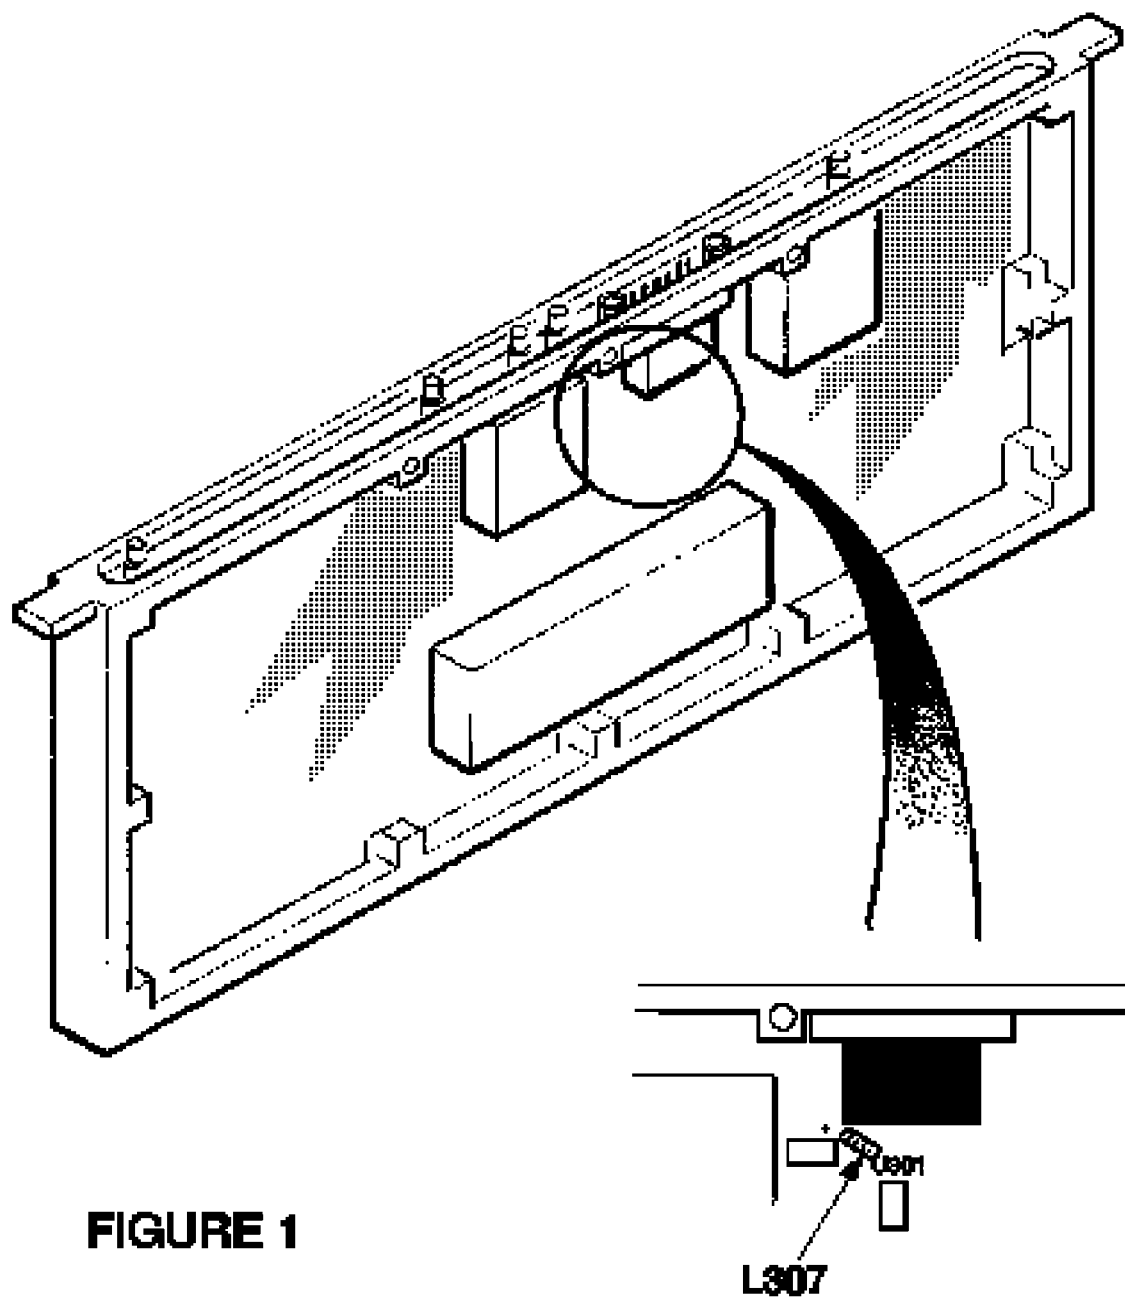

**FIGURE 1**