8922G-01

S E R V I C E N O T E SUPERSEDES: None

Serial Numbers: 3050A00101 / 3343A00550

Recommended Removal of Hardware

Duplicate Service Notes:

8922A-01 8922B-01 8922E-01 8922G-01

Parts Required: None

Situation:

Instruments with serial numbers noted above may have internal hardware (screw and nut) which is improperly attached to the A31 GSM CODEC, A32 GSM Controller, and A34 GSM RTI assemblies. Refer to Figure 1 for location of these assemblies. The hardware can become separated from the assembly, contact other circuitry and may cause electrical damage.

Solution/Action:

Remove and discard the hardware. Specific locations are indicated in Figure 2. Check for and remove any loose hardware within the instrument. Re-calibration is not required.

Continued

DATE: 02 June 1994

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION CATEGORY:	 IMMEDIATELY ON SPECIFIED FAILURE AGREEABLE TIME 	STANDARDS: Labor 1.0 Hour	
LOCATION CATEGORY:	 CUSTOMER INSTALLABLE ON-SITE SERVICE CENTER 	SERVICE □ RETURN USED □ RETURN INVENTORY: ■ SCRAP PARTS: ■ SCRAP □ SEE TEXT □ SEE TEXT □ SEE TEXT	
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: 01 June 1999	
AUTHOR: LHL	ENTITY: 1000	ADDITIONAL INFORMATION:	

© 1994 AGILENT TECHNOLOGIES	
PRINTED IN U.S.A.	



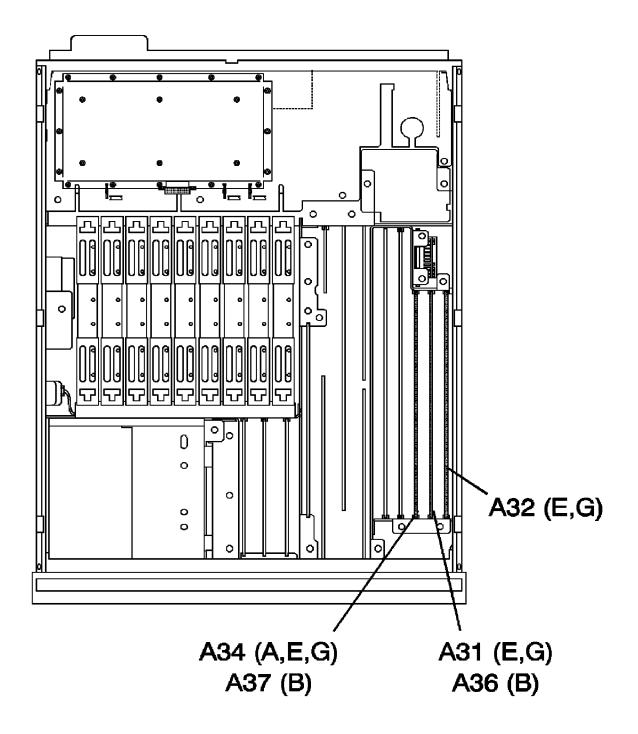


FIGURE 1 Top Internal View of HP 8922A/B/E/G

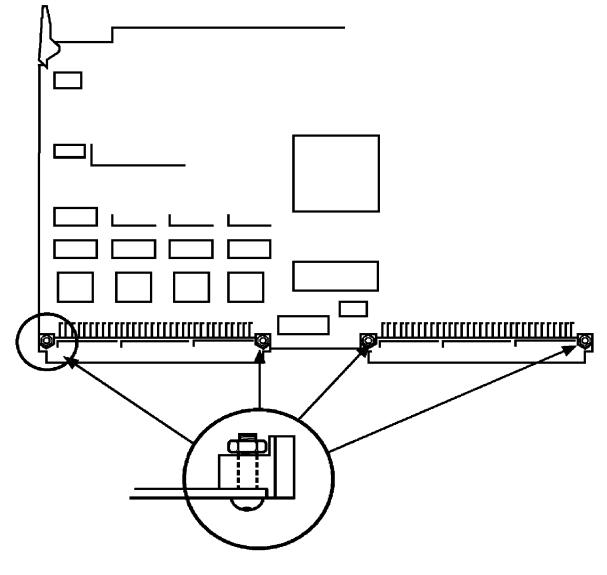


FIGURE 2 Location of Excess Screw and Nut Hardware