

Laser Diode L-I-V Test System

Quick Setup Guide

A GREATER MEASURE OF CONFIDENCE

WARRANTY

Keithley Instruments, Inc. warrants this product to be free from defects in material and workmanship for a period of 1 year from date of shipment.

Keithley Instruments, Inc. warrants the following items for 90 days from the date of shipment: probes, cables, rechargeable batteries, diskettes, and documentation.

During the warranty period, we will, at our option, either repair or replace any product that proves to be defective.

To exercise this warranty, write or call your local Keithley representative, or contact Keithley headquarters in Cleveland, Ohio. You will be given prompt assistance and return instructions. Send the product, transportation prepaid, to the indicated service facility. Repairs will be made and the product returned, transportation prepaid. Repaired or replaced products are warranted for the balance of the original warranty period, or at least 90 days.

LIMITATION OF WARRANTY

This warranty does not apply to defects resulting from product modification without Keithley's express written consent, or misuse of any product or part. This warranty also does not apply to fuses, software, non-rechargeable batteries, damage from battery leakage, or problems arising from normal wear or failure to follow instructions.

THIS WARRANTY IS IN LIEU OF ALL OTHER WARRANTIES, EXPRESSED OR IMPLIED, INCLUD-ING ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE. THE REMEDIES PROVIDED HEREIN ARE BUYER'S SOLE AND EXCLUSIVE REMEDIES.

NEITHER KEITHLEY INSTRUMENTS, INC. NOR ANY OF ITS EMPLOYEES SHALL BE LIABLE FOR ANY DIRECT, INDIRECT, SPECIAL, INCIDENTAL OR CONSEQUENTIAL DAMAGES ARISING OUT OF THE USE OF ITS INSTRUMENTS AND SOFTWARE EVEN IF KEITHLEY INSTRUMENTS, INC., HAS BEEN ADVISED IN ADVANCE OF THE POSSIBILITY OF SUCH DAMAGES. SUCH EXCLUDED DAM-AGES SHALL INCLUDE, BUT ARE NOT LIMITED TO: COSTS OF REMOVAL AND INSTALLATION, LOSSES SUSTAINED AS THE RESULT OF INJURY TO ANY PERSON, OR DAMAGE TO PROPERTY.

KEITHLEY

Keithley Instruments, Inc.		28775 Aurora Road • Cleveland, Ohio 44139 • 440-248-0400 • Fax: 440-248-6168 1-888-KEITHLEY (534-8453) • www.keithley.com
Sales Offices:	BELGIUM: CHINA: FINLAND: FRANCE: GERMANY: GREAT BRITAIN: INDIA: ITALY: JAPAN: KOREA: NETHERLANDS: SWEDEN: SWITZERLAND: TAIWAN:	c/o Regus Business Centre • Frosundaviks Allé 15, 4tr • 169 70 Solna • 08-509 04 679 • Fax: 08-655 26 10

Laser Diode L-I-V Test System Quick Setup Guide

> ©2001, Keithley Instruments, Inc. All rights reserved. Cleveland, Ohio, U.S.A. First Printing, June 2001 Document Number: LIV-903-01 Rev. A

Manual Print History

The print history shown below lists the printing dates of all Revisions and Addenda created for this manual. The Revision Level letter increases alphabetically as the manual undergoes subsequent updates. Addenda, which are released between Revisions, contain important change information that the user should incorporate immediately into the manual. Addenda are numbered sequentially. When a new Revision is created, all Addenda associated with the previous Revision of the manual are incorporated into the new Revision of the manual. Each new Revision includes a revised copy of this print history page.

Revision A (Document Number LIV-903-01)..... June 2001

All Keithley product names are trademarks or registered trademarks of Keithley Instruments, Inc. Other brand names are trademarks or registered trademarks of their respective holders.

Safety Precautions

The following safety precautions should be observed before using this product and any associated instrumentation. Although some instruments and accessories would normally be used with non-hazardous voltages, there are situations where hazardous conditions may be present.

This product is intended for use by qualified personnel who recognize shock hazards and are familiar with the safety precautions required to avoid possible injury. Read the operating information carefully before using the product.

The types of product users are:

Responsible body is the individual or group responsible for the use and maintenance of equipment, for ensuring that the equipment is operated within its specifications and operating limits, and for ensuring that operators are adequately trained.

Operators use the product for its intended function. They must be trained in electrical safety procedures and proper use of the instrument. They must be protected from electric shock and contact with hazardous live circuits.

Maintenance personnel perform routine procedures on the product to keep it operating, for example, setting the line voltage or replacing consumable materials. Maintenance procedures are described in the manual. The procedures explicitly state if the operator may perform them. Otherwise, they should be performed only by service personnel.

Service personnel are trained to work on live circuits, and perform safe installations and repairs of products. Only properly trained service personnel may perform installation and service procedures.

Keithley products are designed for use with electrical signals that are rated Installation Category I and Installation Category II, as described in the International Electrotechnical Commission (IEC) Standard IEC 60664. Most measurement, control, and data I/O signals are Installation Category I and must not be directly connected to mains voltage or to voltage sources with high transient over-voltages. Installation Category II connections require protection for high transient over-voltages often associated with local AC mains connections. The user should assume all measurement, control, and data I/O connections are for connection to Category I sources unless otherwise marked or described in the Manual.

Exercise extreme caution when a shock hazard is present. Lethal voltage may be present on cable connector jacks or test fixtures. The American National Standards Institute (ANSI) states that a shock hazard exists when voltage levels greater than 30V RMS, 42.4V peak, or 60VDC are present. A good safety practice is to expect that hazardous voltage is present in any unknown circuit before measuring.

Users of this product must be protected from electric shock at all times. The responsible body must ensure that users are prevented access and/or insulated from every connection point. In some cases, connections must be exposed to potential human contact. Product users in these circumstances must be trained to protect themselves from the risk of electric shock. If the circuit is capable of operating at or above 1000 volts, **no conductive part of the circuit may be exposed**.

Do not connect switching cards directly to unlimited power circuits. They are intended to be used with impedance limited sources. NEVER connect switching cards directly to AC mains. When connecting sources to switching cards, install protective devices to limit fault current and voltage to the card.

Before operating an instrument, make sure the line cord is connected to a properly grounded power receptacle. Inspect the connecting cables, test leads, and jumpers for possible wear, cracks, or breaks before each use.

When installing equipment where access to the main power cord is restricted, such as rack mounting, a separate main input power disconnect device must be provided, in close proximity to the equipment and within easy reach of the operator.

For maximum safety, do not touch the product, test cables, or any other instruments while power is applied to the circuit under test. ALWAYS remove power from the entire test system and discharge any capacitors before: connecting or disconnecting cables or jumpers, installing or removing switching cards, or making internal changes, such as installing or removing jumpers.

Do not touch any object that could provide a current path to the common side of the circuit under test or power line (earth) ground. Always make measurements with dry hands while standing on a dry, insulated surface capable of withstanding the voltage being measured.

The instrument and accessories must be used in accordance with its specifications and operating instructions or the safety of the equipment may be impaired.

Do not exceed the maximum signal levels of the instruments and accessories, as defined in the specifications and operating information, and as shown on the instrument or test fixture panels, or switching card.

When fuses are used in a product, replace with same type and rating for continued protection against fire hazard.

Chassis connections must only be used as shield connections for measuring circuits, NOT as safety earth ground connections.

If you are using a test fixture, keep the lid closed while power is applied to the device under test. Safe operation requires the use of a lid interlock.

If a (\pm) screw is present, connect it to safety earth ground using the wire recommended in the user documentation.

The \angle symbol on an instrument indicates that the user should refer to the operating instructions located in the manual.

The $\cancel{1}$ symbol on an instrument shows that it can source or measure 1000 volts or more, including the combined effect of normal and common mode voltages. Use standard safety precautions to avoid personal contact with these voltages.

The **WARNING** heading in a manual explains dangers that might result in personal injury or death. Always read the associated information very carefully before performing the indicated procedure.

The CAUTION heading in a manual explains hazards that could damage the instrument. Such damage may invalidate the warranty.

Instrumentation and accessories shall not be connected to humans.

Before performing any maintenance, disconnect the line cord and all test cables.

To maintain protection from electric shock and fire, replacement components in mains circuits, including the power transformer, test leads, and input jacks, must be purchased from Keithley Instruments. Standard fuses, with applicable national safety approvals, may be used if the rating and type are the same. Other components that are not safety related may be purchased from other suppliers as long as they are equivalent to the original component. (Note that selected parts should be purchased only through Keithley Instruments to maintain accuracy and functionality of the product.) If you are unsure about the applicability of a replacement component, call a Keithley Instruments office for information.

To clean an instrument, use a damp cloth or mild, water based cleaner. Clean the exterior of the instrument only. Do not apply cleaner directly to the instrument or allow liquids to enter or spill on the instrument. Products that consist of a circuit board with no case or chassis (e.g., data acquisition board for installation into a computer) should never require cleaning if handled according to instructions. If the board becomes contaminated and operation is affected, the board should be returned to the factory for proper cleaning/servicing.

Table of Contents

Introduction 1				
Standard system configurations 1				
Model LIV-1: General Purpose L-I-V Measurement 1				
Model LIV-2: Transmitter Module 2				
Model LIV-3: 980nm Pump Module 2				
Model LIV-4: High Power Pump Module 2				
System block diagram 3				
Installation				
Connections				
Signal connections 6				
Control connections				
Power line connections				
Power-up and checkout				
Power-up				
L-I-V test resistor network				
Checkout procedure 10				
Instrument programming 10				
Model 2400/2420/2440 SourceMeter programming				
Model 2500 Dual Photodiode Meter programming 12				
Model 2510 TEC SourceMeter programming 14				

List of Illustrations

Figure 1	System block diagram	3
Figure 2	Suggested rack mount locations	5
Figure 3	System signal connections	7
Figure 4	System control connections	8
Figure 5	Test resistor network	9
Figure 5	Test resistor network	9

Congratulations

Congratulations on your purchase of Keithley's LIV (Light Intensity-Current-Voltage) Test System for testing of Laser Diode Modules (LDMs). In applications such as yours, our LIV Test System has been proven to provide a complete LDM test solution, including control of the thermo-electric cooler (TEC), which is a critical part of LDM assemblies.

In this quick setup guide, you'll find information that will enable you to:

- configure
- install
- make signal connections
- perform power-up and checkout
- begin programming

The rest of this section provides an overview of our LIV system.

Your LIV system is either a custom configuration, or one of the following standard configurations:

- LIV-1 General Purpose L-I-V System
- LIV-2 Transmitter Module L-I-V System
- LIV-3 980nm Pump L-I-V System
- LIV-4 High Power Pump Module L-I-V System
- LIV-1-F General Purpose L-I-V System with Fixture TEC Control
- LIV-2-F Transmitter Module L-I-V System with Fixture TEC Control
- LIV-3-F 980nm Pump L-I-V System with Fixture TEC Control
- LIV-4-F High Power Pump Module L-I-V System with Fixture TEC Control

The basic configuration can be easily modified to allow for new connections or expansion with new measurement and control functions, such as other Keithley meters and switching systems. A demonstration software package, created in Visual Basic, provides you with a head start in programming your specific L-I-V test system application.

These configurations may include some or all of the following instruments:

- Model 2400 SourceMeter® that drives the laser diode and acts as a modulator bias source in LDMs employing an integrated modulator.
- Model 2440 5A SourceMeter Instrument that provides a 5A source and measure capability that makes it well suited for testing high power pump lasers.
- Model 2500 Dual Photodiode Meter that uses a time-saving dual-channel design to facilitate simultaneous measurement of related parameters.
- Model 2500INT Integrating Sphere that allows the system to make direct measurements of optical power, with results expressed in watts.
- The Model 2510 TEC Sourcemeter that combines high-speed DC sourcing and measurement with the ability to control the operation of a laser diode module's Thermo-Electric Cooler or TEC (also known as a "Peltier device").
- Model 2510-AT Autotuning TEC SourceMeter that adds autotuning capability using a modified Zeigler-Nichols algorithm. This allows you to determine P, I, and D (proportional, integral, and derivative) values for closed loop temperature control so you no longer need to determine the optimal values for these coefficients experimentally.

Optoelectronic Solutions from Keithley

Keithley offers a suite of products for electrical production test applications that support your need for accuracy and throughput. Other optoelectronic solutions available from Keithley include:

- Model 2520 Pulsed Laser Diode Test System that combines high speed current pulsing with measurement capabilities for precision testing at earlier stages of production without the damaging effects of device heating.
- The Model 4200 Semiconductor Characterization System that combines high resolution DC source and measurement with real-time plotting and analysis for material and device characterization and development.
- Keithley's RF/Microwave Signal Routing Systems for switching and conditioning of high data rate signals up to 40GHz.

Laser Diode L-I-V Test System Quick Setup Guide

Introduction

This guide provides basic information on setting up and using the Laser Diode L-I-V Test System, which combines all the necessary DC measurement capabilities to test laser diode modules. For more detailed information on each of the instruments in the L-I-V Test System, refer to the corresponding user's manual supplied with each unit.

Standard system configurations

The standard system configurations below are supplied with all the cables and adapters required for communication, triggering, and connection to the device to be tested. Also included is all the necessary hardware for rack mounting the instruments.

Model LIV-1: General Purpose L-I-V Measurement

This system is configured as a general purpose system. The system includes:

- Model 2400 SourceMeter[®] for laser drive and forward voltage measure.
- Model 2500 Dual Photodiode Meter[®] for back facet detector measurement and front facet photo current.
- Model 2510 TEC SourceMeter[®] for temperature control of the internal TEC module.

Model LIV-2: Transmitter Module

This system is configured specifically for testing of transmitter laser module in the 1330nm to 1550nm range. The system includes:

- Model 2420 SourceMeter for laser drive and forward voltage measure.
- Model 2500 Dual Photodiode Meter for back facet detector measurement and front facet optical power.
- Model 2510-AT Autotuning TEC SourceMeter for temperature control of the internal TEC module.
- Model 2500INT Integrating Sphere with a cooled InGaAs detector and an FC/PC input connector for optical power measurement.

Model LIV-3: 980nm Pump Module

This system is configured specifically for testing of 980nm pump laser with an input current level of 3A or less. The system includes:

- Model 2420 SourceMeter for laser drive up to 3A and forward voltage measure.
- Model 2500 Dual Photodiode Meter for back facet detector measurement and front facet optical power.
- Model 2510-AT Autotuning TEC SourceMeter for temperature control of the internal TEC module.
- Model 2500INT Integrating Sphere with a silicon detector and an FC/PC input connector for optical power measurement.

Model LIV-4: High Power Pump Module


This system is configured specifically for testing of high power pump laser module with a 14xx wavelength. The system includes:


- Model 2440 SourceMeter for laser drive up to 5A and forward voltage measure.
- Model 2500 Dual Photodiode Meter for back facet detector measurement and front facet optical power.
- Model 2510-AT Autotuning TEC SourceMeter for temperature control of the internal TEC module.
- Model 2500INT Integrating Sphere with a germanium detector and an FC/PC input connector optical power measurement.

System block diagram

Figure 1 shows an overall block diagram of the L-I-V Test System. Components include:

- Model 2400/2420/2440 SourceMeter: sources current to the laser diode module and measures voltage across the device.
- Model 2500 Dual Photodiode Meter: Biases and measures currents from the two photodiode detectors.
- Model 2510/2510-AT TEC SourceMeter: Controls the TEC (thermo-electric cooler) power to maintain the laser diode module at the desired temperature.
- Model 2500INT Integrating Sphere: Provides optimal coupling of light from laser diode module to integral Ge, Si, or InGaAs photodiode detector (not included in Model LIV-1).
- Trigger Link: synchronizes instrument readings.
- GPIB: interfaces the instruments to the controlling computer.



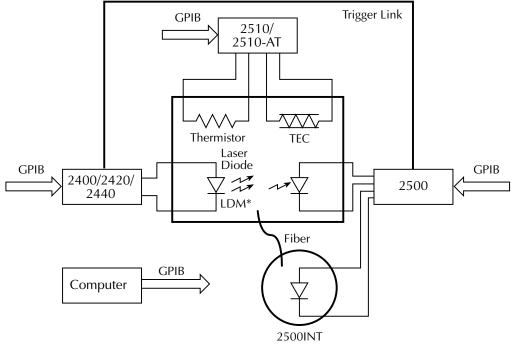


*LDM (Laser Diode Module) = Device Under Test

Installation

The instruments for the L-I-V system are shipped configured for bench-top use. If system rack mounting is desired, the necessary rack mounting kits are provided. Follow the steps below to rack mount the instruments.

- **NOTE** See the documentation provided with the supplied Model 4288-1 and 4288-2 rack mount kits for more detailed information on attaching rack mount hardware.
 - 1. First determine the desired location of each instrument. Figure 2 shows suggested mounting locations. Be sure to allow sufficient air space above and below the instruments, as shown, for proper ventilation.
 - 2. Remove the handles and feet from the instruments, then attach the necessary rack mounting hardware.
 - 3. Slide the instruments into the rack, then secure them with four mounting screws.

Figure 2 Suggested rack mount locations

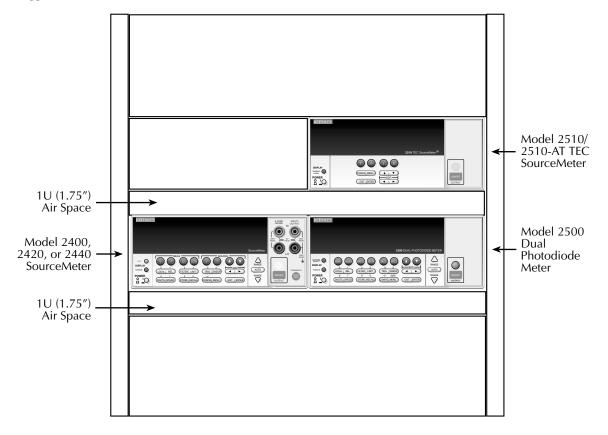

Connections

Signal connections

Using Figure 3 as a guide, make signal connections as follows:

- Model 2400/2420/2440 SourceMeter: Connect the rear panel INPUT/OUTPUT and SENSE HI and LO terminals to the laser diode module using the supplied banana-tocoaxial adapters and BNC-to-alligator cables as shown. The instrument must be used in the 4-wire sense mode.
- Model 2500 Dual Photodiode Meter: Connect the INPUT jacks to the two photodiodes and/or integrating sphere using the supplied triax cables as shown. Connect the triax center conductor to the detector terminal labeled anode; triax outer shield (chassis ground) to the detector terminal labeled cathode. For the Model 2500INT integrating sphere, make direct connections using a triax cable and Model 6172 adapter. Note: ground connect mode must be enabled to use this configuration. (When using the demo software, channel 1 is the front facet, and channel 2 is the back facet.)
- Model 2510/2510-AT TEC SourceMeter: Connect the INPUT and OUTPUT terminals to the TEC and temperature sensor using the supplied Model 2510-CAB cable as shown.
- **NOTE** Additional cable configurations are available from Keithley Instruments, Inc. for other connections to the DUT. Contact your local sales representative for details.

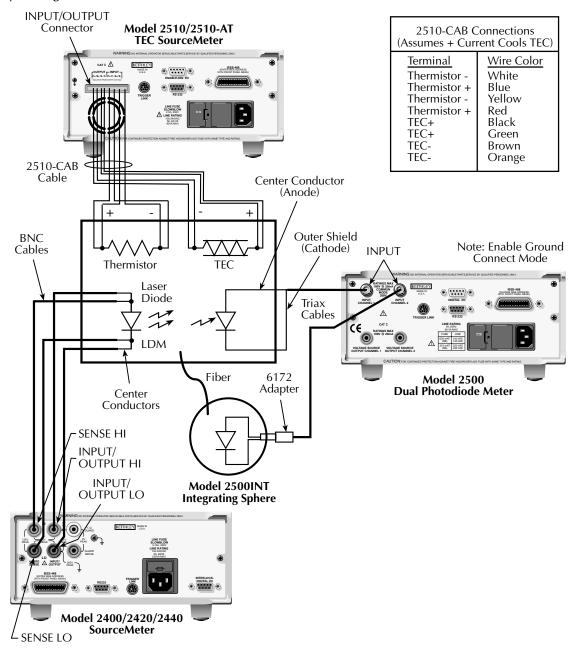


Figure 3 System signal connections

Control connections

Refer to Figure 4 for the following control connections.


GPIB connections

Connect the rear panel IEEE-488 connectors of each instrument to the IEEE-488 interface of the next instrument, and then to the computer interface using the supplied Model 7007 GPIB cables.

Trigger link connections

Connect the rear panel TRIGGER LINK connectors of the Model 2400/2420/2440 and Model 2500 together using the supplied Model 8501 trigger link cable.



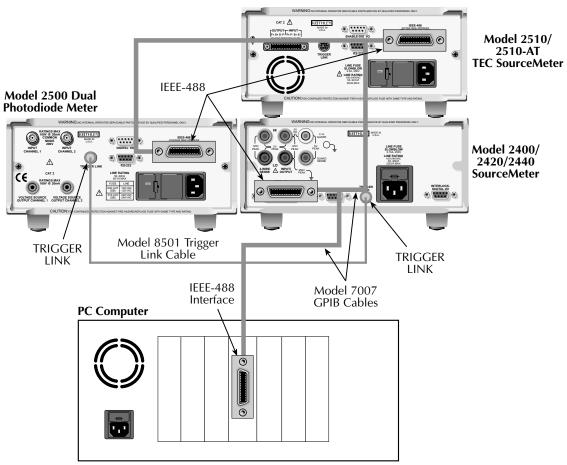

Power line connections

Connect instrument power line inputs to a grounded power outlet using the supplied line cords. Make certain that the power line voltage is within the range specified on the rear panel of each instrument.

Power-up and checkout


Power-up

Turn on the power to all instruments, and verify that they all go through their normal powerup cycles. Note the IEEE-488 address that is shown on the bottom line of the display as part of the power-up cycle, for example: SCPI Addr = 25. Be sure to use that address in your program, or change the addresses to the desired settings. (Use the COMMUNICATION/GPIB selection in the main MENU.)

L-I-V test resistor network

Figure 5 shows a schematic diagram of a resistive network that can be used to check out your system. These resistors can be mounted in a shielded component box that is equipped with banana jacks for connections to 2400/2420/2440 INPUT/OUTPUT HI and LO, as well as two triax jacks for connections to the two Model 2500 INPUT jacks.

Figure 5 Test resistor network

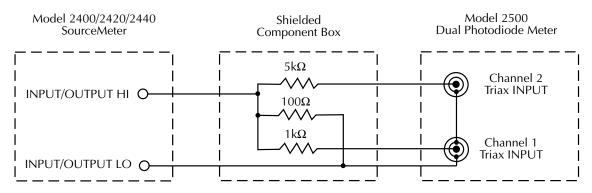

Checkout procedure

Instruments can be checked for proper operation using the resistor network in Figure 5 as follows:

- Model 2400/2420/2440: Select SOURCE I, MEASURE V, then set the source current to +50mA. Turn on the output, then verify that the measured voltage is approximately +5V.
- Model 2500: Set the Model 2400/2420/2440 for SOURCE V, then set the output voltage to +5V. Turn on the output, then verify that the displayed Model 2500 channel 1 reading is approximately +5mA, and the displayed Model 2500 channel 2 reading is about +1mA.

Instrument programming

Several demonstration applications are provided on the software disk supplied with your L-I-V system. Included is a Labview application and several Visual Basic (VB) applications specific to the type of interface card. These programs are fully functional and can be easily modified for your specific purposes.

The following section provides details regarding the function of one of the VB applications provided. This information will aid your modification effort to taylor the applications to your specific needs.

Model 2400/2420/2440 SourceMeter programming

The code fragment below is a subroutine that sets up the SourceMeter for a laser diode current sweep while measuring laser diode voltage. Various operating modes are programmed as follows:

- Beeper: off
- Auto zero: off for maximum speed
- Remote sensing: on (4-wire connections)
- · Terminals: rear
- Source function: current
- Start current: set during program execution (10mA minimum)
- Stop current: set during program execution (1A maximum)
- Step current: set during program execution ([start step]/10 minimum)
- · Current source mode: linear sweep, best fixed source range
- Source delay and NPLCs: set during program execution
- Sense function: concurrent functions disabled, voltage function enabled
- Voltage limit: 5V
- Voltage measurement range: 20V
- · Data elements: both voltage and current, binary format
- SRQ: generate SRQ when buffer is full
- Arm source and count: immediate source, infinite count (bypass arm layer)
- Trigger source and lines: trigger link, line 1 input, line 2 output
- · Source trigger: wait for input trigger before changing source, bypass first trigger
- Trigger output: output trigger after delay phase of SDM cycle
- Trigger delay: Oms

Private Sub Setup24x0() 'Setup SourceMeter(tm) system commands: Call send(intKth24x0, ":syst:beep:stat off", intStatus) 'disable beeper Call send(intKth24x0, ":syst:azer:stat off", intStatus) 'disable auto zero for speed Call send(intKth24x0, ":syst:rsen 1", intStatus) 'enable four-wire measurements 'Call send(intKth24x0, ":display:enable off", intStatus) 'disable display Call send(intKth24x0, ":rout:term rear", intStatus) 'use rear terminals 'The source is configured for the sweep from textStartCurrent to textStopCurrent 'in steps defined by textStepCurrent. The sweep will use the best fixed range 'to prevent the inherent dicontinuities of range changing from being seen by the 'analysis code as kink. The source delay is also set to accommodate the cable and 'DUT capacitive loading. Call send(intKth24x0, ":sour:func curr", intStatus) 'source current Call send(intKth24x0, ":sour:curr:start " & textStartCurrent, intStatus) 'set start (min.) Call send(intKth24x0, ":sour:curr:stop " & textStopCurrent, intStatus) 'set stop (max.) Call send(intKth24x0, ":sour:curr:step " & textStepCurrent, intStatus) 'set step Call send(intKth24x0, ":sour:curr:mode sweep", intStatus) 'enable sweep mode Call send(intKth24x0, ":sour:swe:rang best", intStatus) 'use best fixed range Call send(intKth24x0, ":sour:swe:spac lin", intStatus) 'select linear sweep Call send(intKth24x0, ":sour:del " & txtSourceDelay, intStatus) 'set source delay 'The 24x0 will source current and measure the forward junction voltage 'across the laser diode. Both current and voltage will be passed to 'the analysis portion of the code. Call send(intKth24x0, ":sens:volt:nplc " & comboNPLC, intStatus) 'set NPLC per input param. Call send(intKth24x0, ":sens:func:conc off", intStatus) 'turn off concurrent meas. Call send(intKth24x0, ":sens:func 'volt'", intStatus) Call send(intKth24x0, ":sens:volt:prot 5", intStatus) 'sense voltage (V forward of LD) 'limit output voltage to 5V Call send(intKth24x0, ":sens:volt:range 20", intStatus) Call send(intKth24x0, ":form:elem volt,curr", intStatus) 'read both voltage and current Call send(intKth24x0, ":format:data sre;bord swap", intStatus) 'binary format Call send(intKth24x0, ":stat:meas:enab 512", intStatus) 'mask "buffer full" byte Call send(intKth24x0, "*sre 1", intStatus) 'mask "measurement summary bit" for SRQ 'Trigger layer is used to keep track of triggers from the front facet 'photodetector meter. The trigger count will be set later. Call send(intKth24x0, ":arm:sour imm", intStatus) 'bypass arm layer Call send(intKth24x0, ":arm:count inf", intStatus) Call send(intKth24x0, ":trig:clear", intStatus) 'clear triggers Call send(intKth24x0, ":trig:sour tlink", intStatus) 'use trigger link Call send(intKth24x0, ":trig:ilin 1", intStatus) 'input trigger on line 1 Call send(intKth24x0, ":trig:olin 2", intStatus) 'output trigger on line 2 Call send(intKth24x0, ":trig:input source", intStatus) 'wait for input trigger before 'changing source Call send(intKth24x0, ":trig:outp del", intStatus) 'output trigger after soaking device 'new source current value Call send(intKth24x0, ":trig:dir source", intStatus) 'bypass first input trigger Call send(intKth24x0, ":trig:delay 0", intStatus) 'set trigger delay to OmS

End Sub

Model 2500 Dual Photodiode Meter programming

The code fragment below is a subroutine that sets up the Model 2500 to measure current from both photodiodes using the 20mA range on both channels. Operating modes are set as follows:

- Data format: channel 1 and channel 2 current, binary format
- Channel 1 NPLCs: set during program execution (0.01 to 10)
- Channel 1 current range: 20mA (set during program execution)
- Channel 1 voltage bias source: 10V range, value checked and set during program execution
- Channel 1 source delay: 0
- Channel 1 ground connect mode: enabled
- Channel 2 NPLCs: set during program execution (0.01 to 10)
- Channel 2 current range: 20mA (set during program execution)
- Channel 2 voltage bias source: 10V range, value checked and set during program execution
- Channel 2 source delay: 0
- Channel 2 ground connect mode: enabled
- Arm source: immediate (bypass arm layer)
- Arm count: 1
- Arm direction: acceptor (wait for trigger event)
- Trigger source and lines: trigger link, line 1 output, line 2 input
- Trigger input: wait for trigger before measuring
- Output trigger: trigger after settling
- Trigger event bypass: do not bypass on first pass through trigger layer
- Data store format: channel 1 and channel 2 currents

Private Sub Setup2500() 'General instrument configuration Call send(intKth2500, ":form:elem curr1,curr2", intStatus) 'output only current readings Call send(intKth2500, ":form:data sre;bord swap", intStatus) 'binary format 'Call send(intKth2500, ":syst:key 16", intStatus) 'toggle display to show both channels ****** Configure Channel 1 of 2500 * * * * * * * * * * 'Setup sense circuitry for 20mA range Call send(intKth2500, ":sens1:curr:nplc " & comboNPLC, intStatus) 'set NPLC using input Param. Call send(intKth2500, ":sens1:curr:rang " & textNlCurrRange, intStatus) '20mA range 'Setup source to bias the front facet photodiode. Call send(intKth2500, ":sour1:volt:range 10", intStatus) 'set range to 10V If textNlBias > 10 Then: textNlBias = 10 If textNlBias < -10 Then: textNlBias = -10 Call send(intKth2500, ":sourl:volt " & textNlBias, intStatus) 'set bias output Call send(intKth2500, ":sour1:delay 0", intStatus) 'set source delay to zero Call send(intKth2500, ":sour1:gcon 1", intStatus) 'enable ground connect relay ' ******* Configure Channel 2 of 2500 ********* 'Setup sense circuitry for 20mA range Call send(intKth2500, ":sens2:curr:nplc " & comboNPLC, intStatus) 'set NPLC using input Param. Call send(intKth2500, ":sens2:curr:rang " & textN2CurrRange, intStatus) '20mA range 'Setup source to bias the photodiode with 5V. Call send(intKth2500, ":sour2:volt:range 10", intStatus) 'set range to 10V If textN2Bias > 10 Then: textN2Bias = 10 If textN2Bias < -10 Then: textN2Bias = -10 Call send(intKth2500, ":sour2:volt " & textN2Bias, intStatus) 'set bias output Call send(intKth2500, ":sour2:delay 0", intStatus) 'set source delay to zero Call send(intKth2500, ":sour2:gcon 1", intStatus) 'enable ground connect relay 'Setup Trigger Model: Bypass both arm layers and use trigger 'layer to synch with trigger from 24x0. Call send(intKth2500, ":arm:sour imm", intStatus) 'bypass arm layer 1 Call send(intKth2500, ":arm:coun 1", intStatus) 'set scan count Call send(intKth2500, ":arm:dir acc", intStatus) 'wait for trigger event Call send(intKth2500, ":trig:clear", intStatus) Call send(intKth2500, ":trig:sour tlink", intStatus) 'clear triggers 'use trigger link Call send(intKth2500, ":trig:ilin 2", intStatus) 'input trigger on line 2 Call send(intKth2500, ":trig:olin 1", intStatus) 'output trigger on line 1 Call send(intKth2500, ":trig:input sense", intStatus) 'wait for input trigger before Call send(intKth2500, ":trig:outp sense", intStatus) 'output trigger after setting Call send(intKth2500, ":trig:dir acceptor", intStatus) 'do not bypass on first pass Call send(intKth2500, ":trac:feed calc3,calc4", intStatus) End Sub

Model 2510 TEC SourceMeter programming

The code fragment shown below is a subroutine that conditionally sets up the following Model 2510 operating modes:

- Current protection limit: 1A
- Sensor type: thermistor
- · Thermistor sensor current range: auto
- Thermistor sensor measurement range: 10kΩ
- Temperature setpoint: set during program execution

Private Sub comboTempOnOff_Click()

```
If comboTempOnOff.Text = "ON" Then
Call send(intKth2510, "*rst", intStatus)
                                                               ' 1A current limit
Call send(intKth2510, ":sens:curr:prot:lev 1.0", intStatus)
                                                               ' Thermistor sensor type
Call send(intKth2510, ":sens:temp:tran ther", intStatus)
Call send(intKth2510, ":sens:temp:curr:auto on", intStatus)
                                                               ' Auto sensor current range
Call send(intKth2510, ":sens:temp:ther:range le4", intStatus) ' 10k ohm sensor resistance range
Call send(intKth2510, ":sour:temp:spo " & comboTempSetPoint.Text, intStatus) ' Program setpoint
Call send(intKth2510, ":outp on", intStatus)
                                                                ' Turn on output
                                                                ' Get TEC AC resistance
Call send(intKth2510, ":meas:res:ac?", intStatus)
Call enter(strData, 100, intLength, intKth2510, intStatus)
txtTECRes.Text = strData
Call send(intKth2510, ":outp on", intStatus)
```

Else

Call send(intKth2510, "*rst", intStatus)

End If

End Sub

Specifications are subject to change without notice.

All Keithley trademarks and trade names are the property of Keithley Instruments, Inc. All other trademarks and trade names are the property of their respective companies.



Keithley Instruments, Inc.

BELGIUM:	Keithley Instruments B.V.
CHINA:	Keithley Instruments China
FRANCE:	Keithley Instruments Sarl
GERMANY:	Keithley Instruments GmbH
GREAT BRITAIN:	Keithley Instruments Ltd.
INDIA:	Keithley Instruments GmbH
ITALY:	Keithley Instruments s.r.l.
KOREA:	Keithley Instruments Korea
NETHERLANDS:	Keithley Instruments B.V.
SWITZERLAND:	Keithley Instruments SA
TAIWAN:	Keithley Instruments Taiwan

28775 Aurora Road • Cleveland, Ohio 44139 • 440-248-0400 • Fax: 440-248-6168 1-888-KEITHLEY (534-8453) www.keithley.com

Bergensesteenweg 709 • B-1600 Sint-Pieters-Leeuw • 02/363 00 40 • Fax: 02/363 00 64 Yuan Chen Xin Building, Room 705 • 12 Yumin Road, Dewai, Madian • Beijing 100029 • 8610-6202-2886 • Fax: 8610-6202-2892 3, allée des Garays • 91127 Palaiseau Cédex • 01 64 53 20 20 • Fax: 01 60 11 77 26 Landsberger Strasse 65 • D-82110 Germering • 089/84 93 07-40 • Fax: 089/84 93 07-34 Unit 2 Commerce Park, Brunel Road • Theale • Reading • Berkshire RG7 4AB • 0118 929 7500 • Fax: 0118 929 7519 Flat 2B, WILLOCRISSA • 14, Rest House Crescent • Bangalore 560 001 • 91-80-509-1320/21 • Fax: 91-80-509-1322 Viale San Gimignano, 38 • 20146 Milano • 02-48 39 16 01 • Fax: 02-48 30 22 74 2FL., URI Building • 2-14 Yangjae-Dong • Seocho-Gu, Seoul 137-130 • 82-2-574-7778 • Fax: 82-2-574-7838 Postbus 559 • NL-4200 AN Gorinchem • 0183-635333 • Fax: 0183-630821 Kriesbachstrasse 4 • 8600 Dübendorf • 01-821 94 44 • Fax: 01-820 30 81 IFL., 85 Po Ai Street • Hsinchu, Taiwan, R.O.C. • 886-3-572-9077 • Fax: 886-3-572-9031