

FEMALE - FEMALE ADAPTER

R222.705.240

Series: SMP

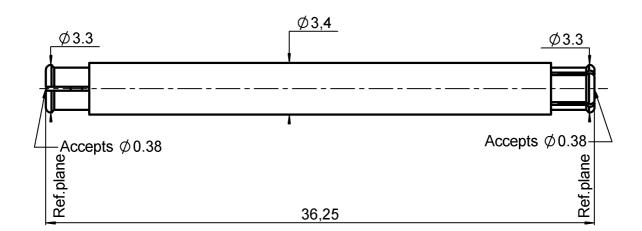

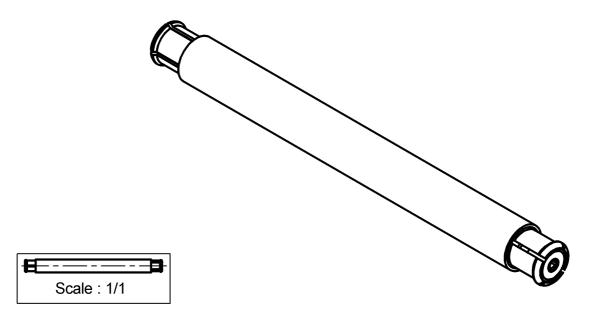

All dimensions are in mm.

COMPONENTS	MATERIALS	PLATING (μm)
BODY CENTER CONTACT OUTER CONTACT INSULATOR GASKET OTHERS PARTS -	BERYLLIUM COPPER BERYLLIUM COPPER - PTFE	GOLD 1.3 OVER NICKEL 2 GOLD 1.3 OVER NICKEL 2
OUTER CONTACT INSULATOR GASKET OTHERS PARTS	-	_

Issue: 0717 A

In the effort to improve our products, we reserve the right to make changes judged to be necessary.



FEMALE - FEMALE ADAPTER

R222.705.240

Series: SMP

PACKAGING

	'W' option	Contact us
Standard	Unit	Other

SPECIFICATION

ELECTRICAL CHARACTERISTICS

 $\begin{array}{ccc} \text{Impedance} & & \textbf{50} \;\; \Omega \\ \text{Frequency} & & \textbf{0-40} \;\; \text{GHz} \end{array}$

VSWR 1.7 + 0,0000 x F(GHz) Maxi

Insertion loss $0.12 \sqrt{F(GHz)}$ Maxi

RF leakage - (NA - F(GHz)) dB Maxi

Voltage rating
Dielectric withstanding voltage

335 Veff Maxi
500 Veff mini

Insulation resistance $\frac{500}{1000}$ M Ω mini

ENVIRONMENTAL

Operating temperature -65/+165 ° C

Hermetic seal NA Atm.cm3/s

Panel leakage NA

OTHER CHARACTERISTICS

Assembly instruction

Others:

MECHANICAL CHARACTERISTICS

Center contact retention

Axial force – Mating end
Axial force – Opposite end
Torque

6.7 N mini
6.7 N mini
NA N.cm mini

Recommended torque

Mating NA N.cm Panel nut NA N.cm

Mating life 100 Cycles mini

Weight **1,8800** g

Issue: 0717 A

In the effort to improve our products, we reserve the right to make changes judged to be



FEMALE - FEMALE ADAPTER

R222.705.240

Series: SMP

ADDITIONAL INFORMATIONS MOUNTING AND REPLACEMENT INSTRUCTIONS

1 - INFORMATIONS

Mechanical durability: 100 cycles -> full detent connector . : 500 cycles -> limited detent connector .

: 1000 cycles-> smooth bore connector .


Axial misalignement = 0/+0.25 mm. Radial misalignement = ± 0.25 mm.

Force to: engage - disengage - connector Full det: 66.75 N maxi - 22.25 N mini - FULL DETENT Limited: 44.5 N maxi - 8.9 N mini - LIMITED DET. Smooth b: 8.9 N maxi - 2.225 N mini - SMOOTH BORE

2 - MOUNTING AND REPLACEMENT

Adaptor must be mounted or removed with tooling R282.918.100.

2-1 - Push in F direction to open the tool .

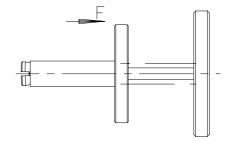

2-2 - Place the adaptor into the tool , until it bottoms against .



2-3 - Push on the adaptor , and release
 the smallest tool diameter.
 (the force to fixe the adaptor is
 applied by a spring) .



- 2-4 Push on the biggest tool diameter to place the adaptor .
 - To remove the adaptor , pull off on the biggest tool diameter .

Issue: 0717 A

In the effort to improve our products, we reserve the right to make changes judged to be necessary.

