വയയി	ПП
]GO	LnJ

Reason for

Modification:

Model: Bellini-C2 Finisher (SR841)

Modified Article: Pawl Stopper Open And Close Bracket

☐ Parts catalog correction

☐ To facilitate assembly

☐ Part standardization

From: 2nd Tech. Support Sec. Service Support Dept.

Modification Bulletin

[Date	e: 8-Sep-04		No.: MB706001	
Bracket		Prepared	by: M.	Matsuda	
ot.					
☐ Vendo	or cha	ange	☐ To m	neet standards	
⊠ To imp	orove	e reliability	()	

PAGE: 1/1

Old part	New part	Description	Q'ty	Int	Page	Index	Note
number	number						
B6744526	B7064526	Pawl Stopper Open And Close Bracket	1	X/O	9	32	

Other

Changed: Material

Reason: To increase latitude against peeling from contact with the stripper pawl.

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
SR841	208-240/50,60	USA, Europe, etc	B706-17	K3140300001
OIXO41	220-240/50, 60	Europe(Danka)	B706-26	5C30440001

Modification Bulletin

·	
Prepared by: M. Matsuda	

PAGE: 1/1

Modified Article: Pawl Stopper Motor Bracket			Prepared by: M. Matsuda		
From: 2nd Tech. Sup	pport Sec. Service Support De	pt.			
Reason for Modification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vendor change of the last o	J	☐ To meet standards ()	

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B6744619		Pawl Stopper Motor Bracket	1	X/O	9	12	
D07 44013	D7 00-1013	i awi otoppei iviotoi biacket		7,10	J	12	

Changed: Part number only Reason: Parts control

Model: Bellini-C2 Finisher (SR841)

NOTE: The old bracket was used on the SR841 and SR860. The new one is only for the

SR841.

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
SR841	208-240/50,60	USA, Europe, etc	B706-17	K3140300001
31041	220-240/50, 60	Europe(Danka)	B706-26	5C30440001

Reason for

Modification:

Model: Bellini-C2 Finisher (SR841)

Modified Article: Decal:misfed Removal:paper

From: 2nd Tech. Support Sec. Service Support Dept.

Modification Bulletin

	Date	e: 8-Sep-04		No.: MB706003	}
		Prepared	by: м.	Matsuda	
ot.					
☐ Vend	lor ch	ange	☐ To m	neet standards	
☐ To in	nprove	e reliability	()	

PAGE: 1/1

Old part	New part	Description	Q'ty	Int	Page	Index	Note
number	number						
B4787020	B7067020	Cover:Front:Sub-ass'y	1	X/O	7	15	
B4787721	B7067721	Decal:misfeed Removal:Paper	1	X/O	7	17	

Changed: Illustration on decal for removing misfeed Reason: This finisher can handle output from a Z-fold unit

☐ Parts catalog correction

☐ To facilitate assembly

☐ Part standardization

MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NO.
SR841	208-240/50,60	USA, Europe, etc	B706-17	K3140300001
011041	220-240/50, 60	Europe(Danka)	B706-26	5C30440001



Modification Bulletin

PAGE: 1/

Model: Bellini-C2 Finisher (SR841) Date					4	No.: MB706004	
Modified Article: TRAY:AUXILIARY					Prepared by: M.Matsuda		
From: 2nd Tech. Su	pport Sec. Service Support De	pt.					
Reason for	☐ Parts catalog correction	☐ Vend	lor ch	ange	☐ To n	neet standards	
Modification:	dification: ☐ To facilitate assembly ☐ To improve re		☐ To improve reliability		()	


Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
	B0391321	HOLDER:OPERATING INSTRUCTIONS:A5-NRC:ASS'Y	1		7	*37	
	B7067621 TRAY:AUXILIARY		1		7	*38	
	B7067631	TRAY:AUXILIARY:SHIFT TRAY	1		7	*39	


*: New Index

Change: Parts added. **Reason:** To improve paper stack accuracy for Z-fold paper.



B0391321 HOLDER:OPERATING INSTRUCTIONS:A5-NRC:ASS'Y

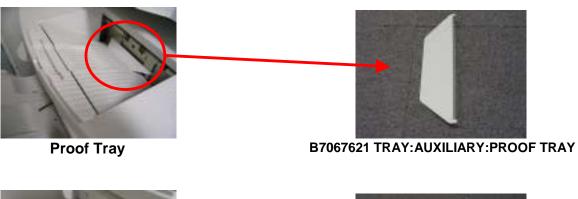

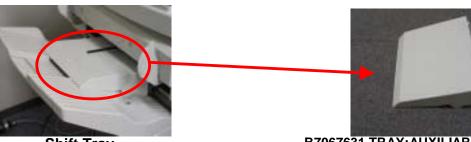

B7067631 TRAY: AUXILIARY: SHIFT TRAY Shift Tray

Modification Bulletin


PAGE:	1/1
-------	-----

Model: Bellini-C2 Finisher (SR841)				e: 19-Nov-04		No.: MB706005	
Modified Article: Jogger Fence					Prepared by: M.Matsuda		
From: 2nd Tech. Support Sec. Service Support Dept.							
Reason for	☐ Parts catalog correction	☐ Vendor	r cha	ange	☐ To m	neet standards	
Modification:	☐ To facilitate assembly	☐ To improve reliability		e reliability	()	
	☐ Part standardization	☐ Other					

Old part	New part	Description	Q'ty	Int	Page	Index	Note
number	number						
B3024611	B7064611	JOGGER FENCE:FRONT:ASS'Y	1	X/O	13	12	
	B7064631	GUIDE:JOGGER FENCE:FRONT	1		13	*24	

*: New Index

Change: Guide added, assembly P/N changed. **Reason:** To further improve the accuracy of the jogger fence.

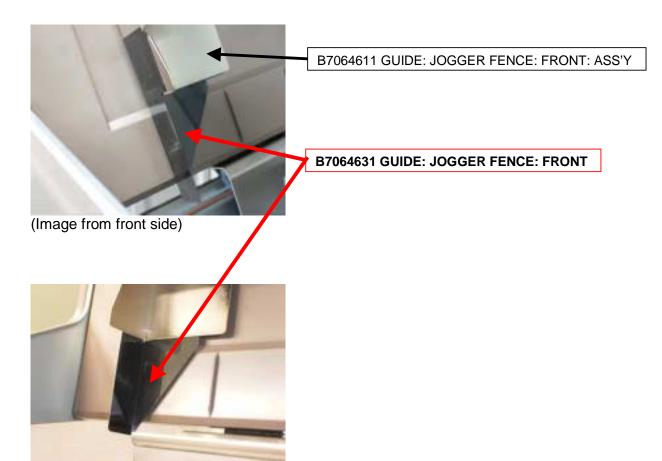

(Image from rear side)

RM M	牊
(K(I)	吅

Reason for

Modification:

Model: Bellini-C2 Finisher (SR841)

Modified Article: Exit Guide Plate

From: 2nd Tech. Support Sec. Service Support Dept.

☐ Parts catalog correction

☐ To facilitate assembly

□ Part standardization

Modification Bulletin

☐ Other

Date: 20-Dec-04			4	No.: MB706006
		Prepared	by: S. I	Ishizu
ot.				
☐ Vendor change		☐ To m	neet standards	
☐ To improve reliability			()

PAGE: 1/1

Old part	New part	Description	Q'ty	Int	Page	Index	Note
number	number						
B3024712	B4784712	GUIDE PLATE:STAPLER TRAY	1	X/O	13	14	
B3021124	B4781134	SUPPORTING PLATE:FRAME	1	X/O	47	15	
B3021194	B4781192	BRACKET:COUPLING:UPPER	1	X/O	33	9	
B4784411	B4784412	SIDE	1	X/O	17	4	
		PLATE:REAR:STAPLER:ASS'Y					
B4781141	B4781143	BRACKET:COUPLING:GROUN	1	X/O	7	22	
		D PLATE:FRONT					
B3024312	B4784311	SIDE PLATE:FRONT:STAPLER	1	X/O	17	18	
B3024749	B4784749	STAY:STAPLER:MIDDLE	1	X/O	13	9	
B3026612	B4786612	INNER COVER:FRONT	1	X/O	7	14	
B3026651	B4786651	INNER COVER:STAPLER UNIT	1	X/O	11	1	

Change/Reason: Parts standardization with the Victoria and Victoria-B.

	ПП
(G(0)	삚

Reason for

Modification:

Model: Bellini-C2 Finisher (SR841)

Modified Article: Standard Fence

From: 2nd Tech. Support Sec. Service Support Dept.

☐ Parts catalog correction

☐ To facilitate assembly

☐ Part standardization

Modification **B**ulletin

☐ Other

	ate: 20-0	Dec-04	No.: MB706007
	Prepa	ared by: S.	Ishizu
ot.			
☐ Vendor change		□То	meet standards
	rove reliab	oility ()

PAGE: 1/1

Old part	New part	Description	Q'ty	Int	Page	Index	Note
number	number						
B4784531	B7064531	Standard Fence: Rear: Auxiliary:	1	X/O	15	8	
		Ass'y					

Change: The attachment position of the rear standard fence was changed.

Reason: To improve stapling accuracy.

Reason for

Modification:

Model: Bellini-C2 Finisher (SR841)

Modified Article: Harness:motor

From: 2nd Tech. Support Sec. Service Support Dept.

☐ Parts catalog correction

☐ To facilitate assembly

☐ Part standardization

Modification Bulletin

	Date: 8-Feb-05			No.: MB706008
Prepared			by: S.Is	shizu
Vendor change			☐ To m	neet standards
To improve reliability			()

PAGE: 1/1

Old part	New part	Description	Q'ty	Int	Page	Index	Note
number	number						
B4785220	B4785221	HARNESS:MOTOR:SHIFTTRAY	1 -> 1	X/O	43	36	
B4785466	B4785467	HARNESS:MOTOR	1 -) 1	X/O	43	29	
		CONTROL:SHIFT:JOGGER					
B4785370	B4785371	HARNESS:MOTOR:STAPLE	1→1	X/O	43	35	
		TRAY					

○ Other

Changes:

- 1) B4785220 → B4785221: The length was increased from 280mm to 300mm, and insulating tape was added.
- 2) B4785466 → B4785467: The length was increased from 580mm to 600mm, and insulating tape was added.
- 3) B4785370 \rightarrow B4785371: The harness binder was moved closer to the PCB connector.

Reason: Parts standardization with the Victoria-B.

MODEL NAME V/Hz		DESTINATION	CODE	SERIAL NO.	
CD041	208-240/50,60	USA, Europe, etc	B706-17	K3140300001	
SR841	220-240/50, 60	Europe(Danka)	B706-26	5C30440001	

Modification **B**ulletin

PAGE: 1/1

Model: Bellini-C2 Finisher (SR841) Dat			ite: 26-Apr-0	5	No.: MB706009
Modified Article: PCB:Main Control				by: S.I	shizu
From: 2nd Tech. Support Sec. Service Support Dept.					
Reason for	☐ Parts catalog correction	☐ Vendor o	hange	☐ To n	neet standards
Modification: ☐ To facilitate assembly ☐ To impro		ve reliability	()	
	☐ Part standardization	Other			

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B7065131	B7065132	PCB:Main Control	1	X/O	43	17	
B7065106	B7065107	Eprom:Main Control:Combination For Rom	1	X/O	43	40	

Change/Reason: The software for the SR841 finisher was changed.

Note: For details, see the SR841 firmware release note.

MODEL NAME V/Hz		DESTINATION	CODE	SERIAL NO.	
SR841	208-240/50,60	USA, Europe, etc	B706-17	K3140900001	
SR841	220-240/50, 60	Europe(Danka)	B706-26	5C30840058	

Modification Bulletin

			l	
⊦ ∽∙	11	1I. O.E.	No • MD7066	140

PAGE: 1/1

Model: Bellini-C2 Finisher (SR841) Date			Date	e: 14-Jul-05	5	No.: MB706010
Modified Article: P		Prepared by: S.Ishizu				
From: 2nd Tech. Support Sec. Service Support Dept.						
Reason for Modification:			prove	ange e reliability	□ To n	neet standards)
	☐ Part standardization	☐ Other				

Incorrect			Q'ty	Page	Index	Note
Part Number	Part Number					
AW020086		Photointerruptor	1	15	38	
	AW010091	Photo Reflection Sensor	1	15	38	

Change/Reason: The P/N and description were corrected.

Modification **B**ulletin

PAGE: 1/1

Model: Bellini-C2 Finisher (SR841)			ate: 26-Aug-05		No.: MB706011	
Modified Article:	Parts Catalog Correection			Prepared	by: S. W.	ATANABE
From: 2nd Tech. S	upport Sec. Service Support	Dept.				
Reason for	□ Parts catalog correction	☐ Vendor	cha	ange	Other	
Modification:	☐ To facilitate assembly	☐ To impr	ove	e reliability	☐ To mee	et standards
	☐ Part standardization	☐ Product	Sa	afety	()

Change/Reason: The following index numbers were corrected.

Pg. 3

Part number	Description	Old index	New Index	Note
B5132110	Jogger Fence: front ass'y	18	23	
B5132120	Jogger Fence: inner back ass'y	23	18	