




Tech Tip	
PRODUCT:	DLP
TIP NUMBER:	ASC20041129001
TIP DATE:	11/29/2004
MODELS:	All DLP Products

SYMPTOM: Picture is inverted

REPAIR: Enter the service mode; under option menu DDP1010 (DDP1011, where applicable) adjust the V-Flip option back to normal. If the problem continues replace the DMD Board

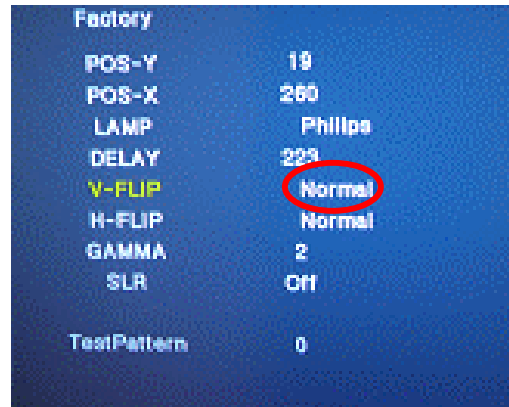

Note: Consult the Samsung Service Website at (www.samsungasc.com) for the Service Manual and other information on this product.